


Leak Report



22 William Street McCrae Victoria 3938 Australia

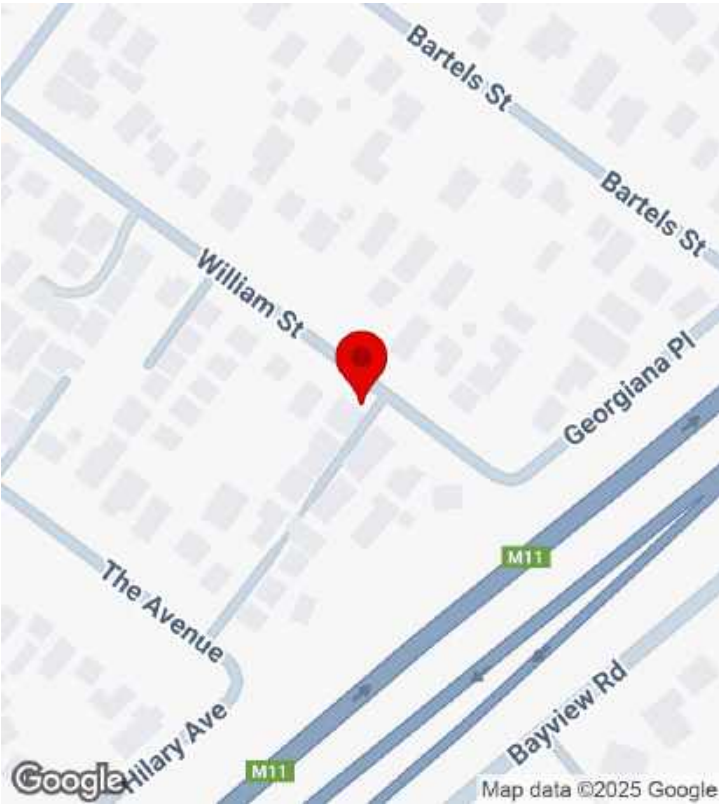

CREATED

🕒

17/01/2025, 10:11:41 am

👤

by Morgan Williams

LOCATION

📍

-38.352518, 144.930250

PROJECT

📁

Downer

Leak Address	22 William Street McCrae Victoria 3938 Australia
Zone	South East Water ► Reactive Leaks
Leak Asset Type	Mains
Flow Rate (L/min)	0.3
Has the leak been called in by DS Technician?	No
Job Ref	1301391/001
Leak Visible	Yes

Comments

Suspect there's a small leak on the main here. I have ran a quick correlation here, but correlation didn't bring up anything, but there's not much noise here. There's only a very slight noise on the Fire plug further up.

I have probed down in naturestrip, but I'm unable to get onto the main to listen directly as it's 80mm AC here, so im probably just missing the main. I did listen anyway, and I think I might be picking up the faintest of noise, but it's hard to tell.

This is directly in line with the main and its seeping down driveway now, and the customer is concerned due to the incident down Penny Lane. I think it's just a very small leak on the main here, and I'm just unable to hear it. I'm unable to test the water myself.

Suggest excavating around wet patch to expose main.

MW

1.5hr travel & 1.5hr onsite

Photo

