



Expert Hydrogeological Report

Board of Inquiry, McCrae Landslide

Prepared for
MinterEllison

Prepared by
Australian Environmental Auditors Pty Ltd

Date
21 July 2025

Job No.
EA1242



Expert Hydrogeological Report

Board of Inquiry, McCrae Landslide

Prepared for:

MinterEllison

Prepared by:

Australian Environmental Auditors Pty Ltd
Suite 21, 1 Ricketts Road
Mount Waverley, VIC 3149

Date of Report:

21 July 2025

Author:

Irrelevant & Sensitive

Phillip Hitchcock
Principal Hydrogeologist

Version Control Record

Document File Name	Auditor	Internal Reviewer	Distribution
EA1242	PH	LH/CB	- MinterEllison - Australian Environmental Auditors Pty Ltd
Version	Date Issued	Date Reviewed	
Final	21 July 2025	18 July 2025	

Australian Environmental Auditors Pty Ltd
ABN 84 161 362 214 ACN 161 362 214

Melbourne
Wurundjeri Country
Suite 21, 1 Ricketts Rd
Mt Waverley VIC 3149
T 03 8542 7500

Adelaide
Karna Country
335 Carrington St
Adelaide SA 5000
T 08 8223 3488

Contaminated Land Auditing | Landfill Auditing | Expert Advice
W environmental-auditors.com.au E enquiries@envaud.com.au

Perth
Whadjuk Country
7/80 Colin St
West Perth WA 6005
T 08 6268 0181

Sydney
Gadigal Country
T 02 8644 0681
Canberra
Ngunnawal Country
T 02 8644 0681

Brisbane
Turrbal Country
T 07 3074 9422
Launceston
Palawa Country
T 03 6289 8918



List of Abbreviations

Abbreviation	Description
EC	Electrical Conductivity
GFR	Geotechnical Factual Report
GRR	Groundwater Resource Report
LRA	Landslide Risk Assessment
mAHD	Metres above Australian Height Datum
mbgl	Metres Below Ground Level
ME	MinterEllison
NP	Not Provided
RL	Reference Level
SEW	South East Water
SWL	Standing Water Level
TDS	Total Dissolved Solids
THM	Trihalomethane
TSS	Total Suspended Solids
VVG	Visualising Victoria's Groundwater
VWPs	Vibrating Wire Piezometers



1. Engagement	1
2. Qualifications	1
3. Matters Outside Expertise	2
4. Assistance.....	2
5. Potential Conflict of Interest Issues	2
6. Expert Witness Code of Conduct	2
7. Declaration.....	2
8. Documents/Files Provided and Requested.....	2
9. Background	3
9.1 Landslide.....	3
a. History Of Occurrence	3
b. Possible 2025 Landslide Causes Suggested by Others	6
9.2 Water Definitions and Characteristics.....	6
9.3 General Mechanisms of Water Flow	8
9.4 Summary of Geology	9
a. Regional	9
b. Landslide Area	10
9.5 Summary of Hydrogeology.....	14
a. Regional	14
b. Landslide Area	17
9.6 Hydrogeochemistry	23
10. Expert Opinions.....	29
10.1 Groundwater	29
10.2 Perched Water.....	29
a. Perched Water – Infiltration of rainfall	29
b. Perched Water – Stormwater Origin.....	30
c. Perched Water – Mains Origin	30
10.3 Summary.....	31

Tables

Table 1: Geotechnical units of 10-12 View Point Road, McCrae	13
Table 2: Summary of Regional Hydrogeological Investigation Findings	14
Table 3: Summary of Local Hydrogeological Investigation Findings.....	18
Table 4: Surface Water Testing Summary	23
Table 5: Summary of Relevant South East Water (SEW) Assets Maintenance Records – McCrae.....	25
Table 6: Summary of Suggested Further Assessment or Review	31

Figures

Figure 1: Locations of Historical McCrae Slope Failures	5
Figure 2: South East Water Leak Detection Survey – McCrae	6
Figure 3: Topography and Natural Drainage Paths of Arthurs Seat	9
Figure 4: Queenscliff Geology.....	10
Figure 5: Geological Mapping of the McCrae Landslide Evacuation Order Area.....	11
Figure 6: Geological Model of 10-12 View Point Road, McCrae Post-2022 Landslide Event.....	13
Figure 7: Conceptual regional hydrogeological model	15
Figure 8: My Mapping of Regional Groundwater Investigation Locations – Dromana Sewer Line	16
Figure 9: Location of Investigation Locations within the Landslide Area	21
Figure 10: Location of Local and Regional Investigation Locations and SEW Assets	22
Figure 11: My Piper Plot of Surface Water – McCrae	24

Attachments

Attachment 1	Instructions
Attachment 2	Phillip Hitchcock CV
Attachment 3	Extract from Form 44A – Expert Witness Code of Conduct
Attachment 4	List of Files Provided
Attachment 5	GRR report



1. Engagement

1. On 7 July 2025, I was engaged by MinterEllison (ME) on behalf of Mornington Peninsula Shire Council (Council) to provide an expert hydrogeological report in relation to the Board of Inquiry (BOI) into the McCrae Landslide.
2. Based on the Day 1 inquiry transcripts provided, it is understood that *'The objectives of this board of inquiry are to determine the causes of the McCrae landslide; determine the adequacy of measures taken to prevent and minimise landslides and landslips in the McCrae area, including reviewing responses to the November 2022 and 5 January 2025 landslides and landslips in the area to the extent that this information is available and relevant to the McCrae landslide; and identify measures to be taken for the prevention or mitigation of the risk of similar landslide events to the McCrae landslide occurring in future in the McCrae area.'*
3. A copy of my instructions has been provided as **Attachment 1**. My interpretation of the instructions is for me to provide my opinion on the likely origins of the water involved in the landslide.

2. Qualifications

4. My current curriculum vitae is provided as **Attachment 2**.
5. I hold a Bachelor of Science (1982, Monash University) and a Master of Applied Science (1990, University of New South Wales).
6. I have over 40 years professional consulting experience and have provided professional advice in the fields of hydrogeology, contamination assessment and auditing and geotechnical engineering.
7. My current roles include:
 - a. Principal Hydrogeologist (AEA); and
 - b. Environmental Auditor (Contaminated Land).
8. I am on the expert support panel of three Environmental Auditors (Contaminated Land) in the field of hydrogeology.
9. I have been involved with over 350 contaminated land-related audits on behalf of state regulators across South Australia, Victoria, Western Australia, New South Wales and Queensland. This work typically involves creating or reviewing hydrogeological conceptual site models.
10. I am affiliated with the following organisations:
 - a. Australian Contaminated Land Consultants Association (ACLCA), and
 - b. Australian Land and Groundwater Associated Inc (ALGA).
11. With respect to the technical issues relevant to the expert opinions requested:
 - a. Following my undergraduate Geology degree I undertook a Masters in Hydrogeology,
 - b. I have conducted post graduate research and published in hydrogeology and related fields including fluoride interaction with soils,
 - c. As a consultant I have provided professional advice regarding hydrogeology in over 500 reports, and
 - d. An important part of my role as a contaminated site auditor is to provide comment and endorsement on conceptual site models to ensure that groundwater impacts are appropriately assessed.



3. Matters Outside Expertise

12. I consider that the matter I have been asked to provide expert opinion is not outside my expertise, noting I am limiting my report to whether it is likely that groundwater has contributed to the landslide rather than mechanism.

4. Assistance

13. I have been assisted by Mr Greg Foster and Ms Louise Child of Australian Environmental Auditors Pty Ltd when preparing this report. While I have been assisted, the opinions provided are my own.

5. Potential Conflict of Interest Issues

14. I have had no professional involvement with the applicants or respondents.
15. I have not previously provided any advice on the McCrae site.
16. I have no known personal relationships with any parties involved in the Proceeding which may affect the independence of this report.

6. Expert Witness Code of Conduct

17. I acknowledge that I have read the Form 44A – Expert Witness Code of Conduct (Code) provided and agree to be bound by it.

7. Declaration

18. I declare that I have made all the inquiries which I believe are desirable and appropriate and that no matters of significance have been withheld from the Court.

8. Documents/Files Provided and Requested

19. I have been provided with the following documents and files:
- a. Extract from 44A – Expert Witness Code of Conduct (**Attachment 3**).
 - b. PSM (2025b), McCrae Landslide, Evacuation Order Area – Landslide Risk Assessment (ref. PSM5665-LRA REV1), 28 May 2025.
 - c. PSM (2025c), Update to McCrae Landslide, Evacuation Order Area – Landslide Risk Assessment (ref. PSM5665-LRA REV1), 28 May 2025.
 - d. PSM (2025d), McCrae Landslide - Stormwater and Sewer Investigation, Geotechnical Factual Report (ref. PSM5665-070R Draft Rev A), 13 June 2025.
 - e. Files (total number of 5014) provided by ME which are listed in **Attachment 4** and include series 1000, 2000, 3000 and 4000.
20. In addition, I have downloaded the available inquiry transcripts from Days 1 to 10 from the Board of Inquiry and requested the following additional documents referenced therein, alongside any additional documents required based on my review of the ME files:
- a. MSC.5012.0001.4440: Cardno Lane Piper (2012), *Draft for Comment Landslide Susceptibility Assessment, Stage 2, Mornington Peninsula Shire, Victoria* (ref. 207166Report02.1), 1 February 2012.

- b. MSC.5000.0001.0639: PSM (2024), *Expert Opinion Report – Landslide Assessments, 10-12 View Point Road, McCrae* (ref. PSM526-006R Rev0), 11 June 2024.
- c. MSC.5031.0001.1289: Mornington Peninsula Shire Council (2025), *RE: Charlesworth St*, email correspondence between 28 and 30 January 2025.
- d. MSC.5007.0004.0078: PSM (2025a), *McCrae Landslide – Evacuation Order Area, Geotechnical Factual Report* (ref. PSM5665-GFR REV0), 9 April 2025.
- e. RES.0011.0001.0016: Map of Networks Leaks, undated.
- f. SEW.0001.0001.4990: South East Water (2023), Task Summaries regarding 1 Fairway Crescent, McCrae, 19 July 2023.
- g. SEW.0001.0001.0085: South East Water (2024a), Task Summaries regarding 1 Charlesworth Street and 2 Waller Place, McCrae, 28 November 2024 to 23 December 2024.
- h. SEW.0001.0001.0076: South East Water (2024b), Task Summaries regarding 4 Waller Place and 2 The Boulevard, McCrae, 16 December 2024 to 7 January 2025.
- i. SEW.0001.0001.0966: South East Water (2024c), *Re: 4 Waller Place McCrae 1295094*, internal email correspondence from South East Water, 24 December 2024 to 30 December 2024.
- j. SEW.0001.0001.0142: SMEC (2025), *Legally Privileged Multidisciplinary Expert Report, McCrae Landslip Project* (ref. 30043649), 5 May 2025.

- 21. I have reviewed these documents/files and summarised any potentially pertinent information relevant to this report in the following section. This information is drawn upon to form my opinions in **Section 10**.
- 22. I understand that the BOI has arranged an 'Expert Database', containing documents to assist in the preparation of expert reports. I have no access to the expert data base and acknowledge the information contained in this database may aid in developing my opinions set out in this report

9. Background

9.1 Landslide

a. History Of Occurrence

- 23. The occurrence of translational landslides across McCrae have been recorded since at least the early 1950s, locations of which remain within a 0.5 km radius of the most recent landslide event in 2025 and were captured by PSM Consulting (PSM; 2025b)¹ as summarised below and shown in **Figure 1**.
- 24. PSM (2025b) included a review of historical newspaper articles and aerial imagery that identified a landslide having occurred on 14 July 1952, inferred to have initiated south to south-east of 563 Point Nepean Road affecting properties between approximately 563 and 577 Point Nepean Road. The estimated depth of failure was up to 2 m, indicating debris likely consisted of colluvium (silty and clayey sands with layers of sandy clay) based on known regional geology and their greater susceptibility to reduced cohesion via saturation over short timeframes. The leading cause of this event was heavy rainfall, reporting 113 to 160 mm precipitation two days prior, in comparison to the 127 to 188 mm reported across the 30 days prior. A burst water main was also reported on Coburn Avenue around that time.
- 25. PSM (2025b) noted that during the late 1970s, based on aerial imagery reviews and site inspections, 10-12 View Point Road was potentially subject to a landslide. Aerial imagery from 1975 and 1977 show altered vegetation cover, while PSM site inspections identified signs of past instability including a 0.5 m high old head scarp, a gum tree fully rotated and lying parallel

¹ PSM (2025b), *McCrae Landslide, Evacuation Order Area – Landslide Risk Assessment* (ref. PSM5665-LRA REV1), 28 May 2025.

to the slope and tracks cut into the same section leading from the plateau to the coastal plain. PSM (2025b) also highlighted that an extended La Nina event occurred from 1973 to 1976, reflected in the above-average rainfall from July to late 1975 and May to September 1977, thereby the likely trigger for this event.

26. PSM (2025b) stated that a debris flood event occurred circa 5-6 February 2017 as recounted by a resident at 4 View Point Road where several tonnes of surficial soils were transported downslope by flood waters, triggered by a 58 mm rainfall event across the nine hours prior.
27. The next known landslide occurred on 15 November 2022 across two events, a translational slide followed by debris flow, damaging a private water main and properties at 2 Penny Lane and part of Unit 3/613 Point Nepean Road. Rainfall was in the order of 80 mm within eight hours one day prior, compared to 70 mm (Arthurs Seat) and 85 mm (Rosebud) in the 30 days prior; the reading at Rosebud was 15 to 25 mm above average for the October to November period, influenced by a La Nina weather event that occurred from September 2020 to 2023. Additionally, PSM (2025b) reviewed a report prepared by Stantec in December 2022, which reported observation of groundwater seepage at the head scarp 24 hours after the rain event. Meanwhile, South East Water (SEW) reported a water main failure at 23 Coburn Avenue on 14 November 2022, the influence of which was not confirmed regarding the landslide. There is also potential for slow creep to have been occurring as evident by leaning and curved trees.
28. PSM (2025b) documented the most recent landslide event in January 2025 which appeared to have initiated near the head of a gully at 10-12 View Point Road occurring across two stages – a translational slide on 5 January 2025 involving fill, colluvium and extremely weathered granite, followed by a debris flow on 14 January 2025 involving fill, naturally transported and in-situ soils and extremely weathered granite. The initial slide on 5 January partially resulted from progressive changes in slope loading with the failure point located below a 2 m high retaining wall, which supported garden beds, and various other retaining walls and areas of earthworks contouring and filling nearby. No rainfall was recorded at nearby weather stations on 5 January, and a period of below-average rainfall was identified in the region with only 16 mm recorded at Arthurs Seat station in the 30 days prior, which is 32 mm less than the monthly average for December to January. However, the landslide area comprised denser vegetation compared to surrounding slopes, suggesting consistent moisture in the soil likely from elevated groundwater levels causing increased soil pore pressure and, therefore, slope instability. The second slide on 14 January was deemed a transitional failure leading into a debris flow, likely a continuation of the initial slide, caused by elevated groundwater levels further weakening the slope which was already compromised by ground modifications and loss of the passive wedge in front of the retaining wall at 10-12 View Point Road. Between the two stages, further soil saturation took place with a site inspection by PSM on 6 January reporting water discharging at a rate of 0.15 to 0.20 L/second from the rear of 3 Penny Lane. No link was made to precipitation as only 10 mm was recorded on 13 January.

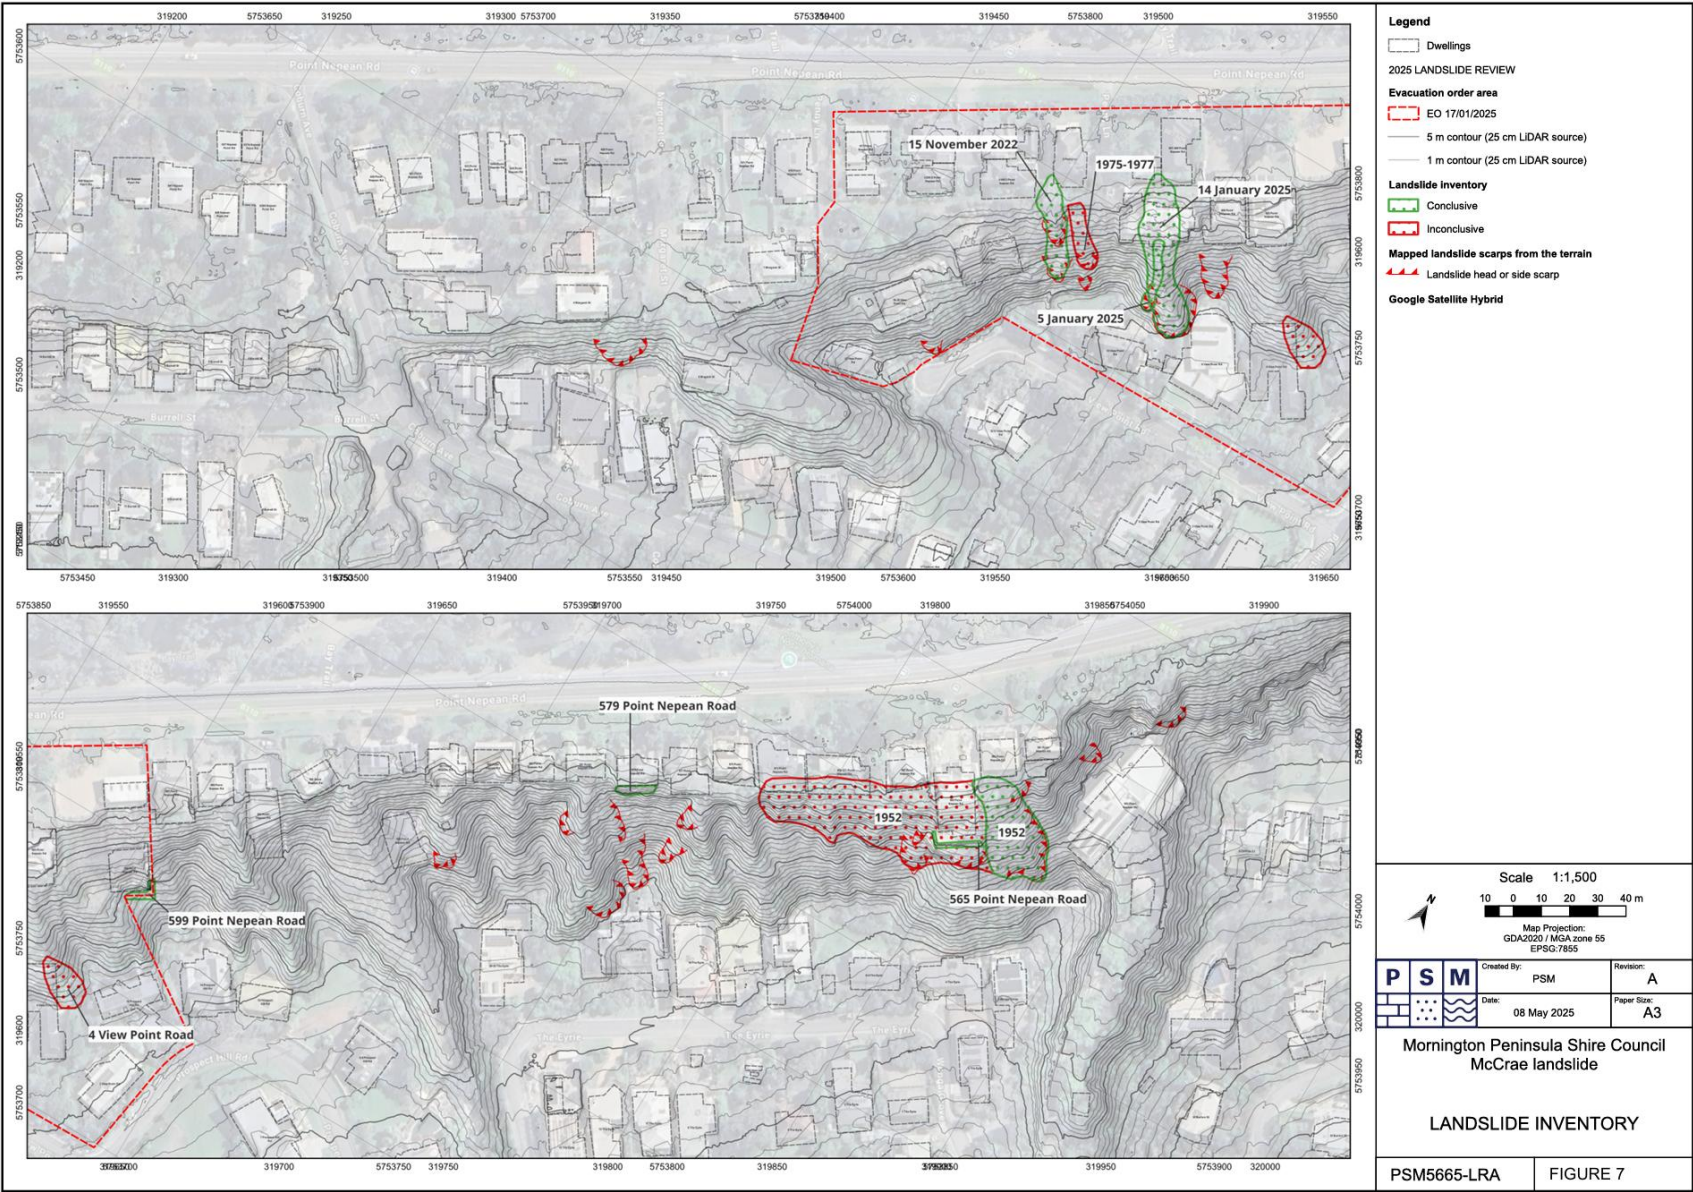


Figure 1: Locations of Historical McCrae Slope Failures
(Source: PSM 2025b)

b. Possible 2025 Landslide Causes Suggested by Others

29. PSM (2025b) considers that the cause(s) of the 2025 landslides are:

- Elevated groundwater levels causing increased soil pore water pressure, thereby reducing soil cohesion,
- Anthropogenic slope modification such as earthworks (cut and fill) above and within the failed area, and
- Loss of the resisting passive wedge in front of the retaining wall at 10-12 View Point Road, resulting from the failure on 5 January, further destabilising the slope and triggering the subsequent failure on 14 January.

30. When referring to groundwater PSM does not distinguish between regional groundwater in aquifers and seepage or perched water in the shallow soils which can be caused by:

- a. Infiltration of rainfall,
- b. Leakage of water service infrastructure in the area, such as that identified in **Figure 2**, including:
 - i. Stormwater,
 - ii. Mains supply, and
 - iii. Sewage.

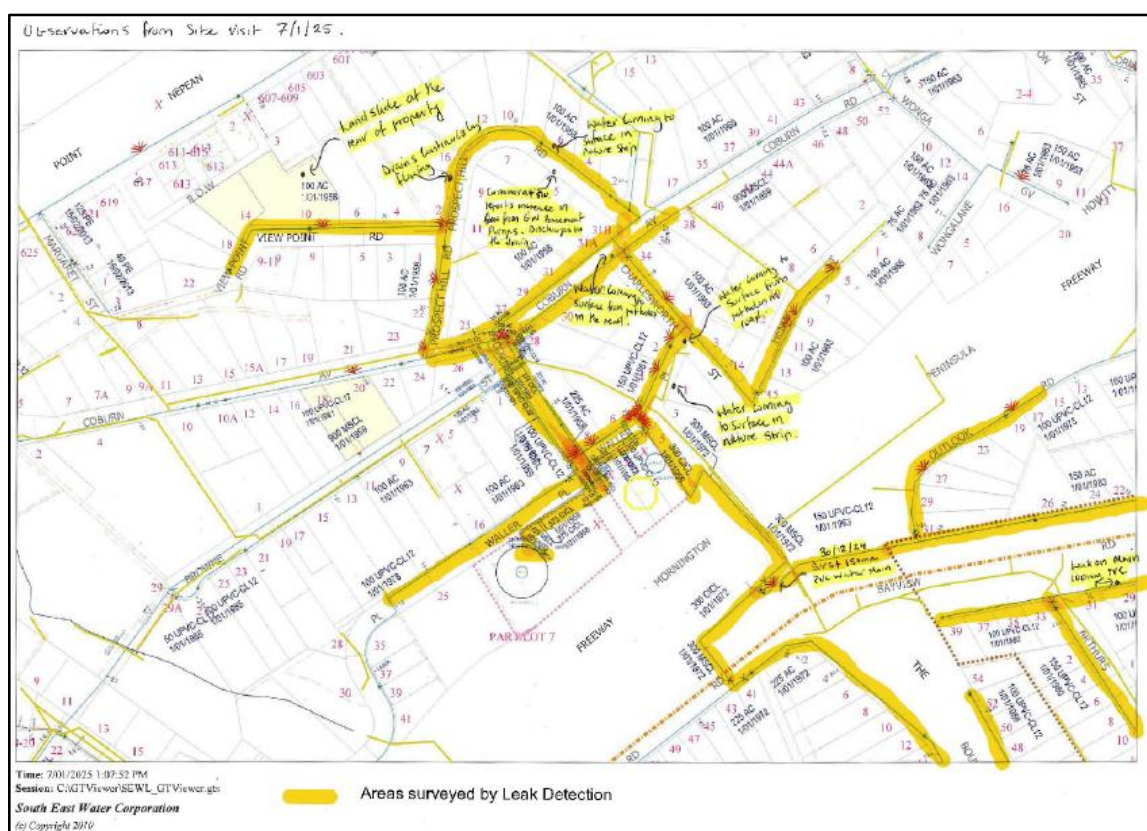


Figure 2: South East Water Leak Detection Survey – McCrae
(Source: SEW 2024b)

9.2 Water Definitions and Characteristics

31. It is noted that in the provided reports, groundwater seems to refer to any water under the ground whether it is a true aquifer system or perched water from seepage from the sources

noted above in paragraph 30. This an important distinction as the remedial actions to reduce seepage or groundwater pressures would likely be different.

32. In this report groundwater is defined as water that resides in an aquifer beneath the ground surface. An aquifer is defined as water bearing strata that provides a constant supply of water. It can either be confined, semi-confined, or unconfined. Regional groundwater resides in the aquifer for long periods and thus its chemistry is influenced by the aquifer material it is in contact with.
33. Perched groundwater is water that has infiltrated from the surface or from a leaking service and is transient in nature. It is not a continuous water source and usually is present for short periods. Its chemistry is more heavily influenced by its source and would be expected to have the following characteristics:
 - a. Rainfall – very low salinity, sodium and chloride geochemical type and no contaminants.
 - b. Stormwater – low salinity, moderate TSS and limited contaminants, and
 - c. Potable/mains water – low salinity, sodium and some impurities and additives from water treatment including chlorine, fluoride, disinfection chemicals such as trihalomethanes (THMs). Note that the presence of THMs in water is often used as an indicator of cross contamination in water laboratories.
 - d. Sewage – while sewage is a possible source based on infrastructure in the landslide area, given it would be easy to identify based on odour and colour, this has not been identified in the seepage water. This source will not be considered further in this report.
34. Based on the above, hydrochemistry can be a useful way of narrowing down a water source.
35. Indicators of a water source can be further defined via the analysis of environmental tracers and isotopes. The following definitions and processes were obtained from Dr Peter Cook (2020).²
36. Tracers – “geogenic (natural to the Earth) or anthropogenic (human created) isotopes, elements or compounds that are widely distributed in the near-surface environment of the earth, such that variations in their abundances can be used to infer environmental processes”.
37. Isotopes – “a particular category of environmental tracers and are variants of chemical elements that have the same atomic number but differ in their mass number due to different numbers of neutrons in their nucleus”.
38. It is noted that as tracers are transported along the flow line, groundwater ages progressively (with distance and depth) thus altering the ratios of tracers/isotopes.
39. Of relevance to the investigation of the January 2025 McCrae landslides, tracers/isotopes could be utilised to determine:
 - a. The level of groundwater mixing with other water sources,
 - b. The rate of groundwater recharge in unconfined aquifers, where increasing recharge rates slow groundwater ageing with depth,
 - c. Groundwater flow rates – groundwater flows horizontally in confined aquifers, aging with distance; the rate is estimated by measuring the distance between two points of known age,

² Peter Cook (2020), *Introduction to Isotopes and Environmental Tracers as Indicators of Groundwater Flow*, Version 4, September 2022.

- d. Recharge processes, such as identification of recharge areas based on elevation and temperature, or flow lines based on temperature (e.g. higher temperature may be indicative of geothermal heating),
 - e. Groundwater flow through fractures, and/or
 - f. Sources of contaminants (include salinity), which may be undertaken via the installation of piezometers at varying depths to assess the age and contaminant levels with depth and distance.
40. It should be noted that the success of tracing may be limited by factors such as influence of processes on tracers, the type of tracer employed, and the depth and screening placement of monitoring wells/piezometers.

9.3 General Mechanisms of Water Flow

Perched Water

- 41. Civiltest (2019) highlights perched water is commonly present seasonally via rainfall infiltration and is therefore more notable around winter when rainfall is highest³, otherwise where anthropogenic sources contribute such as a leaking water service whether private (e.g. irrigation system, roof stormwater runoff, etc.) or public (e.g. sewage, drinking water supply main, stormwater system) (PSM 2024).⁴
- 42. Perched water flows via gravity from an elevated point of release and infiltrates the soil, as discussed on Day 1 of the court inquiry (based on the provided transcripts). It will then continue downwards, following a path of least resistance, until it either finds a low permeability layer that limits its vertical migration, or a permeable pathway which may include service trench backfill or granular soils.
- 43. In the case of a leaking service, it is common for the released water to flow along the trench backfill material which is typically granular in nature and of high permeability thus creating a pathway. However, the trench may not be the preferential pathway if the underlying soils are more permeable, such as sand, and the presence of dune sands has been noted in the landslide area.
- 44. For the latter, water would flow under gravity and follow drainage pathways such as gullies. Several north to north-west trending gullies are present along the escarpment and within vicinity of the landslide area as documented by PSM (2024) and shown in **Figure 3**.

³ PSM.5000.0002.8868 – Civiltest (2019), *Land Stability Assessment at 599 Point Nepean Road McCrae* (ref. 1180525-2), 4 February 2019.

⁴ PSM.5000.0004.4529 – PSM Consulting (2024), *Risk Assessment 10-12 View Point Road McCrae* (ref. PSM5226-002L Rev1), 11 June 2024.

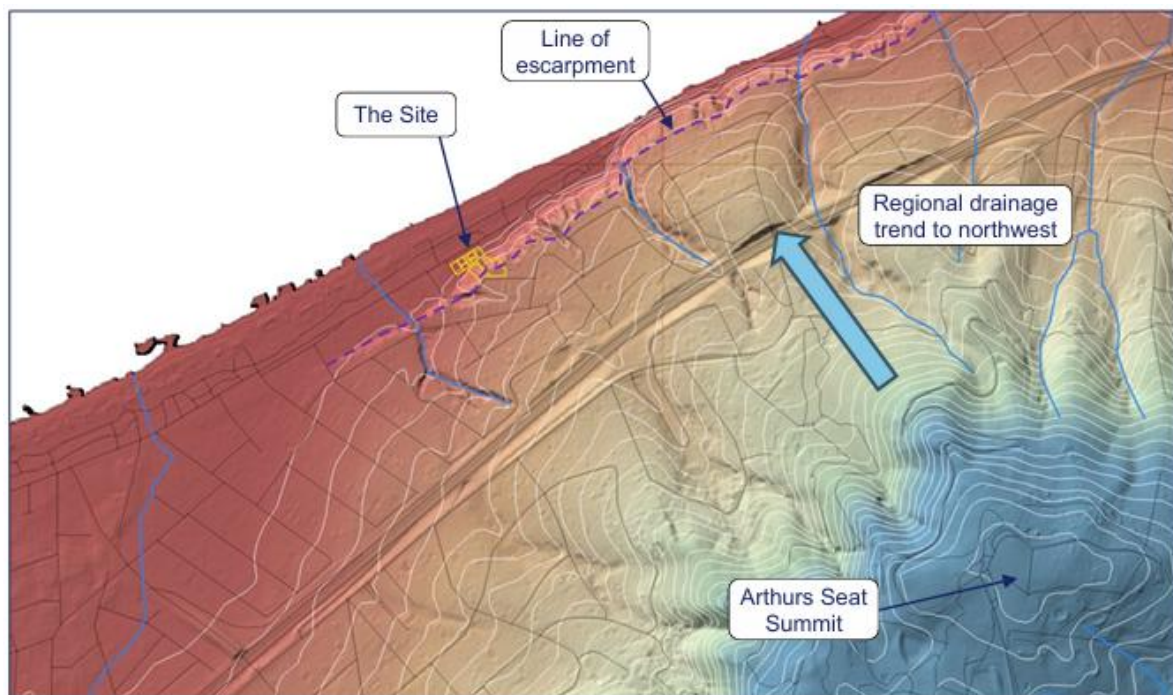


Figure 3: Topography and Natural Drainage Paths of Arthurs Seat

Notes: "The Site" refers to 10-12 View Point Road in relation to the 2022 landslip events which is adjacent to the 2025 site. (Source: PSM 2024)

45. SMEC (2025; S7.3.2.1) when discussing the results of a water main burst on 14-15 November 2022 at 23 Coburn Avenue, McCrae, discussed potential for sink holes to be created where abandoned services (e.g. stormwater drains) may be present and these may also provide a migration pathway.

Groundwater

46. In simple terms, groundwater enters the aquifer at a recharge point e.g. a rock outcrop or ground surface and then migrates vertically to the water table level in the aquifer. The point of recharge can be a significant distance to the discharge area. Near the landslip the main aquifer would be recharged at Arthurs Seat where there are granite outcrops at the surface.
47. The direction of flow in the aquifer is generally governed by the elevation of the recharge point and where groundwater ultimately discharges (usually a watercourse or the ocean/bay).

9.4 Summary of Geology

a. Regional

48. The Geological Survey of Victoria 1:250 000 Geological Map Series, Queenscliff (SJ 55-9, Ed 2, May 1997) has identified various geological forms within the region which generally comprise of alluvium, colluvium, dune deposits and granites as defined in the extract below as **Figure 4**.
49. Three faults are identified on the Queenscliff map traversing Arthurs Seat (Nepean Park) including the Selwyn Fault (running south-west to north-east), the Flinders Fault towards the south of Arthurs Seat (running north-west to south-east) and the Balcombe Fault to the east of Arthurs Seat (running south-west to north-east), alongside many surficial drainage gullies.

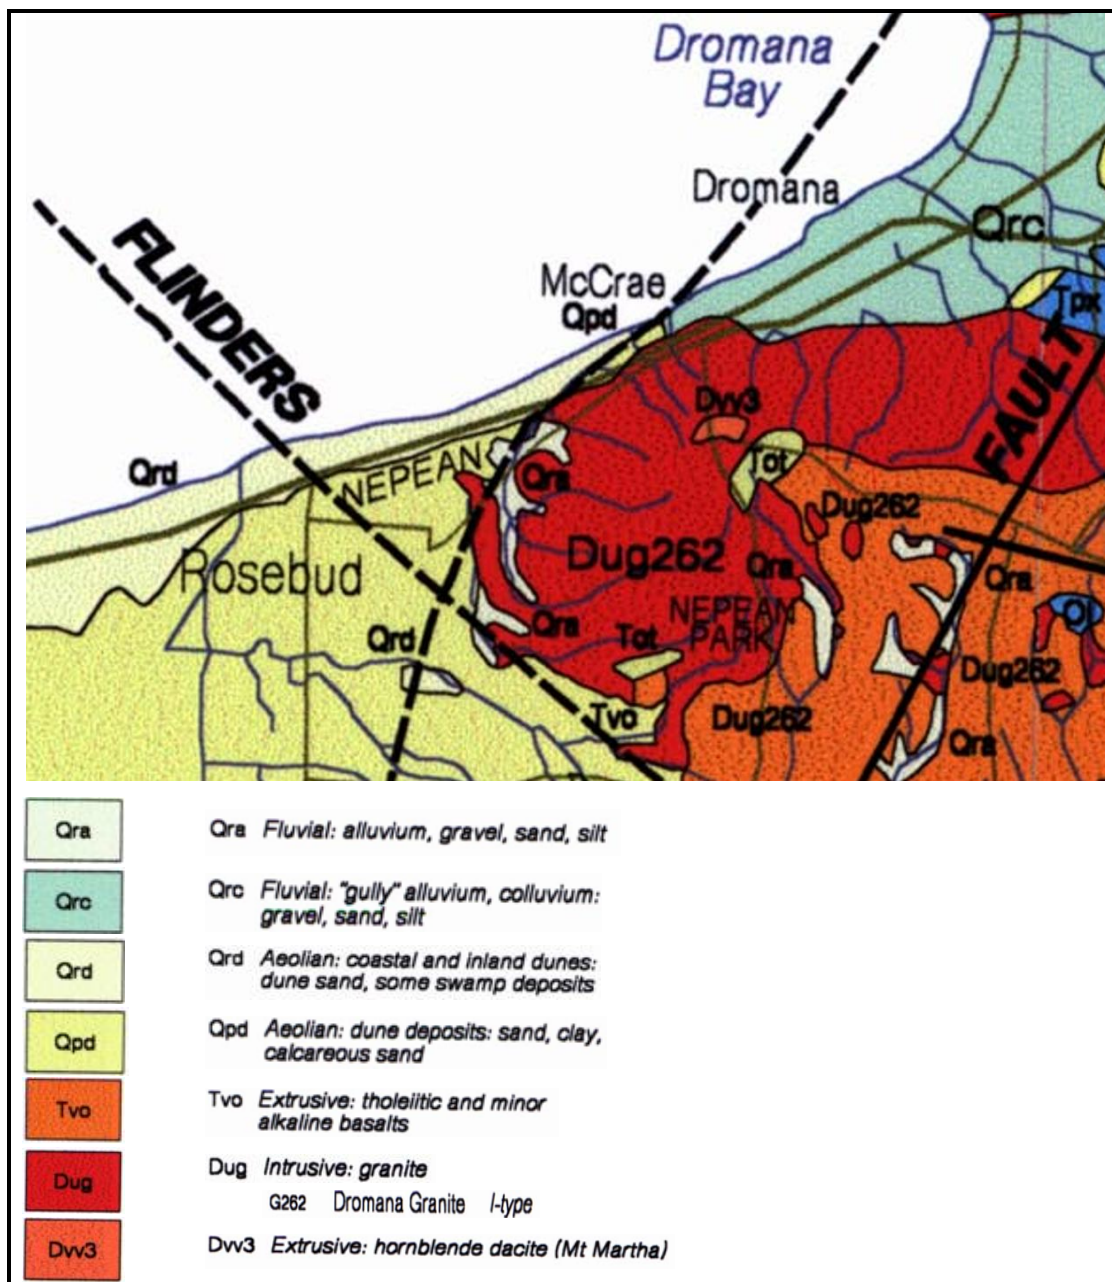


Figure 4: Queenscliff Geology

(Source: extract from Geological Survey of Victoria 1:250 000 Geological Map Series, Queenscliff, May 1997)

b. Landslide Area

52. Geological mapping provided has identified Quaternary-age Aeolian Dune Deposits (siliceous and calcareous sands) and Devonian-age Dromana Granite within the McCrae area, with the Selwyn Fault traversing 10-12 View Point Road as shown in **Figure 5**.

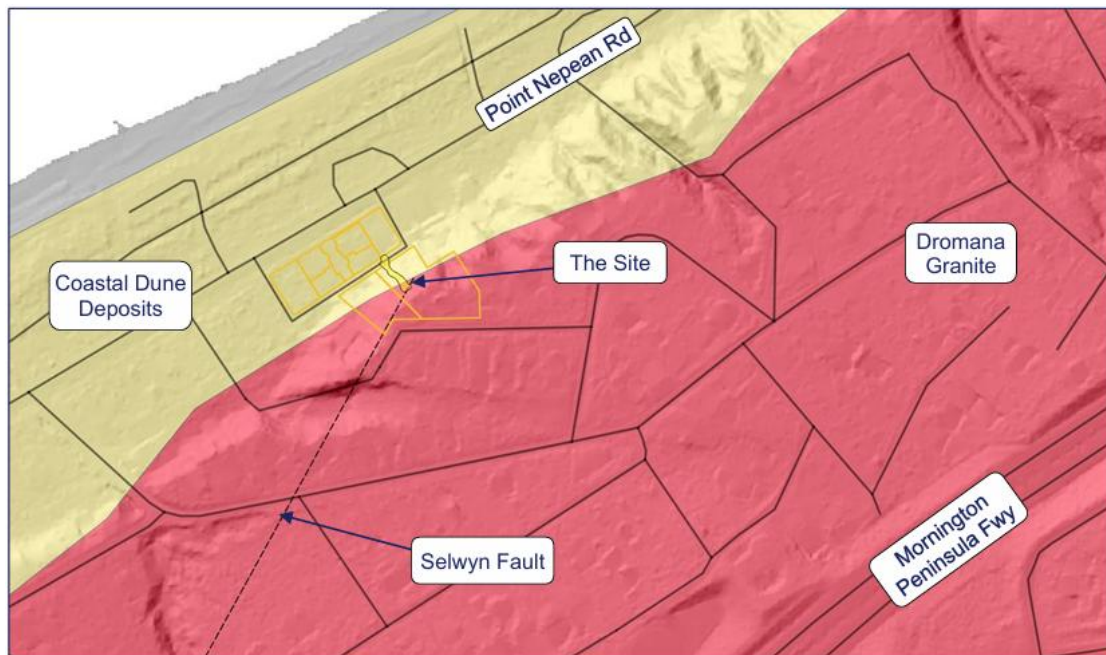


Figure 5: Geological Mapping of the McCrae Landslide Evacuation Order Area

Notes: "The Site" refers to 10-12 View Point Road in relation to the 2022 landslip events which is adjacent to the 2025 site; red = Dromana Granite; yellow = Coastal Dune Deposits. (Source: PSM 2024, via Earth Resources – GeoVic – Explore Victoria Online⁵).

50. The following lithology has been observed within properties along View Point Road and Penny Lane i.e. the area of the landslide:
- Fill – silty sand, sandy clay and sand.
 - Aeolian sand – silty sand, sandy/silty clay, and sand.
 - Colluvium – sandy clay, sand and gravelly/silty/clayey sand with some areas comprising trace granodiorite gravel (e.g. reported in BH1-BH3 at 14 View Point Road).
 - Residual granite – silty/clayey sand, sandy clay.
51. Extremely weathered granite – clayey sand and sandy clay.
- 52.

⁵ Department of Energy, Environment and Climate Action (2023), Earth Resources – GeoVic – Explore Victoria Online, Geology – Surface 250K(+) layer, via https://gsv.vic.gov.au/sd_weave/anonymous.html

53. **Table 1** from PSM (2024) below also provides a summary of the local geology and cross-section from the same source as provided in **Figure 6**.

Table 1: Geotechnical units of 10-12 View Point Road, McCrae

Unit	Description
SURFICIAL SAND (1)	SAND and Silty/Gravelly SAND, fine to coarse grained, brown to pale grey, brown, moist to wet, inferred medium dense. SPT N value of 10 at 1.5 m bgl. Contact with underlying Residual Granite (3) is difficult to define.
COLLUVIUM (2)	Inferred to be a mixture of Units 1 and 3. Recent Colluvium (the debris flow from 2022 landslide) is Silty SAND/Sandy CLAY. Old Colluvium buried by 2022 landslide is Sandy CLAY and SAND. This unit has no strength testing.
RESIDUAL GRANITE (3)	Sandy to Silty CLAY/Clayey SAND, low plasticity, pale grey, brown to mottled orange grey brown, fine to coarse grained, wet at contact with overlying Surficial Sands otherwise moist, typically medium dense to dense/stiff to very stiff. SPT N values vary from 12 to 34 with a mean of 25 from 3 m to 20 m bgl.

Note: Surficial sand is used interchangeably with dune deposits throughout reporting.

(Source: PSM 2024)

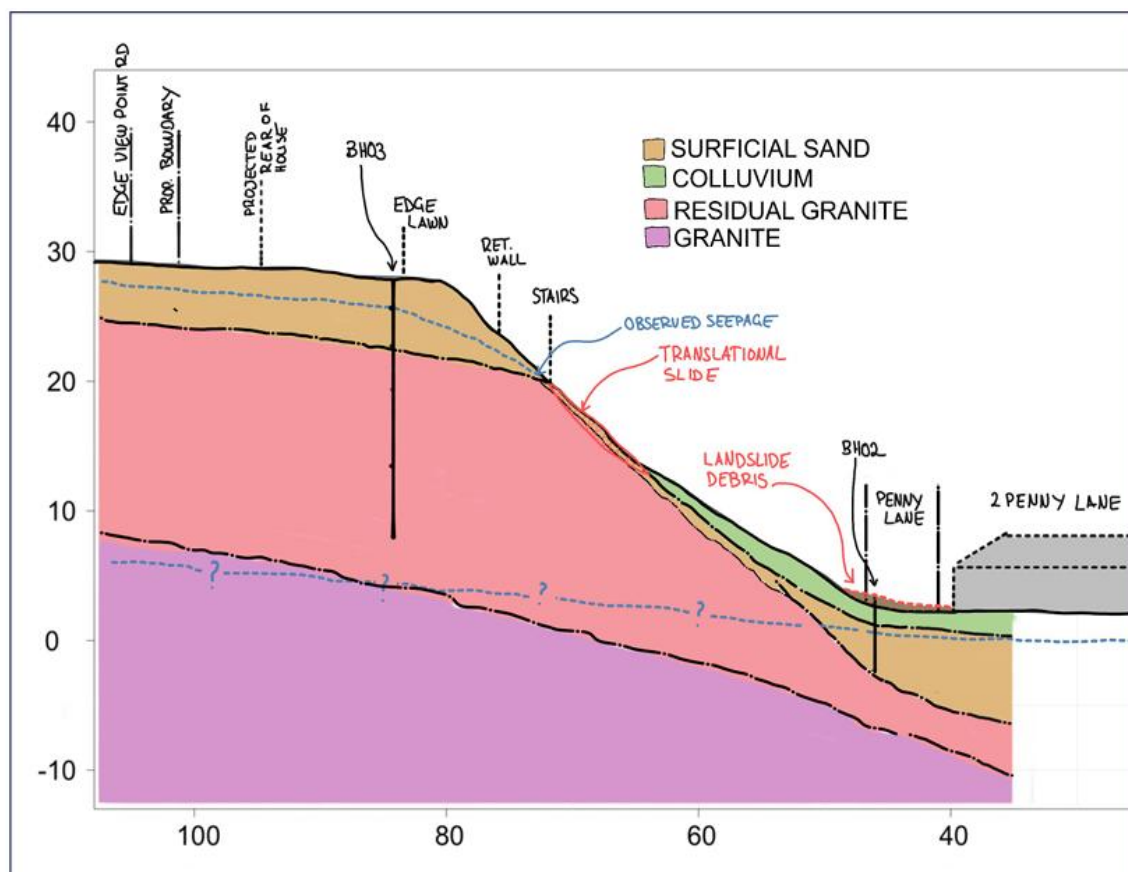


Figure 6: Geological Model of 10-12 View Point Road, McCrae Post-2022 Landslide Event

(Source: PSM 2024)

9.5 Summary of Hydrogeology

a. Regional

54. Based on the geological material of the area, SMEC (2025) has referred to the Port Phillip and Westernport Groundwater Flow Systems Report and identified various aquifers underlying the region such as fractured rock, saprock, saprolite soil and decayed granitic sands.⁶
55. Hydraulic conductivity varies between material and is estimated as anywhere between 10^{-10} m/d (rock) and 10^{-1} m/d (saprolite), with groundwater recharge occurring at a rate of “up to 25 mm/yr or more in wetter landscapes”.⁶
56. It is also suggested that regional salinity ranges from 500 to 10,000 mg/L Total Dissolved Solids (TDS).⁷
57. A review of regional groundwater conditions based on available historical information was undertaken by PSM (2025a) and the results have been incorporated into **Table 2** below with the locations shown in **Figure 8**.

Table 2: Summary of Regional Hydrogeological Investigation Findings

Source	Bore no	Depth	Strata Screened	Water Comment from logs
Neilson (1966) Geological report No. 1 on The Proposed Dromana Sewer Tunnel of the MMBW South Eastern Effluent Outfall, for MMBW	DT2/7	6 m (RL 55 mAHD)	Surficial sand immediately above sandy clay layer	Struck water at 6 m depth
	DT2/8	6 m (RL 72 mAHD)	Decomposed granite	Struck water at 6 m depth
	DT 9	20 m (50 mAHD)	Weathered granite	Struck water at approximately 20 m depth
	DT 10	25 m (57 mAHD)	Weathered granite	Struck water at approximately 25 m depth
	DT 15	2.5 m (RL 65 mAHD)	Decomposed Granite	Groundwater struck at 2.5 m depth
DEDJTR Victorian Aquifer Framework (also known as Visualising Victoria's Groundwater [VVG] ⁷) *	15 Outlook Road	52 mAHD	N/A; inferred geology is Devonian Granite	N/A
	Intersection Bayview Road and The Boulevard	33 mAHD		

Note: * Additional locations supplemented by AEA in July 2025

58. South-west of the site, associated with the Dromana Sewer Tunnel, groundwater was measured at 2.5 mbgl approximately 2.4 km from site, and from 20 to 25 mbgl approximately 3.9 km away.

⁶ SEW.0001.0001.0142: SMEC (2025), *Legally Privileged Multidisciplinary Expert Report, McCrae Landslip Project* (ref. 30043649), 5 May 2025.

⁷ Department of Energy, Environment and Climate Action (2025), Visualising Victoria's Groundwater, via <https://www.vvg.org.au/>

59. **Figure 7** below presents a summary of regional hydrogeological conditions in the McCrae area – from south/south-east to north/north-west across the peninsula from Arthurs Seat to Point Nepean Road (PSM 2025b).

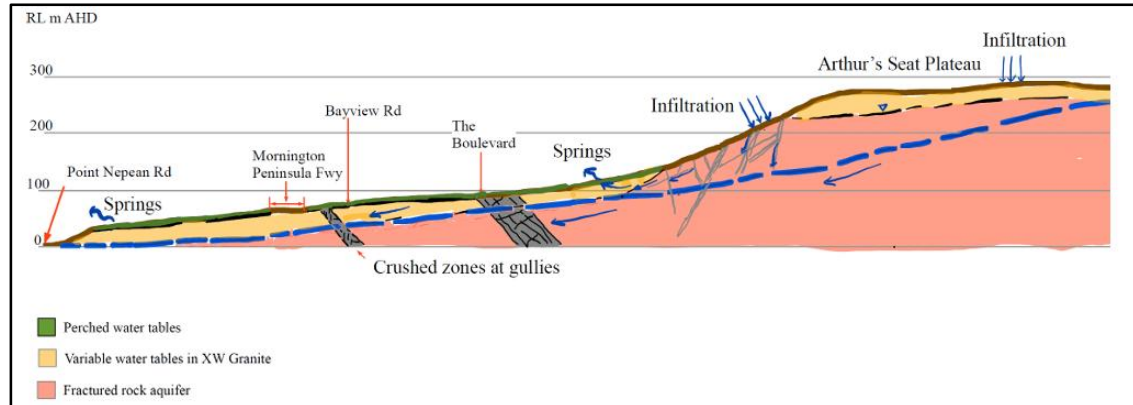


Figure 7: Conceptual regional hydrogeological model

Note: DEDJTR (2012) groundwater elevation in blue
 (Source: PSM 2025b)

60. In summary, regional groundwater is known to occur in the granite aquifer in the area at variable depth and salinity.



Figure 8: My Mapping of Regional Groundwater Investigation Locations – Dromana Sewer Line
(Source: adapted from Google Earth and historical data presented in PSM 2025a)

b. Landslide Area

61. A Groundwater Resource Report (GRR) was generated from the Department of Energy Environment and Climate Action (DEECA) database (refer **Attachment 5**) for 10-12 View Point Road (the source site) in July 2025. The GRR indicates groundwater beneath the site is generally found at depths of 20 to 50 mbgl with salinity in the range of 1,001 to 3,500 mg/L TDS (electrical conductivity [EC] of 1,564 to 5,469 $\mu\text{S}/\text{cm}$); furthermore, three potential aquifers underlying the site were highlighted including:
 - a. Quaternary Aquifer at 0 to 6 mbgl comprising sand, gravel, clay and silt,
 - b. Lower Tertiary Aquifer at 6 to 7 mbgl comprising sand, gravel, clay, silt and minor coal, and
 - c. Mesozoic and Palaeozoic Bedrock at 7 to 207 mbgl comprising sedimentary sandstone, siltstone, mudstone and shale, as well as igneous volcanics, granites and granodiorites.
62. Perched water is expected to form at the interface of the Aeolian dune deposits and residual granitic clays, evidenced by moisture ingress at the exposed batter surface following the 2022 landslides at a time when rainfall was not reported (Civiltest 2022).⁸
63. Geotechnical works at 14-16 View Point Road in June 2009 (GeoAust 2011)⁹ included installation of one groundwater standpipe (BH1; **Figure 9**) through sand, with bands of sandy clay from 7.5 to 9.0, 12.0 to 14.0 and 15.0 to 16.5 mbgl. The standing water level (SWL) of groundwater was measured at 16.5 mbgl in June 2009 then reported as dry in May 2011. It was recognised that drilling fluids utilised during installation of BH1 may have affected the initial SWL reading, which was measured only six hours after installation. As a result, the consultant adopted a conservative SWL at the base of the bore i.e. SWL 6.8 m.
64. GeoAust (2011) installed to other soil bores (BH2 and BH3) which comprised silty sand and sand with a band of silty clay at BH3 between 0.8 and 1.0 mbgl; although no groundwater was encountered at these locations (which are shown in **Figure 9**), moisture was reported between 0.9 and 1.5 mbgl at BH2 and from 1.0 to 3.4 mbgl at BH3.
65. At this same site, within the south-eastern corner, Civiltest (2017) installed a bore BH01 to 15 mbgl in 2017 with no groundwater encountered; the encountered geology comprised sands to 5 mbgl, underlain by clay to 7 mbgl then extremely weathered (granite) rock to the maximum depth of investigation.¹⁰
66. In January 2025, the neighbouring site at 10-12 View Point Road (PSM 2025a)¹¹ was investigated with the drilling of eight bores (BH01-BH05, BH01A, BH03A and BH04A) down to 5 to 30 mbgl. Bores BH01-BH03, BH03A and BH05 were installed with vibrating wire piezometers (VWPs), BH03A and BH04 were installed with Hobo data loggers, and BH01A and BH04A remained as standpipes. No evidence was provided to indicate the presence of groundwater in most of the bores aside from the following:
 - a. Evidence of groundwater was noted within BH01 at 14.5 mbgl (17.60 mAHD) and at BH03 at 2.5 mbgl (25.8 mAHD). However PSM reported, “Note that these observations may not reflect actual groundwater levels as they are likely to have been influenced by the fluids introduced during drilling”, so groundwater levels at these locations remain unconfirmed.

⁸ PSM.5000.0002.8425: Civiltest (2022), *RE: 10-12 View Point Road McCrae* (ref. 1222044-1 Issue 2), 5 December 2022

⁹ PSM.5000.0002.8460: GeoAust Geotechnical Engineers (2011), *Proposed Residential Dwelling, 14 View Point Road, McCrae Vic* (ref. 1624-8-R), 27 May 2011

¹⁰ PSM.5000.0002.8531: Civiltest (2017), *Land Stability Assessment at 14-16 View Point Road, McCrae* (ref. 1140220E), 24 January 2017

¹¹ MSC.5007.0004.0078: PSM Consulting (2025a), *McCrae Landslide – Evacuation Order Area, Geotechnical Factual Report* (ref. PSM5665-GFR REV0), 9 April 2025

- b. VWP results for BH01 at 29 m depth showed that the bore had between 2.5 and 4.0 m of water in the bore, i.e. 25 to 26.5mbgl.
 - c. VWP results for BH02 at 28.5 m depth showed that the bore had between 1.5 and 2.0 m of water in the bore, i.e. 26.5 to 27mbgl.
 - d. VWP results for BH03 at 28 m depth showed that the bore had between 3.5 and 4.5 m of water in the bore, i.e. 23.5 to 24.5 mbgl.
67. Sewer trench backfill was also investigated (PSM 2025a; see **Figure 10**) via non-destructive testing with NDT01 excavated to 5 mbgl (1.8 m below trench) and NDT02 excavated to 3.2 mBGL (0.5 m above design trench invert level), then ReIn Drains were investigated to 0.7 mbgl (RD2) and 0.9 mbgl (RD1) (0.4 m below drain). Groundwater was not observed during either of these investigation works.
68. Overall, throughout recent known investigations undertaken within the landslide evacuation order area, groundwater has not been encountered aside from that noted at significant depth in the granite aquifer i.e. greater than 23.5 mbgl. Refer to **Table 3** for an overview.

Table 3: Summary of Local Hydrogeological Investigation Findings

Source	Bore no	Depth (m)	Strata Screened	Water Comment from Logs
GeoAust (2011) Proposed Residential Dwelling 14 View Point Road, McCrae (PSM.5000.0002.8460)	Test Location 1 (BH1)	25	Sand (fine to medium grained) Bands of clay with sand (medium to high plasticity)	Moist from surface to 7.5 mbgl Moist from 9.0 to 15.0 mbgl Moist from 16.5 to 25.0 mbgl SWL at 16.5 mbgl in 2009 but was dry in 2011
	Test Location 2 (BH2)	1.5	Silty sand (fine to medium grained) and sand with clay (fine to coarse grained)	Moist from 0.9 mbgl to refusal at 1.5 mbgl on dense clay layer
	Test Location 3 (BH3)	3.4	Sand with silt (fine to medium grained) and band of clay with silt (medium plasticity)	Moist from 1.0 to 3.4 mbgl (refusal) on very dense sand
Civiltest (2017) Land Stability Assessment at 14-16 View Point Road, McCrae (PSM.5000.0002.8531)	Test Hole 1	15	Sand Surface Clay 5-7 m Extremely Weathered Rock 7 - 15 m	Moist at 2.0 mbgl Moist at 7.0 to 8.0 mbgl Moist 8.5 to 9.0 mbgl Most 9.0 to 15.0 mbgl Groundwater not encountered expected to be >15 m depth
	Test Holes 2-7	0.75-2.50	Sandy Fill at surface Gravels to granitic gravels	No groundwater encountered. Dry to moist in upper fill
PSM (2025) McCrae Landslide – Evacuation Order Area - Sewer and Stormwater Investigation Report (PSM5665-070R) ¹²	NDT03 to NDT13 BH14A & BH14B	1.5-2.9	Fill – Sand – clayey gravels to sandy clays	No groundwater observed

¹² PSM Consulting (2025d), *McCrae Landslide – Stormwater and Sewer Investigation, Geotechnical Factual Report* (ref. PSM5665-070R DRAFT REVA), 13 June 2025

Source	Bore no	Depth (m)	Strata Screened	Water Comment from Logs
PSM (2025a) McCrae Landslide – Evacuation Order Area - Geotechnical Factual Report (PSM5665-GFR REV0)	BH01	30	Fill to 0.5 m Clays – silty sands-gravelly sands-clayey sands to 5.8 m Weathered granites (sandy clays to clayey sands to gravelly sands) to 30 m	Water encountered at 14.5 m mbgl (17.6 mAHD) – see BH1 log and accompanying photos. Varying levels of moisture noted down bore. S5.1 of report - “ <i>Note that these observations may not reflect actual groundwater levels as they are likely to have been influenced by the fluids introduced during drilling</i> ”
	BH02	30	Fill to 1.1 m Clayey sand to 4.1 m Sandy Clay to 5.7 m Weathered Granite (Sandy Clay-Clay-sandy clay-gravelly sands-trace cobbles) to 30 m	Notes indicate groundwater not encountered. Varying levels of moisture noted down bore.
	BH03	29.5	Fill to 0.9 m Sand to silty sand to 4.2 m Weathered Granite (Sandy Clay-Clay-sandy clay-gravelly sands-trace cobbles) to 30 m	Water levels observed at 2.5 m mbgl (25.8 mAHD) Groundwater not encountered below. S5.1 of report - “ <i>Note that these observations may not reflect actual groundwater levels as they are likely to have been influenced by the fluids introduced during drilling</i> ”
	BH04	30	Sand to 3.1m Silt to 3.6 m Sandy Clay to 5.8 m Weathered Granite (Sandy Clay-Clay-sandy clay-gravelly sands-trace cobbles) to 30 m	Groundwater not encountered. Varying levels of moisture noted down bore.
	BH05	6	Gravelly sand to 0.5m Sand to 2.4 Clayey sand to 3.6 m Clay to 3.8 m Sand to 4.5 m Clayey sand to 4.9 m Clay to 5 m	Water observed at 1.6 mBGL (0.6 mAHD); wet from 1.6 m mbgl to bottom of hole
	NDT01 to NDT02	3.2-4.0	Fill above buried services/trenches	Water not encountered
	RD01	0.9	Fill to 0.5 m Silty sands to 0.9 m	Water not encountered
	4 Waller Place	1.6 mAHD		N/A

Expert Report – Phillip Hitchcock
 Board of Inquiry, McCrae Landslide
 Date Issued: 21 July 2025



Source	Bore no	Depth (m)	Strata Screened	Water Comment from Logs
DEDJTR Victorian Aquifer Framework (also known as VVG) *	Intersection Charlesworth Street and Coburn Avenue		N/A; inferred geology is Devonian Granite	
	10-12 View Point Road	1.7 mAHD	N/A; inferred geology is the coastal dune deposits (sand, silt and clay)	
	3 Penny Lane			
	607 Point Nepean Road	0.4 mAHD		

Note: * Additional locations supplemented by AEA in July 2025

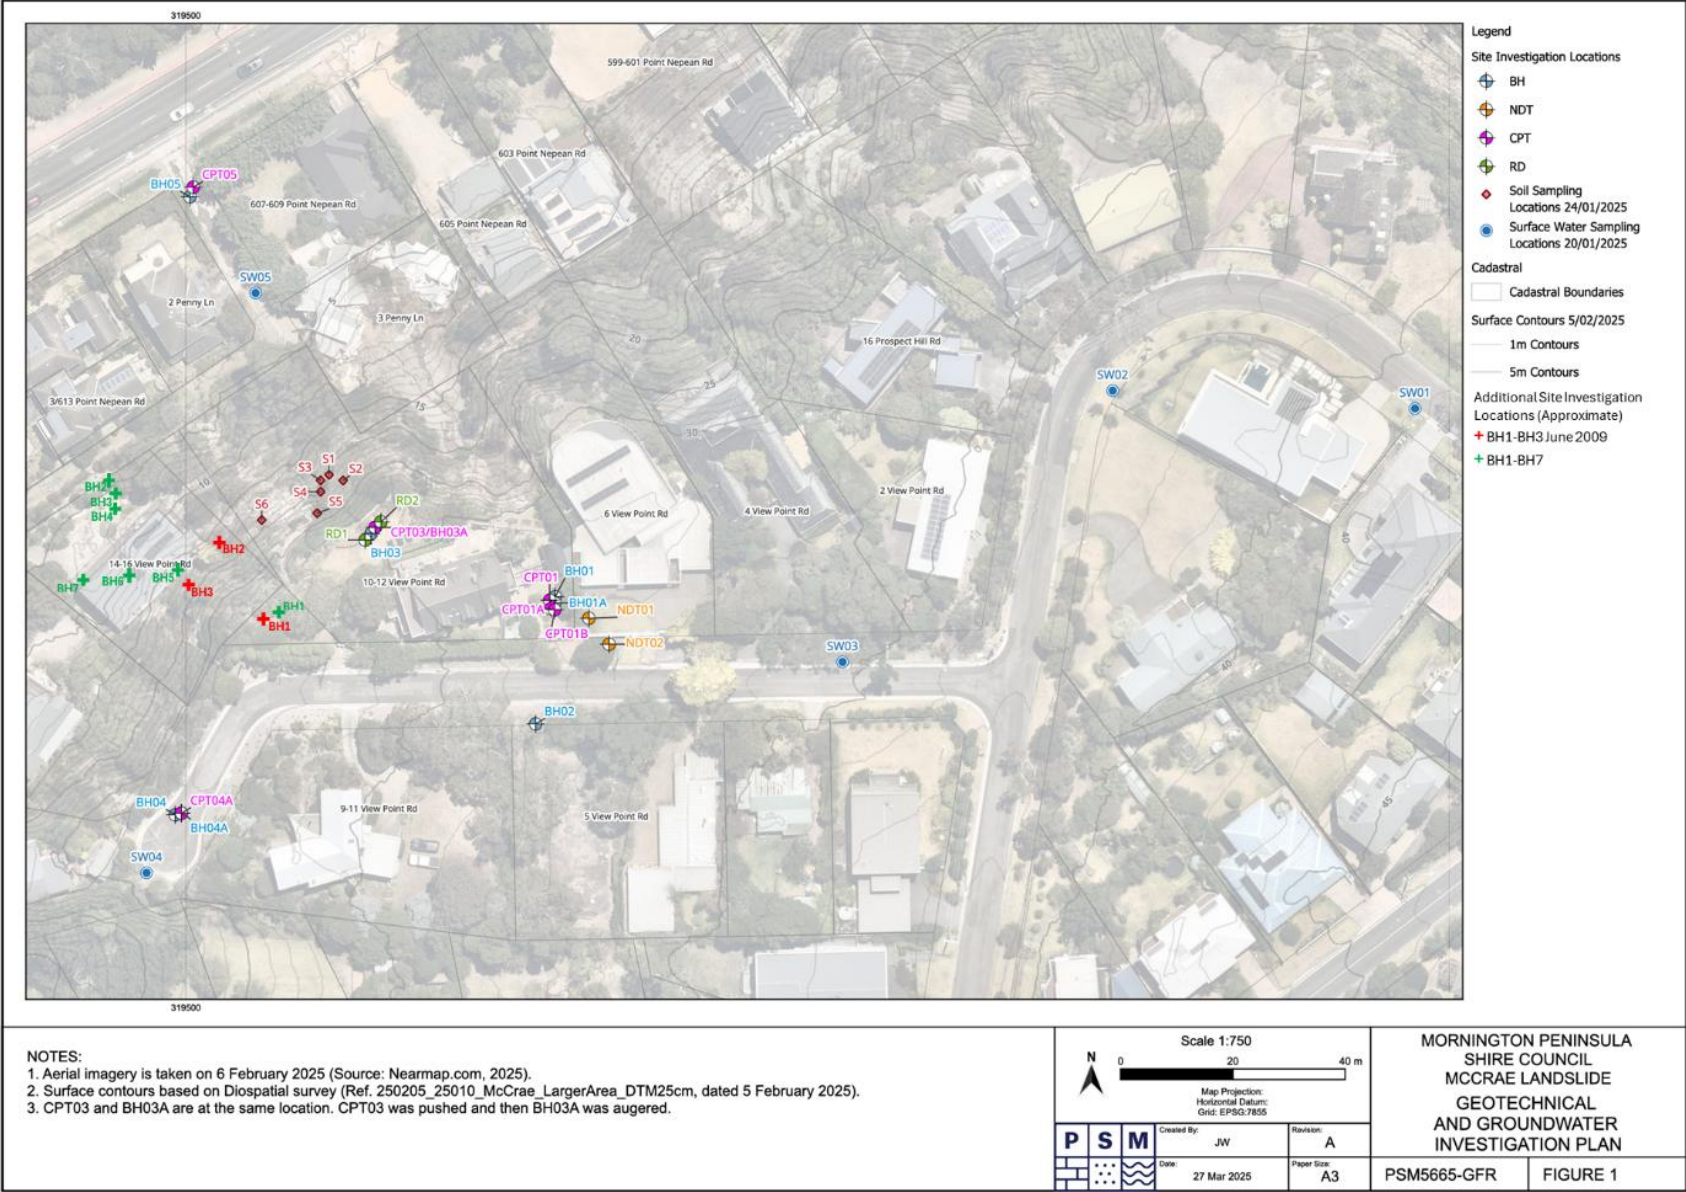


Figure 9: Location of Investigation Locations within the Landslide Area
(Source: adapted from PSM 2025a)

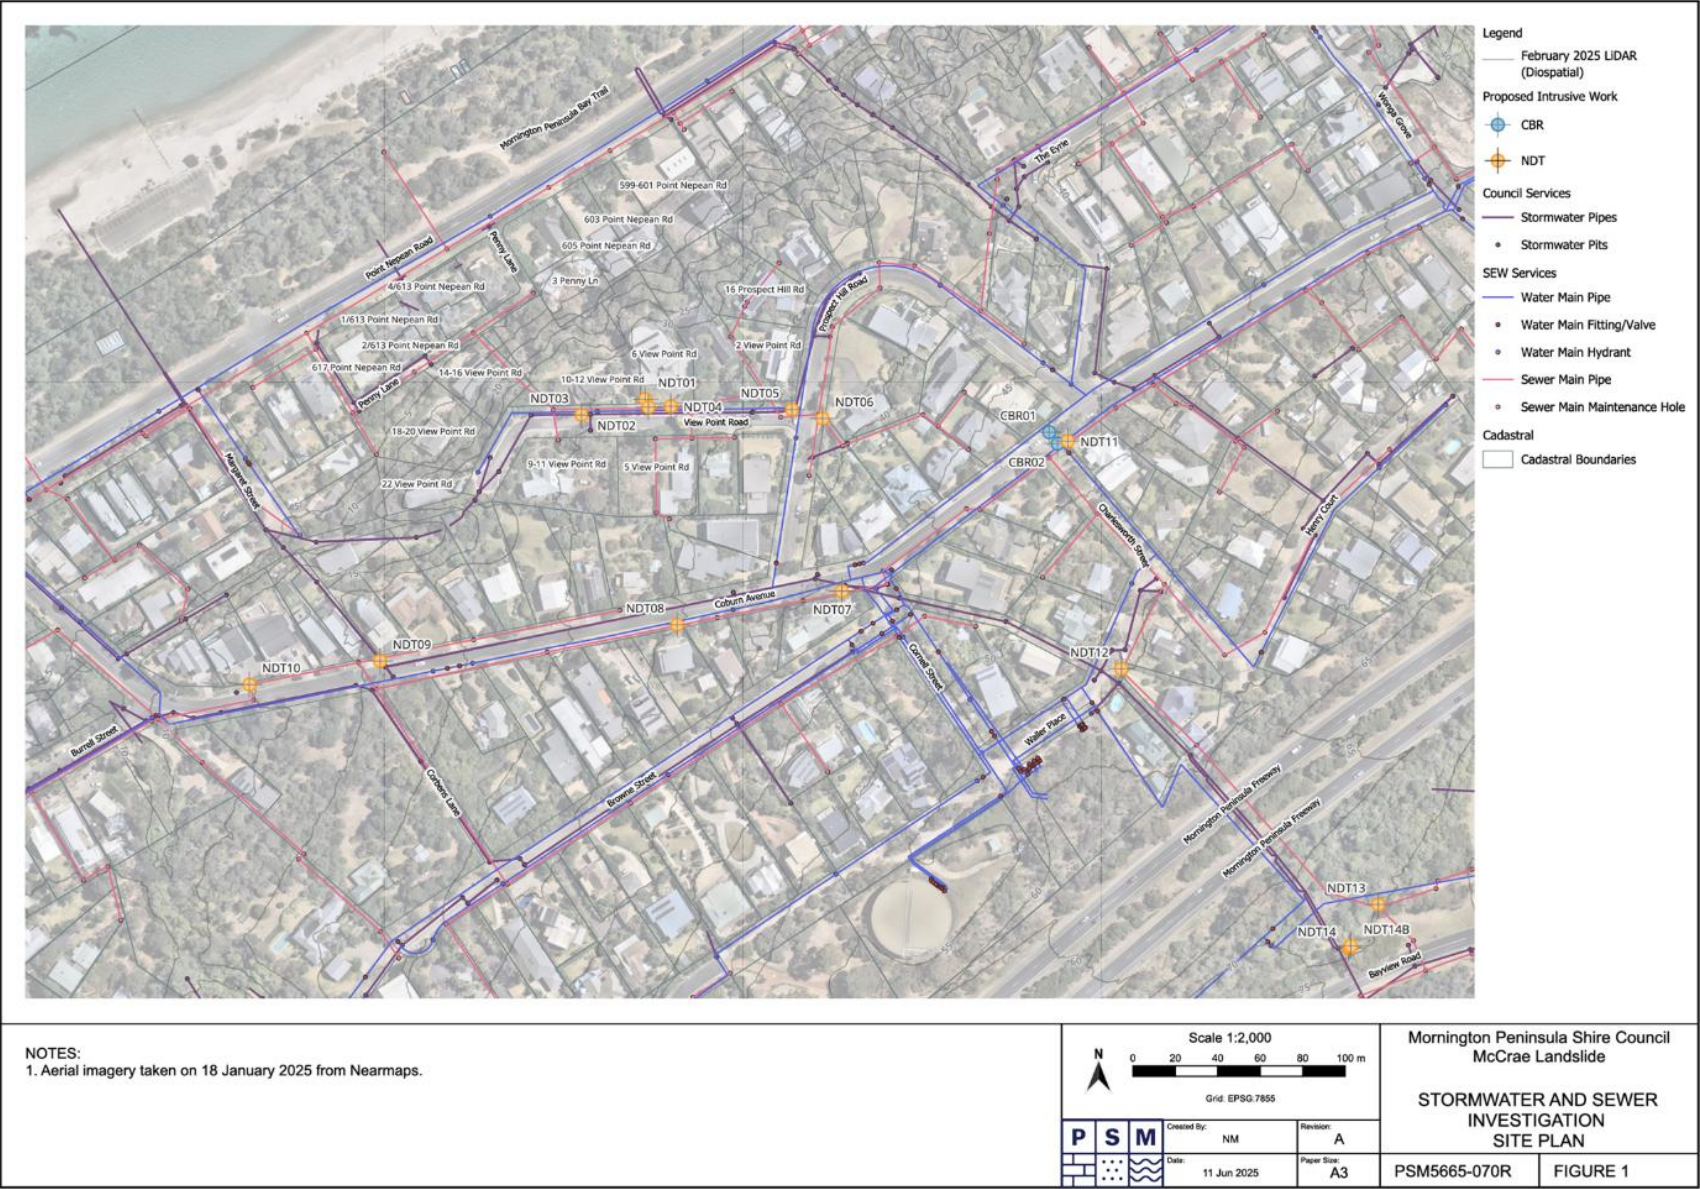


Figure 10: Location of Local and Regional Investigation Locations and SEW Assets
(Source: adapted from PSM 2025a)

9.6 Hydrogeochemistry

69. Surface water samples were collected on 20 January 2025 from five locations and reported as part of the site Geotechnical Factual Report (PSM 2025a). Samples were analysed for a series of cations and anions, TDS, non-metallic organics and selected metals.
70. Metals were reported at low concentrations; however, field sampling methodology was not reported in any of the documents provided and therefore it cannot be ascertained whether surface water samples were field filtered for metals analyses or preserved appropriately.

Table 4: Surface Water Testing Summary

ID	Location	Sample Date and Time	pH	Temp (°C)	DO (mg/L)	EC (us/cm)	Redox Potential (mV)	Comment
SW01	Flowing water from 5 Prospect Hill Road into gutter	20/01/2025 9:30am	7.47	22.7	5.92	125.0	91.7	No odour, no sheen, clear, no colour
SW02	Flowing water from 7 Prospect Hill Road into private stormwater pit	20/01/2025 9:55am	6.50	20.6	7.26	332.5	99.0	No odour, no sheen, high turbidity, brown
SW03	Flowing drain around 4 View Point Road	20/01/2025 10:20am	7.19	21.7	6.48	359.5	80.9	No odour, no sheen, high turbidity, brown
SW04	Flowing drain at View Point Road Cul-de-sac	20/01/2025 10:40am	7.74	22.9	8.91	360.6	75.8	No odour, no sheen, high turbidity, brown
SW05	Flowing water along east side of Penny Lane	20/01/2025 1:05pm	7.97	24.2	6.30	1051.0	79.3	No odour, no sheen, very high turbidity, brown

71. AEA generated a Piper Plot from the available surface water sampling data (see **Figure 11** below). This shows that four of samples are of similar geochemical type and therefore likely of similar origin. The sample that is different i.e. SW01 has low ammonia levels and lowest salinity.
72. It is noted that the detection limit for Fluoride was 0.5 mg/L which is much higher than that used by SEW which limits the review in variations of this analyte.
73. Ammonia was present in three samples (SW02 – 05) indicating some level of anthropogenic input.

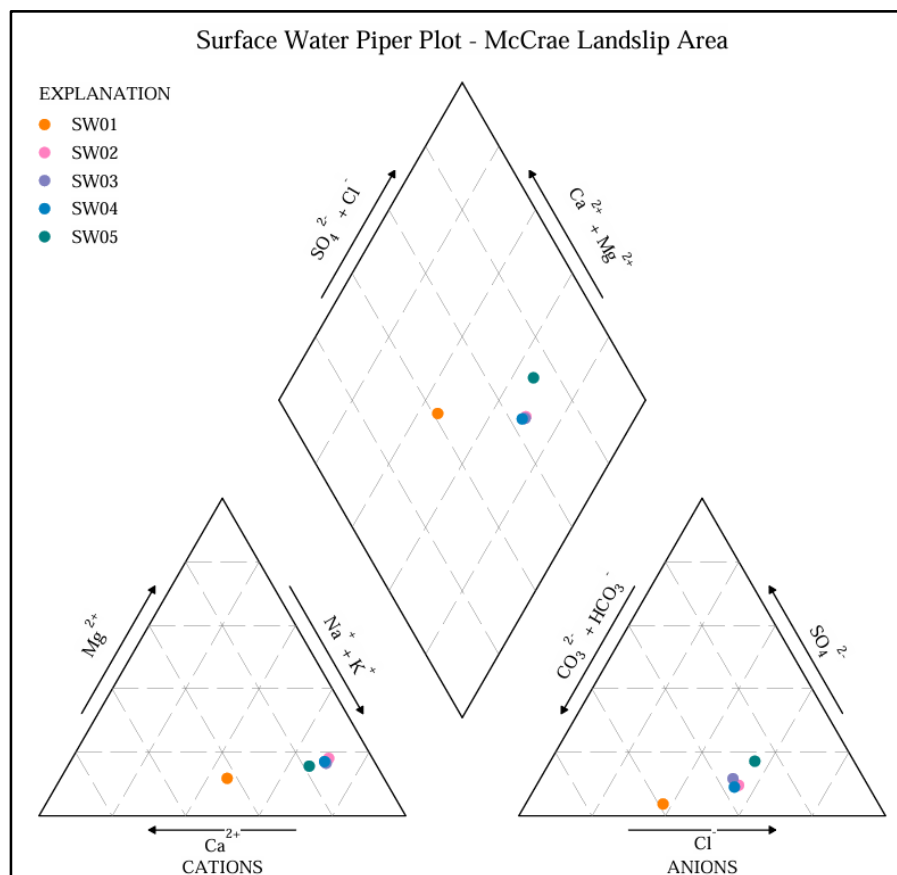


Figure 11: My Piper Plot of Surface Water – McCrae

74. SMEC (2025) have defined average concentrations of various analytes within the SEW mains water network, including EC (83 $\mu\text{S}/\text{cm}$), calculated TDS (53 mg/L), chloride (9 mg/L) and fluoride (0.77 mg/L).
75. An assessment of limited water chemistry data against the average concentrations within SEW water assets has been undertaken by SMEC (2025) and supplemented by AEA (see **Table 5**). SEW concluded that the assessed water sources were not linked to the SEW mains water supply, as evident by the diluted levels of fluoride (being a common water treatment additive). This is not a view I support as discussed in **Section 10.2c** of this report.
76. SMEC (2025) considered that seepage sampled from stormwater pits along View Point Road and Prospect Hill Road are in line with lower salinity type water such as stormwater, mains water or a private water supply.
77. SMEC (2025) also considered that groundwater influence has been noted on several occasions where higher salinity levels were reported, based on the inferred regional aquifer conditions (i.e. EC > 780 $\mu\text{S}/\text{cm}$). This included samples of seeped water collected at the intersections of Charlesworth and Waller Streets between November 2024 and January 2025, and Charlesworth Street and Coburn Avenue in January 2025.

Table 5: Summary of Relevant South East Water (SEW) Assets Maintenance Records – McCrae

SEW Montage Record / Source (Other)	Date	Location	Event / Water Type	Analyte						
				EC (µs/cm) ^A	TDS (ppm)	Chloride (mg/L)	Fluoride (mg/L)	Sulphate (mg/L)	Ammonia (mg/L)	pH
SEW (2023) ¹³	19/07/2023	1 Fairway Crescent	Leaking garden standpipe causing surface water pooling; private water supply therefore issued a 7-day red notice for repairs.	No water sampling undertaken						
SEW (2024a) ¹⁴	28/11/2024	3 Charlesworth Street / 1 Waller Place	Ongoing water seepage from pothole in road, which was patched in November 2024 however seepage was still observed by December.	1,348	863*	No other sampling undertaken				
	01/12/2024		Source is inconclusive with SEW believing there may be a link to stormwater drainage issues after high rainfall, however Fulton Hogan considered the seepage to be too pressurised for stormwater; residents believe a natural spring is present.	3,746	2,397*					
SEW (2024b) ¹⁵ See also: SEW (2024c) ¹⁶	16/12/2024	1 Waller Place	Water seepage from nature strip causing surface water pooling and runoff into the gutter.	350* (pooled surface water)	224 (pooled surface water)	No other sampling undertaken				

¹³ SEW.0001.0001.4990: South East Water (2023), Task Summaries regarding 1 Fairway Crescent, McCrae, 19 July 2023

¹⁴ SEW.0001.0001.0085: South East Water (2024a), Task Summaries regarding 1 Charlesworth Street and 2 Waller Place, McCrae, 28 November 2024 to 23 December 2024

¹⁵ SEW.0001.0001.0076: South East Water (2024b), Task Summaries regarding 4 Waller Place and 2 The Boulevard, McCrae, 16 December 2024 to 7 January 2025

¹⁶ SEW.0001.0001.0966: South East Water (2024c), Re: 4 Waller Place McCrae 1295094, internal email correspondence from South East Water, 24 December 2024 to 30 December 2024

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



SEW Montage Record / Source (Other)	Date	Location	Event / Water Type	Analyte						
				EC (µs/cm) ^A	TDS (ppm)	Chloride (mg/L)	Fluoride (mg/L)	Sulphate (mg/L)	Ammonia (mg/L)	pH
SMEC 2025	21/12/2024			No water sampling undertaken						
	24/12/2024		Detection services employed; heavy rainfall; water flowing up from road at 10+ L/min; nature strip saturated leaking onto road; no leak noises in SEW assets	670 (road)	429*	120	0.29	No other sampling undertaken		
	30/12/2024		Property flooded with house foundations and fence inundated, and the road opposite was crumbling with three sink holes observed	160 ^B (pit)	102*	29 (pit)	0.80 (pit)			
			Samples collected and analysed from the stormwater pit and road seepage	640 (road)	410*	120 (road)	0.27 (road)			
	01/01/2025		In the afternoon water flow from the nature strip onto the road was reduced, however water pooling was observed along the fence line and approximately 3 m onto property	528	338*	No other sampling undertaken				
	02/01/2025		Water seepage still occurring	No water sampling undertaken						
	06/01/2025			570	365*	110	0.14	No other sampling undertaken		
	08/01/2025			No water sampling undertaken						
	13/01/2025		Water seepage no longer apparent, with water pooling still present however drying up	No water sampling undertaken						
	16/01/2025			1,200	768*	250	0.28	No other sampling undertaken		
	17/12/2024	1 Charlesworth Street	Water bubbling nearby. As above, Fulton Hogan consider water unlikely to be stormwater given pressure and no identified issues with SEW assets.	550*	352	No other sampling undertaken				
	21/12/2024	3 Charlesworth Street	Ongoing water seepage from pothole in road	446	285*	No other sampling undertaken				
	533			341*						
	01/01/2025		Seepage continuing after burst water pipe was repaired on 30/12/2024	No water sampling undertaken						
	02/01/2025									

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



SEW Montage Record / Source (Other)	Date	Location	Event / Water Type	Analyte						
				EC (µs/cm) ^A	TDS (ppm)	Chloride (mg/L)	Fluoride (mg/L)	Sulphate (mg/L)	Ammonia (mg/L)	pH
	08/01/2025		Road seepage stopped; appears Council installed drainage pipe from middle of road to grated drain in gutter							
	13/01/2025									
	19/01/2025									
	30/12/2024	Opposite 2 The Boulevard, between Bayview Road and Mornington Peninsula Highway	Burst located on 150 mm UPVC main other side of Peninsula Freeway	No water sampling undertaken						
	01/01/2025		Burst pipe area dried up							
	02/01/2025	29 Bayview Road	Water seepage through middle of driveway; water testing turned pink indicating mains water with faint noise detections on nearby services (including 100 mm UPVC main)	No additional information supplied						
	18/01/2025		Water seepage is still occurring, and ground has subsided adjacent to the driveway							
	09/01/2025	Not provided	WR174 water tank potentially leaking with water coming to surface at presser; determined to be a backed up agi pipe	~500	~320*	No other sampling undertaken				
		6 Waller Place	Stormwater pit flow reported at 10 L/min with testing undertaken and reported as a positive result for stormwater pit; previously tested 30/12/2024 prior to burst main repair	>600	>384*					
	14/01/2025	34 Coburn Avenue	Undergoing construction works, meanwhile surface water pooling observed at the front of the property; SEW state daily tests being completed and confirmed as groundwater	No additional information supplied						
	17/01/2025	7 Prospect Hill Road	Grated drainage pit testing	~100	~64*	No other sampling undertaken				
				404	259*					

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



SEW Montage Record / Source (Other)	Date	Location	Event / Water Type	Analyte						
				EC (µs/cm) ^A	TDS (ppm)	Chloride (mg/L)	Fluoride (mg/L)	Sulphate (mg/L)	Ammonia (mg/L)	pH
	18/01/2025	13 and 15 Outlook Road	Noise was detected in SEW assets	No additional information supplied						
SEW.0001.0001.0142 (SMEC 2025)	30/12/2024	6 View Point Road	Stormwater drain	160	102*	29	0.8	No other sampling undertaken		
	08/01/2025			570	365*	82	0.13			
	06/01/2025	Seepage within [6 January 2025] landslide material		1,600	1,024*	330	0.15	No other sampling undertaken		
	06/01/2025	Intersection Coburn Avenue and Charlesworth Street	Pothole seepage	750	480*	140	0.30	No other sampling undertaken		
	22/01/2025		Pavement	1,000	640*	210	0.32			
				1,400	896*	270	0.22	95	0.1	7.2
	22/01/2025	34 Coburn Avenue	Verge	680	435*	150	0.31	<20 LINT	<0.1	6.7
	22/01/2025	5 Waller Place	Verge	600	384*	120	0.18	29	<0.1	8.2
	03/02/2025	11 Prospect Hill Road	Stormwater drain	400	256*	83	0.14	14	<0.1	7.1
	25/03/2025		Stormwater pit	440	282*	100	0.13	17	<0.1	7.0
	03/02/2025	5 Prospect Hill Road	Kerb	140	90*	20	0.86	5	0.1	7.7
	25/03/2025		Gutter/storm pipe	120	77*	17	0.71	2	<0.1	7.1
	25/03/2025	10 View Point Road	Stormwater pit	450	288*	99	0.16	22	<0.1	7.6
	25/03/2025	29 Browne Street	Coburn Creek	420	269*	100	0.19	<5 LINT	<0.1	7.3
	25/03/2025	1-3 Burrell Street	Coburn Creek	630	403*	88	0.15	43	0.6	6.8
	15/04/2025	5 The Eyrie	NP	120	77*	20	0.76	2	<0.002	7.7
	15/04/2025	16 Arthurs Avenue	NP	120	77*	19	0.81	2	<0.002	7.7
	15/04/2025	3 Flinders Street	NP	120	77*	20	0.79	3	<0.002	7.7

Notes:

* TDS and EC are converted using a factor of 0.64

NP = not provided

10. Expert Opinions

10.1 Groundwater

78. I note that the geotechnical reports reviewed refer to water below the ground as groundwater but for the purposes of this report I have made a distinction between permanent groundwater in aquifers and transient shallow perched water.
79. I do not consider groundwater (i.e. aquifers in the shallow dune sand, colluvium or underlying granite) to be a contributing source of water for the following reasons:
80. No permanent water has been identified in the sand or colluvium soils. While some layers in these strata have been noted to be locally saturated, this water is transient in nature and was not identified in bores. It is noted that VWP's have been installed in some shallow wells and shallow standpipes have also been installed. Further review of the latest data when available should be undertaken, as suggested in **Section 10.3**, for confirmation.
81. The regional groundwater in the landslide area is present in the granite aquifer which occurs under the dune sand and colluvium (where present).
82. The VWP results (refer paragraph 66) for various depths in the soil profile indicate that permanent water is unlikely to be present in the soils above the granite and that groundwater in the granite aquifer is present at a depth of between 23.5 and 27 mbgl. It is noted that this is based on only about one month's monitoring which is understood to be ongoing. Review of further time series data should be undertaken given the limited length of time and as water levels were generally decreasing, and this has been suggested in **Section 10.3**.
83. Given that the granite aquifer water level is well below where seepage has occurred there is no mechanism for it to contribute.
84. An assessment of groundwater geochemistry would also be informative to compare to the surface water results, but no wells are currently available for sampling. The installation of a limited number of wells to sample the water and assess water levels in the landslide and upgradient of same would be beneficial as discussed in **Section 10.3**.

10.2 Perched Water

85. Based on my review of the available information, in my opinion the sources of water that impact on the landslide area include any or a combination of the following perched water sources:
 - a. Direct infiltration of rainfall – a naturally occurring process.
 - b. Leakage from mains potable water – numerous leaks from mains potable water (refer **Figure 1**) have been documented and domestic irrigation could also be a source.
 - c. Leakage from stormwater drains – stormwater infrastructure breaches have been documented.

a. Perched Water – Infiltration of rainfall

86. Rainfall infiltration is a plausible source of the seepage water given the sandy nature of the shallow soils. Infiltrating rainfall could migrate under gravity until it meets a lower permeability layer (such as clays in the colluvium or the weathered granite interface; refer **Section 9.3**) and then travels laterally. Given the topography of the area and presence of the gullies this water could travel to the main landslide area.
87. Chemically, the water would be expected to be of low salinity, low contaminant levels and low fluoride. Reviewing the limited chemical results of the sampled water (refer **Table 5**) does

not rule this out as at least a partial source of the water. While the salinity levels of the seepage water measured may be higher than that expected from rainfall, given the maritime location of the area, aerosol deposition of salt on to the soil surface is likely, which could be picked up as water flows through the strata. I have recommended some soil sampling to assess the soil salinity in **Section 10.3**.

88. Fluoride would not be expected in this infiltrated rainwater and has been detectable in all 27 samples with a range of 0.16 to 0.86 mg/L suggestive of some mains water source as noted below. It is however possible that some levels of fluoride are present in the soil (Fluorite can be present in granite but has low solubility) that could leach out and so I have recommended that this is assessed via leaching test of soil samples in the area.
89. Also considering that the 2025 rainfall was not significant prior to and at the time of the landslide (refer **paragraph 28**) its contribution is unlikely to be significant.

b. Perched Water – Stormwater Origin

90. Migration of stormwater from cracks/breaks in stormwater infrastructure would occur via gravity along trench backfill material and/or underlying soils until a less permeable layer is reached then flow would be lateral. Given the topography of the area and presence of the gully (refer **paragraphs 28 and 44** and **Figure 3**), this water could migrate to the main impacted area.
91. SMEC (2025) suggests that this is an unlikely source given the tortuous pathways and invert changes assumed if migration was limited to just the stormwater trench bedding. However, given the sandy nature of the shallow soils it is plausible that the migration could also occur outside of the trench via the underlying strata and flow under gravity to the landslide area.
92. This water would be hard to distinguish from rainfall infiltration as it would be characterised by low salinity, have low contaminant levels and be free of water treatment chemicals. As noted above any discrepancy between the salinity levels in the sampled water and stormwater could be attributed to picking up salt along the flow path. I have recommended some soil sampling to assess the soil salinity in **Section 10.3** to further assess this scenario.
93. Fluoride would not be expected in stormwater and has been detected in all 27 samples with a range of 0.16 to 0.86 mg/L suggestive of some mains water source. It is however possible that some levels of fluoride are present in the soil (Fluorite can be present in granite but has low solubility) that could leach out and so I have recommended that this is assessed via leaching test of soil samples in the area.
94. Given that stormwater is generated from rainfall, its contribution is unlikely to be significant given that the 2025 rainfall was not substantial prior to and at the time of the landslide (refer **paragraph 28**).

c. Perched Water – Mains Origin

95. Similar to stormwater, migration of leaking mains infrastructure would occur via gravity along trench backfill material and/or underlying soils until a less permeable layer is reached then flow would be lateral. Given the location of the leaks (refer **Figure 2**) it is possible for this to flow to the main landslide area via a combination of the trench bedding or underlying soils given the topography of the area.
96. Also, mains water could be present via domestic irrigation in any part of the landslide area.
97. Three samples of mains water were tested for salinity, pH, fluoride, chloride and ammonia. Comparing these results to the seepage tests in **Table 5** showed the collected water to be slightly higher in salinity and lower in Fluoride (ranging from 0.16 to 0.86 mg/L compared to mains at around 0.8 mg/L) and have low ammonia levels.

98. In the SMEC (2025) report they note that the higher salinity of the collected seepage samples and presence of fluoride levels cast doubt on the mains water as a contributing source. I do not agree with this because:

- a. As noted in the preceding sections the higher salinity may be due to collection of salt as the water flows through the soil, and
- b. Fluoride is well known to sorb to soil especially clays¹⁷ and there are clays present in the soil profile so I would not expect to find the same levels of fluoride in samples that escaped from the mains and flowed through the soil. Indeed, the presence of fluoride even at reduced concentrations e.g. Fluoride was detected in all 27 samples from 0.13 to 0.86 mg/L point to the mains as a likely contributing source. It is possible that some levels of fluoride are present in the soil (Fluorite can be present in granite but has low solubility) that could leach out and so I have recommended that this is assessed via leaching test of soil samples in the area in **Section 10.3**.

99. It is noted that mains water is known to contain impurities such as THMs¹⁸ from disinfection processes. Analysis for this and other disinfection compounds could provide further evidence that mains water is a contributing source, and this is recommended in **Section 10.3**.

10.3 Summary

100. In my opinion, it is unlikely that groundwater is a likely water source associated with the landslide.

101. Regarding perched water, the contribution of mains water is the most likely source but further work as noted in **Table 6** below should reduce the uncertainties in this conclusion.

Table 6: Summary of Suggested Further Assessment or Review

Source	Activity	Reason	Comment
Groundwater	Review of current VWP results in the nested well	Assess latest water level information	--
	Guage water levels in available wells e.g. BH1a, 3a and 4a	Confirm absence of shallow aquifer	--
	Sample groundwater and analyse for 1. Major cations and anions 2. Fluoride 3. Salinity 4. Isotopes of oxygen and/or carbon	1. Gives geochemical type for comparison to seepage water 2. Comparison to seepage water 3. Comparison to seepage water 4. Gives age of water and recharge information	Note that the VWP wells are not able to be sampled so would require drilling of new wells
	Install limited further wells upgradient of the landslide area	Assess groundwater occurrence/pressures upgradient of the landslide as these are not known	--
Rainfall Infiltration	Collection of rainfall for salinity assessment	Determine rainfall salinity for comparison to seepage water	--

¹⁷ Kau, P.M.H., Hitchcock, P.W., Smith, D.W and Binning, P (1995), *Laboratory Estimation of the Diffusion and Partition Coefficients of Fluoride in Kaolin*, submitted to NUMOGV, Fifth International Symposium on Numerical Methods in Geomechanics, Davos, Switzerland, September 1999

¹⁸ Australian Drinking Water Guidelines 6 2011, v3.9, *Part 5: Fact Sheets > Physical and Chemical Characteristics, Trihalomethanes (THMs)*, accessed via <https://guidelines.nhmrc.gov.au/australian-drinking-water-guidelines/part-5/physical-chemical-characteristics/trihalomethanes-thms>

Expert Report – Phillip Hitchcock
 Board of Inquiry, McCrae Landslide
 Date Issued: 21 July 2025



Source	Activity	Reason	Comment
Stormwater Leakage	Review of recent dye tracer results	Assess flow paths near leakage sources	Test reporting in PSM (2025c) report results are said to be pending
	Review of dye tracer results	Assess flow paths near leakage sources	Test reporting in PSM (2025c) report results are said to be pending
Mains Water Leakage	Sample and analyse mains water for disinfection chemicals	Assess tracer compounds unique to mains water	--
	Sample seepage water for 1. Major cations and anions 2. Fluoride 3. Salinity Disinfectant chemicals	Assess general geochemistry of seepage water and disinfection parameters	--
Soil Testing	Collect and analyse shallow soil samples for total and leachable salinity and fluoride levels	Assess soil contribution to seepage water salinity and fluoride levels	--

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



Attachment 1 – Instructions

MinterEllison.

21 July 2025

BY EMAIL

Phillip Hitchcock
Director
Australian Environmental Auditors
335 Carrington Street
Adelaide SA 5000

CONFIDENTIAL AND SUBJECT TO LEGAL PROFESSIONAL PRIVILEGE

Dear Mr Hitchcock

McCrae Landslip

1. We refer to and rely on the contents of our letter to you dated 3 July 2025.
2. With reference to the Board's proposal at paragraph 9(a) of our letter dated 3 July 2025, we request you review the documents included with the letter dated 3 July 2025 and prepare, for the purpose of the Board's inquiry, an expert report containing your opinion as to the cause(s) of the McCrae Landslide, focusing on the issue of groundwater.
3. Please contact Greg Carfoot on (03) 8608 2343 or Emily Miers on (02) 9921 4398 with any questions concerning any aspect of this letter.
4. Please let us know if there is any information or documents that would assist you and we can seek instructions.

Yours faithfully
MinterEllison

Irrelevant & Sensitive

Contact: Thanh Bui T: +61 3 8608 2542
thanh.bui@minterellison.com
Partner: Greg Carfoot T: +61 3 8608 2343
OUR REF: TRB GJC 1528114

Level 20 Collins Arch Melbourne
GPO Box 769 Melbourne VIC 3001 Australia
T +61 3 8608 2000 F +61 3 4232 3920 minterellison.com

ME_955229217_1

MinterEllison.

3 July 2025

BY EMAIL

Phillip Hitchcock
Director
Australian Environmental Auditors
335 Carrington Street
Adelaide SA 5000

CONFIDENTIAL AND SUBJECT TO LEGAL PROFESSIONAL PRIVILEGE


Dear Mr Hitchcock

McCrae Landslip

1. We act on behalf of Mornington Peninsula Shire Council (**Council**).

Background

2. As you may be aware, on 14 January 2025 a landslip occurred in McCrae located on the Mornington Peninsula, Victoria (**landslip**). We are instructed that the landslip was from 10-12 View Point Road, McCrae towards 3 Penny Lane, McCrae. We understand that 3 Penny Lane, McCrae was destroyed as a result of the landslip.
3. As a result of the landslip, a number of occupants in the surrounding area were evacuated. A list of the evacuated properties is contained in **Annexure A** and are outlined in the below map:

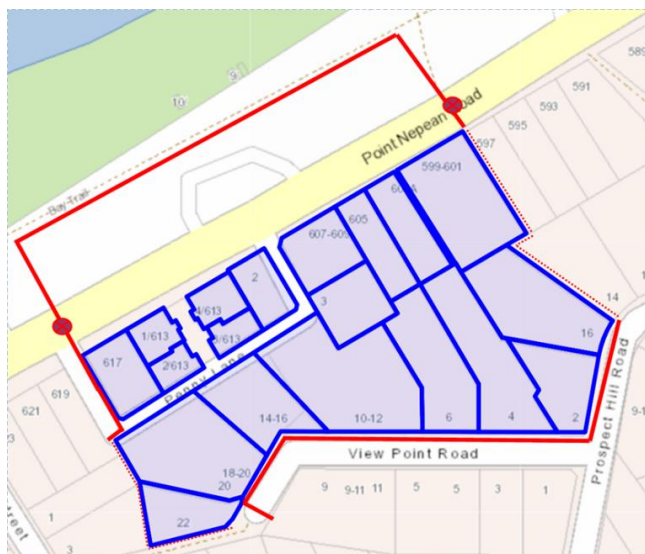

Level 20 Collins Arch Melbourne
GPO Box 769 Melbourne VIC 3001 Australia
T +61 3 8608 2000 F +61 3 4232 3920 minterellison.com

ME_954591467_1

Inquiry

4. On 18 March 2025, the Victorian State Government, on the recommendation of the Premier under s 53(1) of the *Inquiries Act 2014* (Vic), appointed Renée Enbom KC to constitute a Board of Inquiry in relation to the landslip (**Board**).
5. Amongst other issues, the Board is required to inquire into, report on and make any recommendations considered appropriate concerning the causes of the landslip.
6. The Board is required to deliver a final report to the Victorian Government by **10 September 2025**.
7. In the course of its inquiries, the Board has conducted hearing blocks during May and June 2025 and will hold further public hearings in the weeks of 4 and 18 August 2025 at the Federal Court of Australia at 305 William Street, Melbourne.
8. The Board has indicated to Council that the public hearing to occur in the week of 4 August 2025 will provide an opportunity for Council to present expert evidence about any causes of the landslip.
9. In preparation for the public hearing during the week of 4 August 2025, the Board has proposed:
 - (a) any expert report which contains an opinion as to the cause(s) of the landslip be finalised by no later than 21 July 2025;
 - (b) that there be a conclave of the experts between 21 July 2025 and 29 July 2025, with the experts to prepare a short joint report following any conclave; and
 - (c) expert witnesses give evidence concurrently in the week of 4 August 2025.

Matters in respect of which your opinion is sought

10. We wish to retain you on behalf of Council with the view to you providing an expert opinion for the purposes of the Board's inquiry and any proceedings.
11. We request you review the documents included with this brief and make yourself available for a videoconference with us prior to preparing any written expert report.
12. While your attendance at the Board's proposed expert conclave and upcoming public hearing (discussed at paragraph 9 above) is yet to be confirmed, we ask that you retain the necessary availability to attend in person in Melbourne. We will confirm closer to the time if and when you are required to attend.
13. We note that the area affected by the landslip is currently under the control of the State Emergency Service who have set up an exclusion zone in respect of the evacuated properties and access is therefore restricted. To the extent that you identify that in the scope of your engagement you require a visit of the area affected, we request that you:
 - (a) undertake a visit of the area affected insofar as possible given the current exclusion zone; and
 - (b) outline what investigations you consider are necessary and the anticipated timeframe of these investigations.

Duties of an expert

14. Proceedings have not been issued against Council. However, if it is necessary for you to prepare a report we request that you prepare it in accordance with what is outlined below.
15. The Supreme Court of Victoria requires expert witnesses to comply with Form 44A – Expert Witness Code of Conduct (**Code**), a copy of which is provided at **Annexure B**. Please carefully review the Code and ensure that you comply with your obligations under it.
16. Any report must be prepared in accordance with Code. In particular, the Code requires every report prepared by an expert witness for use in court to clearly state the opinion or opinions of the expert and also include:

- (a) the name and address of the expert;
 - (b) an acknowledgment that the expert has read the Code and agrees to be bound by it;
 - (c) the qualifications of the expert to prepare the report;
 - (d) the assumptions and material facts on which each opinion expressed in the report is based (a letter of instructions may be annexed);
 - (e) the reasons for and any literature or other materials utilised in support of each such opinion;
 - (f) (if applicable) that a particular question, issue or matter falls outside the expert's field of expertise;
 - (g) any examinations, tests or other investigations on which the expert has relied, identifying the person who carried them out and that person's qualifications;
 - (h) to the extent to which any opinion which the expert has expressed involves the acceptance of another person's opinion, the identification of that other person and opinion expressed by that other person;
 - (i) a declaration that the expert has made all the inquiries which the expert believes are desirable and appropriate, (save for any matters identified explicitly in the report) and that no matters of significance which the expert regards as relevant have, to the knowledge of the expert, been withheld from the court;
 - (j) any qualification of an opinion expressed in the report without which the report is or may be incomplete or inaccurate;
 - (k) whether any opinion expressed in the report is not a concluded opinion because of insufficient research or insufficient data or for any other reason; and
 - (l) where the report is lengthy or complex, an executive summary of your conclusions at the start of your report.
17. Please check each of these requirements carefully, and ensure that any report you prepare complies with them.
18. The *Civil Procedure Act 2010* (Vic) (the **Act**) also imposes obligations on all participants in litigation, including expert witnesses. The obligations set out in Part 2.3 of the Act for your review are detailed at **Annexure C**.
19. When providing any report, please confirm that you have read, understood and agree to comply with the Code and the Act. If you are unsure of your obligations under the Code or the Act, please let us know.

Materials provided to you

20. Please keep a copy and record of all documents provided to you during the course of your engagement.
21. We provide with this letter an electronic copy of documents to assist during the course of your engagement, accessible via the link provided:

<https://share.minterellison.com/#/folder/e11d3ed8-96e0-4165-81b3-35db48a5c9a8>

Engagement

22. Your engagement will be governed by:
- (a) this letter; and
 - (b) commercial terms provided by you to MinterEllison on 18 June 2025.

MinterEllison.

23. You will be engaged by MinterEllison on behalf of Council and Council will be liable for the payment of your fees. However, we request that all invoices be directed to MinterEllison, attention: Greg Carfoot. Please send us your invoice at least 2 business days before the end of the month so we can include your invoice in our monthly invoice to Council. Any invoices received later will be included in our following month's invoice to Council. MinterEllison will pay your invoices upon receipt of equivalent funds from Council, which may be later than the due date for payment set out on your invoices.
24. Please provide an estimate of your fees based on the scope of your retainer as outlined above.
25. Please contact Greg Carfoot on (03) 8608 2343 or Emily Miers on (02) 9921 4398 with any questions concerning any aspect of this letter.
26. Please let us know if there is any information or documents that would assist you and we can seek instructions.

Yours faithfully
MinterEllison

Irrelevant & Sensitive

Contact: Thanh Bui T: +61 3 8608 2542
thanh.bui@minterellison.com
Partner: Greg Carfoot T: +61 3 8608 2343
OUR REF: TRB GJC 1528114

Annexure A

List of evacuated properties

2 Penny Lane
3 Penny Lane
599 Point Nepean Road
603 Point Nepean Road
605 Point Nepean Road
607-609 Point Nepean Road
613 Point Nepean Road
1/613 Point Nepean Road
2/613 Point Nepean Road
3/613 Point Nepean Road
4/613 Point Nepean Road
617 Point Nepean Road
16 Prospect Hill Road
2 View Point Road
4 View Point Road
6 View Point Road
10-12 View Point Road
14-16 View Point Road
18-20 View Point Road
22 View Point Road

Annexure B**FORM 44A – Expert Witness Code of Conduct**

1. A person engaged as an expert witness has an overriding duty to assist the Court impartially on matters relevant to the area of expertise of the witness.
2. An expert witness is not an advocate for a party.
3. Every report prepared by an expert witness for the use of the Court shall state the opinion or opinions of the expert and shall state, specify or provide—
 - (a) the name and address of the expert;
 - (b) an acknowledgement that the expert has read this code and agrees to be bound by it;
 - (c) the qualifications of the expert to prepare the report;
 - (d) the facts, matters and assumptions on which each opinion expressed in the report is based (a letter of instructions may be annexed);
 - (e)
 - (i) the reasons for,
 - (ii) any literature or other materials utilised in support of,
 - (iii) a summary of—
 each such opinion;
 - (f) (if applicable) that a particular question, issue or matter falls outside the expert's field of expertise;
 - (g) any examinations, tests or other investigations on which the expert has relied, identifying the person who carried them out and that person's qualifications;
 - (h) a declaration that the expert has made all the inquiries which the expert believes are desirable and appropriate, and that no matters of significance which the expert regards as relevant have, to the knowledge of the expert, been withheld from the Court;
 - (i) any qualification of an opinion expressed in the report without which the report is or may be incomplete or inaccurate; and
 - (j) whether any opinion expressed in the report is not a concluded opinion because of insufficient research or insufficient data or for any other reason.
4. Where an expert witness has provided to a party (or that party's legal representative) a report for the use of the Court, and the expert thereafter changes his or her opinion on a material matter, the expert shall forthwith provide to the party (or that party's legal representative) a supplementary report which shall state, specify or provide the information referred to in paragraphs (a), (d), (e), (g), (h), (i) and (j) of clause 3 of this code and, if applicable, paragraph (f) of that clause.
5. If directed to do so by the Court, an expert witness shall—
 - (a) confer with any other expert witness; and
 - (b) provide the Court with a joint report specifying (as the case requires) matters agreed and matters not agreed and the reasons for the experts not agreeing.
6. Each expert witness shall exercise his or her independent judgment in relation to every conference in which the expert participates pursuant to a direction of the Court and in relation to each report thereafter provided, and shall not act on any instruction or request to withhold or avoid agreement.

Annexure C

CIVIL PROCEDURE ACT 2010 NO. 47 OF 2010

PART 2.3- THE OVERARCHING OBLIGATIONS

16 Paramount duty

Each person to whom the overarching obligations apply has a paramount duty to the court to further the administration of justice in relation to any civil proceeding in which that person is involved, including, but not limited to—

- (a) any interlocutory application or interlocutory proceeding;
- (b) any appeal from an order or a judgment in a civil proceeding;
- (c) any appropriate dispute resolution undertaken in relation to a civil proceeding.

17 Overarching obligation to act honestly

A person to whom the overarching obligations apply must act honestly at all times in relation to a civil proceeding.

18 Overarching obligation—requirement of proper basis

A person to whom the overarching obligations apply must not make any claim or make a response to any claim in a civil proceeding that—

- (a) is frivolous; or
- (b) is vexatious; or
- (c) is an abuse of process; or
- (d) does not, on the factual and legal material available to the person at the time of making the claim or responding to the claim, as the case requires, have a proper basis.

19 Overarching obligation to only take steps to resolve or determine dispute

For the purpose of avoiding undue delay and expense, a person to whom the overarching obligations apply must not take any step in connection with any claim or response to any claim in a civil proceeding unless the person reasonably believes that the step is necessary to facilitate the resolution or determination of the proceeding.

20 Overarching obligation to cooperate in the conduct of civil proceeding

A person to whom the overarching obligations apply must cooperate with the parties to a civil proceeding and the court in connection with the conduct of that proceeding.

21 Overarching obligation not to mislead or deceive

A person to whom the overarching obligations apply must not, in respect of a civil proceeding, engage in conduct which is—

- (a) misleading or deceptive; or
- (b) likely to mislead or deceive.

22 Overarching obligation to use reasonable endeavours to resolve dispute

A person to whom the overarching obligations apply must use reasonable endeavours to resolve a dispute by agreement between the persons in dispute, including, if appropriate, by appropriate dispute resolution, unless—

- (a) it is not in the interests of justice to do so; or
- (b) the dispute is of such a nature that only judicial determination is appropriate.

Example A proceeding where a civil penalty is sought may be of such a nature that only judicial determination is appropriate.

23 Overarching obligation to narrow the issues in dispute

If a person to whom the overarching obligations apply cannot resolve a dispute wholly by agreement, the person must use reasonable endeavours to—

- (a) resolve by agreement any issues in dispute which can be resolved in that way; and
- (b) narrow the scope of the remaining issues in dispute—

unless—

- (c) it is not in the interests of justice to do so; or
- (d) the dispute is of such a nature that only judicial determination is appropriate.

24 Overarching obligation to ensure costs are reasonable and proportionate

A person to whom the overarching obligations apply must use reasonable endeavours to ensure that legal costs and other costs incurred in connection with the civil proceeding are reasonable and proportionate to—

- (a) the complexity or importance of the issues in dispute; and
- (b) the amount in dispute.

25 Overarching obligation to minimise delay

For the purpose of ensuring the prompt conduct of a civil proceeding, a person to whom the overarching obligations apply must use reasonable endeavours in connection with the civil proceeding to—

- (a) act promptly; and
- (b) minimise delay.

26 Overarching obligation to disclose existence of documents

- (1) Subject to subsection (3), a person to whom the overarching obligations apply must disclose to each party the existence of all documents that are, or have been, in that person's possession, custody or control—
 - (a) of which the person is aware; and
 - (b) which the person considers, or ought reasonably consider, are critical to the resolution of the dispute.
- (2) Disclosure under subsection (1) must occur at—
 - (a) the earliest reasonable time after the person becomes aware of the existence of the document; or
 - (b) such other time as a court may direct.
- (3) Subsection (1) does not apply to any document which is protected from disclosure—
 - (a) on the grounds of privilege which has not been expressly or impliedly waived; or
 - (b) under any Act (including any Commonwealth Act) or other law.
- (4) The overarching obligation imposed by this section—
 - (a) is an ongoing obligation for the duration of the civil proceeding; and
 - (b) does not limit or affect a party's obligations in relation to discovery.

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



Attachment 2 Phillip Hitchcock CV



Phillip Hitchcock

Managing Director
Principal Auditor

08 8223 3488

phitchcock@envaud.com.au



SYNOPSIS

Phillip Hitchcock is the Managing Director and Principal Auditor of Australian Environmental Auditors (AEA). He is a hydrogeologist with more than 30 years consulting experience providing environmental advice in relation to hydrogeology, landfill, soil and groundwater contamination issues.

Mr Hitchcock is a contaminated sites auditor, accredited by the South Australian EPA and WA DER completing over 70 audits in WA and 80 in SA.

EXPERIENCE SUMMARY

Over the years, Mr Hitchcock has conducted contaminated site assessments and audits for over 1000 projects including Phase 1 assessments, Phase 2 assessments, preparation of Remedial Action Plans and management of remediation projects. These projects have covered a large range of sites including landfills, service stations, depots, marine sediments, port-related activities, industrial sites, quarries and railway facilities and demonstrate a strong and diverse track record in contaminated site assessment and management.

Mr Hitchcock is a renowned, experienced auditor and has worked in all States and Territories. He has just about seen all scenarios, contaminants and assisted on resolving his Clients' issues to move projects forward successfully.

He has provided expert support in the areas of hydrogeology and fate and transport of contaminants and has a strong geotechnical background.

EXPERTISE & PROJECT EXAMPLES

Groundwater Remediation

- Hamilton - groundwater modelling to predict flow rates necessary to reverse hydraulic gradient for groundwater remediation
- Williamstown - groundwater study to assess contaminant levels and flowpaths for fuel spill at RAAF base
- Wollongong Gasworks - Pump and treat for high levels of BTEX, TPH, PAH
- Steel Street Gasworks - Pump and treat for elevated BTEX, TPH and PAH levels
- Former Fisherman's Coop, Newcastle, pump and treat for Diesel and Oil
- Mobil Wickham - assessment of Natural Attenuation processes at former service station site
- Islington - assessment of Natural Attenuation processes at operating service station site

ENVIRONMENTAL AUDITOR ACCREDITATION

Contaminated Sites Auditor - Western Australia, 2007

Site Contamination Auditor - South Australia, 2009

QUALIFICATIONS

Bachelor of Science (Honours),
Geology, Monash University, Victoria,
1982

Master of Applied Science,
Hydrogeology and Contaminant
Management, University of NSW,
Sydney, 1990

Australian Environmental Auditors Pty Ltd
ABN 84 161 362 214 ACN 161 362 214

Melbourne
Suite 21, 1 Ricketts Rd
Mt Waverley VIC 3149
T 03 8542 7500

Adelaide
335 Carrington St
Adelaide SA 5000
T 08 8223 3488

Contaminated Land Auditing | Landfill Auditing | Expert Advice
W environmental-auditors.com.au E enquiries@envaud.com.au

Perth
7/80 Colin St
West Perth WA 6005
T 08 6268 0181

Sydney
101/283 Alfred St
North Sydney NSW 2060
T 02 8644 0681

Brisbane
T 07 3074 9422





Phillip Hitchcock

Managing Director
Principal Auditor

08 8223 3488

phitchcock@envaud.com.au

- Newcastle – removal of BTEX using vacuum extraction at service station
- Gunnedah – vacuum extraction at former fuel depot

Groundwater Modelling and Dewatering

- Dewatering of clarifier bases at Liverpool involving groundwater modelling using finite difference analysis (MODFLOW)
- Groundwater modelling of intake manifold at PS9, Tomago Sandbeds, using finite difference analysis (FLOWPATH)
- Groundwater modelling of Pump Station 10 at the Tomago Sand Beds to determine the effect of heavy pumpage using finite difference analysis (MODFLOW)
- Groundwater modelling to assess drawdown effects and mine in-flows during longwall mining at Cooranbong Colliery using finite difference analysis (MODFLOW)
- Queensland Nickel, dam seepage analysis finite difference model (MODFLOW)
- Dunbogan Canal Estate, wetland water balance, salt water intrusion and drainage of wetland due to canal development using finite element analysis (SUTRA)
- Parallel Runaway - groundwater modelling for design of dewatering of proposed new runway and millstream diversion
- Silverstream Estate - design of drainage measures to effect dewatering of water charged colluvium
- Tomago Aluminium, dewatering strategy using finite difference modelling (MODFLOW)
- Waterside Green – design of dewatering system for significant lake development to allow future maintenance
- Honeysuckle – basement dewatering design for high rise building, prediction of maximum groundwater levels
- Wickham – basement dewatering design and prediction of maximum groundwater levels
- Girilambone – dewatering design for open cut copper mine

Groundwater Impact Assessment

- Hinton - groundwater study to assess groundwater fluctuations in response to tides
- Kooragang Island - hydrogeological investigation to assess suitability of a site for dredgings disposal
- Hopetown - assessment of impact of roadworks on wetland groundwater levels
- Dunbogan - groundwater modelling to assess drainage options for canal estate
- Lake Tabourie - assessment of groundwater flow direction at proposed effluent disposal area
- Currumbin water balance, effect of irrigation on flooding regime

KEY AREAS OF EXPERTISE

Contaminated Site Auditing

Landfill Projects

Groundwater remediation

Groundwater Modelling and
Dewatering

Groundwater Impact Assessment

Mining Related Hydrogeological
Projects

Groundwater Resource and Modelling

Industrial Contamination

Gasworks

Fuel Related Contamination

Contamination at Mine Sites

Environmental Compliance Audits

Sediment Studies

Acid Sulphate Soils

Landfill Projects



Phillip Hitchcock

Managing Director
Principal Auditor

08 8223 3488

phitchcock@envaud.com.au

- Hydrochemical study to determine extent of reservoir leakage, Grahamstown Dam
- Penrith Lakes – assessment of impact on significant gravel aquifer of the dewatering for lake installation and maintenance

Mining Related Hydrogeological Projects

- Saxonvale - groundwater study to assess infiltration rates into coal chitter
- Hunter Valley No 1 Mine - Groundwater modelling to assess box cut and mine inflows into proposed coal mine, mining through alluvial flats
- Gordonstone - groundwater modelling and drainage design of coal mine
- Ravensworth - groundwater study to assess infiltration rates into coal chitter dumps
- Delta Colliery - prediction of leachate quantity and quality from proposed landfill, chitter combustibility control, hydrogeological analysis of deep and shallow aquifer
- Girilambone - hydrogeological study to assess groundwater flow rates and patterns and delineate aquifers at proposed copper mine
- Wakefield underground mine - estimation of inflows into main shaft
- Gunning basalt quarry - water balance to determine effect of mining on aquifer storage and sustainability of using spring water during mining operations
- Dewatering of right bank intake area at Ok Menga for Ok Tedi Mining Ltd (PNG), to reduce the risk of slope instability using finite difference analysis (MODFLOW)
- Warkworth Coal Mine, dewatering and pore pressure assessment using finite element analysis (SUTRA)
- Bengalla Open Cut, dewatering and pore pressure assessment using finite element analysis (SUTRA)
- East Boggabri – assessment of hydrogeology, impact of new mine on existing alluvial bore field, groundwater monitoring program and modelling using MODFLOW
- Somersby– assessment of hydrogeology, impact of new sand quarry on drinking water supply included groundwater monitoring program and modelling using MODFLOW
- Werris Creek – assessment of hydrogeology, impact of new mine on existing irrigation area, groundwater monitoring program and modelling using MODFLOW
- Pinedale– assessment of hydrogeology, impact of new mine on degraded pre-mined areas. Included piezometer installation, groundwater monitoring program and modelling using MODFLOW

Groundwater Resource and Modelling

- Coolah - water supply investigation and groundwater modelling to assess flow patterns and rates

PUBLICATIONS & PRESENTATIONS

Dawsonite Paragenesis, Field, Theoretical and Laboratory Studies Monash University Honours Thesis, 1982.

Hydrogeology, Hydrochemistry and Geophysical Conditions at Astrolabe Park, Sydney, University of New South Wales Masters Thesis, 1991.

Contaminant Transport Modelling

Hitchcock, P.W., Smith, D.W. and Booker, J.R. (1994). Leachate Plume Characterisation and Modelling at a Landfill. Second National Hazardous and Solid Waste Convention. Melbourne, May, 1994.

Hitchcock, P.W and Carr, R. (1991). The Electrical Conductivity Probe: A New Tool for Groundwater Contamination and Salinity Measurement'. Proc. 25th Newcastle Symposium on Advances in the Study of the Sydney Basin, Newcastle, NSW, April 1991.

Fluoride Migration and Landfill Design

Kau, P.M.H., Hitchcock, P.W., Smith, D.W and Binning, P (1995). Laboratory Estimation of the Diffusion and Partition Coefficients of Fluoride in Kaolin. Submitted to NUMOGV, Fifth International Symposium on Numerical Methods in Geomechanics, Davos, Switzerland, September, 1995.

- Tomago Sandbeds - groundwater modelling to determine safe yield of section of the sand beds using Modflow
- Waratah - investigation of origins and mechanisms of significant hillside water seeps
- Waratah Reservoir - hydrogeological investigation to assess degree of leakage from reservoir
- Hat Head – assessment of extent of salt water intrusion, safe yield and optimal bore placement in new bore field
- South West Rocks – assessment of safe yield and optimal bore placement in new bore field
- Stuarts Point - assessment of natural arsenic levels in drinking water aquifer

Industrial Contamination

- Moorebank – assessment and remediation of 100 hectare former Brickworks site for Boral
- Greystanes - assessment and remediation of 150 hectare former asphalt depot and disposal area for Boral
- Honeysuckle - review of site history, sampling and analysis strategy and site investigation of over 30 suites in the Honeysuckle precinct
- Shortland (BHP) - contamination survey to determine extent of phytotoxic leachate
- Rutherford - contamination assessment and remedial recommendations for the clean-up of a disused abattoir site. Contaminants included oil and grease, hydrocarbons, nitrogen, phosphorus and pesticides
- Carrington - baseline contamination survey to assess levels prior to construction of a chemical factory
- Waratah - contamination assessment for transmission line easement
- Alcan - conductivity cone testing and groundwater sampling to assess shape of leachate plume from cathode pile
- Tomago - follow up delineation of groundwater leachate plume - 18 months after initial investigation

Gasworks

- Maitland - contamination assessment to assess migration of contamination along service lines at former gasworks
- East Maitland – assessment of extent of cyanide and PAH contamination at former gasworks site. Included fate and transport, modelling to assess impact at nearest receptor
- Steel Street – remediation of gasworks including deep tar pit, gasometers and groundwater remediation
- Wollongong – remediation of gasworks including deep tar pit and groundwater remediation
- Singleton – assessment of former gasworks site
- Clyde Street – assessment of extent of soil and groundwater contamination and pilot thermal desorption study

Fuel Related Contamination

- Assessment of over 120 fuel stations and depots
- Cardiff/Marks Point/Cessnock/Narrabri/Berkeley Vale/Mt Thorley - contamination assessments of Shell depots to assess soil and groundwater contamination levels and remediation strategies
- Hamilton - assessment of groundwater and soil contamination levels resulting from a fuel spill. Remediation of groundwater undertaken
- Williamtown - assessment of extent of AVTUR spill in soil and groundwater at RAAF base
- Berkeley Vale - assessment of contaminant levels on former service station site;
- Berkeley Vale - assessment of contaminant levels on shell fuel depot



Phillip Hitchcock

Managing Director
Principal Auditor

08 8223 3488

phitchcock@envaud.com.au

- Wickham - soil gas and soil sampling to determine extent of BTX and TPH contamination at a redeveloped service station

Contamination at Mine Sites

- Warkworth - assessment of nitrate, diesel and explosive residue levels in dam run off area at explosive manufacturing plant
- Newvale - soil and groundwater contamination survey of former underground mine pit top
- Burwood Colliery - full environmental site audit, including site history/land use and contamination assessment
- Tomago - contamination assessment of ex chemical factory site. Contaminant transport modelling and plume delineation
- Delta Colliery - assessment of contaminant levels in washery and tailings dams. Landfill leachate quality prediction and baseline groundwater quality study

Environmental Compliance Audits

- Bennetts Green - environmental audit of smash repair works
- Warrabrook - environmental audit of redeveloped abattoir site
- Wickham - environmental audit of redeveloped belt repair shop
- Cardiff - environmental audit of dry cleaning service
- Rydalmere - site audit and contamination study due to owner refinancing
- Newcastle – compliance audit of earthworks undertaken at former BHP Steelworks site
- Kooragang Island – compliance audit for new coal loader

Sediment Studies

- Newcastle Harbour - over-water sampling and testing to assess levels of contaminants in material to be dredged
- Throsby Creek - baseline soil contaminant survey for proposed dredging disposal site
- Kooragang Island - study to assess leachability of contaminants from dredge spoil
- Kooragang Island - baseline groundwater and soil contamination survey of proposed dredgings disposal site
- Carrington - assessment of contaminant levels in dredge spoil prior to dredging for new wharf alignment
- The Basin - assessment of contaminant levels in material to be dredged, suitability for land or sea disposal
- Carrington - assessment of contaminant levels in material to be used to infill marine basin
- Throsby creek - survey to assess levels and water and acid leachable levels, acid sulphate testing. Sludge disposed and remedial options
- Kooragang - collection of over-water samples of material to be dredged, assessment of suitability for land and/or sea disposal, material handling recommendations

Acid Sulphate Soils

- Dunbogan - acid sulphate assessment of soils at proposed canal estate development
- Wyong - acid sulphate assessment of soils at proposed golf club and resort;
- Coffs Harbour – acid sulphate assessment of soils at proposed lake
- Dunbogan - assessment of acid sulphate levels for proposed land estate



Phillip Hitchcock

Managing Director
Principal Auditor

08 8223 3488

phitchcock@envaud.com.au

- Ballina - acid sulphate assessment and management plan for Pacific Highway Upgrade
- Coopersnook- acid sulphate assessment and management plan for Pacific Highway Upgrade;
- Brunswick Heads- acid sulphate assessment and management plan for Pacific Highway Upgrade
- Port Stephens - acid sulphate assessment and management plan for drainage easement

Contaminated Site Auditing

- Mr Hitchcock has been involved as auditor for over 350 audits throughout South Australia, New South Wales, Victoria, Tasmania and Western Australia.

Expert Witness

- Williamtown Airbase, NSW – Client Dentons. Working for a class action claim and included the assessment of adequacy of assessment of PFOS/PFOA plume at airbase and review of remedial of options.
- Pinkenba, QLD – Client: 1878 Elix Lawyers. Expert report on unexpected asbestos finds in imported topsoil to development site.
- Langhorne Creek, SA – Client: Cowell Clark. Expert report on unexpected asbestos finds in soils at a winery site. Report included remedial methods and costings.
- Alexandria, NSW- Client: Davis Advisory: Expert report on current remedial costings and costs to complete remediation appropriately.
- Cranbourne Landfill (Stephenson's Road) –Client Mallesons. Member of expert conclave regarding landfill gas migration from a landfill. Represented the insurer of the local council that approved the landfill.
- Blackwood, SA – Client – Gilchrist Connell. Review of validation of UST pit, adequacy of assessment and remedial/cost implications.
- Hazelwood Coal Mine. VIC, Client Mallesons. Expert advice on impact of mine dewatering on landslide that resulted in closing of the Princess Highway.
- Thebarton Council Depot, SA – Client DMAW lawyers. Expert advice regarding pending prosecution of a contaminated site auditor due to approval of an inadequate Remedial Action Plan (RAP).
- Brighton Dry Cleaners, SA – Client Norman Waterhouse. Expert advice regarding plume migration and extent of contamination from a dry cleaning premises to surrounding land.
- Ceduna Service Station , SA – Client Camatta Lempens Pty Ltd Lawyers. Expert advice on age of contamination from historic fuel spills and lease/license determinations.

EMPLOYMENT HISTORY

July 2013–Current	Australian Environmental Auditors Pty Ltd Managing Director, Principal Auditor Principal Environmental Engineer
2010–July 2013	Environmental Auditors Pty Ltd Director / Principal Environmental Engineer
2005–2010	Environ Australia Pty Ltd Hunter Office Manager / Principal
1995–2005	RCA Australia Pty Ltd NSW Environmental Manager/Director
1988–1993	Douglas Partners Senior Hydrogeologist



Phillip Hitchcock

Managing Director

Principal Auditor

08 8223 3488

phitchcock@envaud.com.au

1982–1988

Provincial Soil Services
Senior Geologist/Director



Phillip Hitchcock

Managing Director

Principal Auditor

08 8223 3488

phitchcock@envaud.com.au

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



Attachment 3 – Extract from Form 44A – Expert Witness Code of Conduct

Annexure B**FORM 44A – Expert Witness Code of Conduct**

1. A person engaged as an expert witness has an overriding duty to assist the Court impartially on matters relevant to the area of expertise of the witness.
2. An expert witness is not an advocate for a party.
3. Every report prepared by an expert witness for the use of the Court shall state the opinion or opinions of the expert and shall state, specify or provide—
 - (a) the name and address of the expert;
 - (b) an acknowledgement that the expert has read this code and agrees to be bound by it;
 - (c) the qualifications of the expert to prepare the report;
 - (d) the facts, matters and assumptions on which each opinion expressed in the report is based (a letter of instructions may be annexed);
 - (e)
 - (i) the reasons for,
 - (ii) any literature or other materials utilised in support of,
 - (iii) a summary of—
 each such opinion;
 - (f) (if applicable) that a particular question, issue or matter falls outside the expert's field of expertise;
 - (g) any examinations, tests or other investigations on which the expert has relied, identifying the person who carried them out and that person's qualifications;
 - (h) a declaration that the expert has made all the inquiries which the expert believes are desirable and appropriate, and that no matters of significance which the expert regards as relevant have, to the knowledge of the expert, been withheld from the Court;
 - (i) any qualification of an opinion expressed in the report without which the report is or may be incomplete or inaccurate; and
 - (j) whether any opinion expressed in the report is not a concluded opinion because of insufficient research or insufficient data or for any other reason.
4. Where an expert witness has provided to a party (or that party's legal representative) a report for the use of the Court, and the expert thereafter changes his or her opinion on a material matter, the expert shall forthwith provide to the party (or that party's legal representative) a supplementary report which shall state, specify or provide the information referred to in paragraphs (a), (d), (e), (g), (h), (i) and (j) of clause 3 of this code and, if applicable, paragraph (f) of that clause.
5. If directed to do so by the Court, an expert witness shall—
 - (a) confer with any other expert witness; and
 - (b) provide the Court with a joint report specifying (as the case requires) matters agreed and matters not agreed and the reasons for the experts not agreeing.
6. Each expert witness shall exercise his or her independent judgment in relation to every conference in which the expert participates pursuant to a direction of the Court and in relation to each report thereafter provided, and shall not act on any instruction or request to withhold or avoid agreement.

Annexure C**CIVIL PROCEDURE ACT 2010 NO. 47 OF 2010****PART 2.3- THE OVERARCHING OBLIGATIONS****16 Paramount duty**

Each person to whom the overarching obligations apply has a paramount duty to the court to further the administration of justice in relation to any civil proceeding in which that person is involved, including, but not limited to—

- (a) any interlocutory application or interlocutory proceeding;
- (b) any appeal from an order or a judgment in a civil proceeding;
- (c) any appropriate dispute resolution undertaken in relation to a civil proceeding.

17 Overarching obligation to act honestly

A person to whom the overarching obligations apply must act honestly at all times in relation to a civil proceeding.

18 Overarching obligation—requirement of proper basis

A person to whom the overarching obligations apply must not make any claim or make a response to any claim in a civil proceeding that—

- (a) is frivolous; or
- (b) is vexatious; or
- (c) is an abuse of process; or
- (d) does not, on the factual and legal material available to the person at the time of making the claim or responding to the claim, as the case requires, have a proper basis.

19 Overarching obligation to only take steps to resolve or determine dispute

For the purpose of avoiding undue delay and expense, a person to whom the overarching obligations apply must not take any step in connection with any claim or response to any claim in a civil proceeding unless the person reasonably believes that the step is necessary to facilitate the resolution or determination of the proceeding.

20 Overarching obligation to cooperate in the conduct of civil proceeding

A person to whom the overarching obligations apply must cooperate with the parties to a civil proceeding and the court in connection with the conduct of that proceeding.

21 Overarching obligation not to mislead or deceive

A person to whom the overarching obligations apply must not, in respect of a civil proceeding, engage in conduct which is—

- (a) misleading or deceptive; or
- (b) likely to mislead or deceive.

22 Overarching obligation to use reasonable endeavours to resolve dispute

A person to whom the overarching obligations apply must use reasonable endeavours to resolve a dispute by agreement between the persons in dispute, including, if appropriate, by appropriate dispute resolution, unless—

- (a) it is not in the interests of justice to do so; or
- (b) the dispute is of such a nature that only judicial determination is appropriate.

Example A proceeding where a civil penalty is sought may be of such a nature that only judicial determination is appropriate.

23 Overarching obligation to narrow the issues in dispute

If a person to whom the overarching obligations apply cannot resolve a dispute wholly by agreement, the person must use reasonable endeavours to—

- (a) resolve by agreement any issues in dispute which can be resolved in that way; and
- (b) narrow the scope of the remaining issues in dispute—

unless—

- (c) it is not in the interests of justice to do so; or
- (d) the dispute is of such a nature that only judicial determination is appropriate.

24 Overarching obligation to ensure costs are reasonable and proportionate

A person to whom the overarching obligations apply must use reasonable endeavours to ensure that legal costs and other costs incurred in connection with the civil proceeding are reasonable and proportionate to—

- (a) the complexity or importance of the issues in dispute; and
- (b) the amount in dispute.

25 Overarching obligation to minimise delay

For the purpose of ensuring the prompt conduct of a civil proceeding, a person to whom the overarching obligations apply must use reasonable endeavours in connection with the civil proceeding to—

- (a) act promptly; and
- (b) minimise delay.

26 Overarching obligation to disclose existence of documents

- (1) Subject to subsection (3), a person to whom the overarching obligations apply must disclose to each party the existence of all documents that are, or have been, in that person's possession, custody or control—
 - (a) of which the person is aware; and
 - (b) which the person considers, or ought reasonably consider, are critical to the resolution of the dispute.
- (2) Disclosure under subsection (1) must occur at—
 - (a) the earliest reasonable time after the person becomes aware of the existence of the document; or
 - (b) such other time as a court may direct.
- (3) Subsection (1) does not apply to any document which is protected from disclosure—
 - (a) on the grounds of privilege which has not been expressly or impliedly waived; or
 - (b) under any Act (including any Commonwealth Act) or other law.
- (4) The overarching obligation imposed by this section—
 - (a) is an ongoing obligation for the duration of the civil proceeding; and
 - (b) does not limit or affect a party's obligations in relation to discovery.

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



Attachment 4 – List of Files Provided

Count	Document ID	Document Date	Document Type	Title
1	PSM.5000.0001.0001	19/12/2006	Email	RE: P06-1090_6-8 The Eyrie McCrae
2	PSM.5000.0001.0003	19/12/2006	Attachment	27072-Report-1.1.pdf
3	PSM.5000.0001.0006	19/12/2006	Attachment	Lane Piper Standard Conditions of Engagement.pdf
4	PSM.5000.0001.0008	9/08/2011	Email	209242.1 - Review of GeotAust Report, 14-16 View Point Rd, McCrae
5	PSM.5000.0001.0009	9/08/2011	Attachment	209242 - Report Review, GeoAust 8-8-11.pdf
6	PSM.5000.0001.0013	20/04/2020	Email	P20/0578 - 603 Point Nepean Road MCCRAE
7	PSM.5000.0001.0014	20/04/2020	Attachment	PERMIT notice.pdf
8	PSM.5000.0001.0018	20/04/2020	Attachment	P20_0578 - Endorsed Plans.PDF
9	PSM.5000.0001.0021	8/11/2023	Electronic File	121628.pdf
10	PSM.5000.0001.0022	8/11/2023	Electronic File	121754.pdf
11	PSM.5000.0001.0023	8/11/2023	Electronic File	121755.pdf
12	PSM.5000.0001.0024	8/11/2023	Electronic File	121702.pdf
13	PSM.5000.0001.0025	8/11/2023	Electronic File	121837.pdf
14	PSM.5000.0001.0026	8/11/2023	Electronic File	121838.pdf
15	PSM.5000.0001.0027	8/11/2023	Electronic File	121839.pdf
16	PSM.5000.0001.0028	8/11/2023	Electronic File	121840.pdf
17	PSM.5000.0001.0029	8/11/2023	Electronic File	121841.pdf
18	PSM.5000.0001.0030	8/11/2023	Electronic File	121842.pdf
19	PSM.5000.0001.0031	8/11/2023	Electronic File	121843.pdf
20	PSM.5000.0001.0032	8/11/2023	Electronic File	121844.pdf
21	PSM.5000.0001.0033	8/11/2023	Electronic File	121845.pdf
22	PSM.5000.0001.0034	8/11/2023	Electronic File	121846.pdf
23	PSM.5000.0001.0035	8/11/2023	Electronic File	121847.pdf
24	PSM.5000.0001.0036	8/11/2023	Electronic File	121848.pdf
25	PSM.5000.0001.0037	8/11/2023	Electronic File	121849.pdf
26	PSM.5000.0001.0038	8/11/2023	Electronic File	121850.pdf
27	PSM.5000.0001.0039	8/11/2023	Electronic File	121851.pdf
28	PSM.5000.0001.0040	8/11/2023	Electronic File	121852.pdf
29	PSM.5000.0001.0041	8/11/2023	Electronic File	121853.pdf
30	PSM.5000.0001.0042	8/11/2023	Electronic File	121854.pdf
31	PSM.5000.0001.0043	8/11/2023	Electronic File	121855.pdf
32	PSM.5000.0001.0044	8/11/2023	Electronic File	121856.pdf
33	PSM.5000.0001.0045	8/11/2023	Electronic File	121857.pdf
34	PSM.5000.0001.0046	8/11/2023	Electronic File	122011.pdf
35	PSM.5000.0001.0047	8/11/2023	Electronic File	122012.pdf
36	PSM.5000.0001.0048	8/11/2023	Electronic File	122013.pdf
37	PSM.5000.0001.0049	8/11/2023	Electronic File	122032.pdf
38	PSM.5000.0001.0050	8/11/2023	Electronic File	122208.pdf
39	PSM.5000.0001.0051	8/11/2023	Electronic File	122209.pdf
40	PSM.5000.0001.0052	8/11/2023	Electronic File	122210.pdf
41	PSM.5000.0001.0053	8/11/2023	Electronic File	122222.pdf
42	PSM.5000.0001.0054	8/11/2023	Electronic File	122223.pdf
43	PSM.5000.0001.0055	8/11/2023	Electronic File	122224.pdf
44	PSM.5000.0001.0056	8/11/2023	Electronic File	122225.pdf
45	PSM.5000.0001.0057	8/11/2023	Electronic File	122226.pdf
46	PSM.5000.0001.0058	8/11/2023	Electronic File	122227.pdf
47	PSM.5000.0001.0059	8/11/2023	Electronic File	122228.pdf
48	PSM.5000.0001.0060	8/11/2023	Electronic File	122229.pdf
49	PSM.5000.0001.0061	8/11/2023	Electronic File	122230.pdf
50	PSM.5000.0001.0062	8/11/2023	Electronic File	122231.pdf
51	PSM.5000.0001.0063	8/11/2023	Electronic File	122232.pdf
52	PSM.5000.0001.0064	8/11/2023	Electronic File	122275.pdf
53	PSM.5000.0001.0065	8/11/2023	Electronic File	122276.pdf
54	PSM.5000.0001.0066	8/11/2023	Electronic File	122277.pdf
55	PSM.5000.0001.0067	8/11/2023	Electronic File	122278.pdf

Count	Document ID	Document Date	Document Type	Title
56	PSM.5000.0001.0068	8/11/2023	Electronic File	122279.pdf
57	PSM.5000.0001.0069	8/11/2023	Electronic File	123053.pdf
58	PSM.5000.0001.0070	8/11/2023	Electronic File	123160.pdf
59	PSM.5000.0001.0071	6/12/2023	Email	PSM5226-009E Risk Assessment. 10-12 View-Point Road, McRae [IMAN ACTIVE FID5022001]
60	PSM.5000.0001.0078	6/12/2023	Attachment	PSM5226-002L.pdf
61	PSM.5000.0001.0079	1/02/2024	Electronic File	319000_5753000.las
62	PSM.5000.0001.0080	1/02/2024	Electronic File	320000_5754000.las
63	PSM.5000.0001.0081	1/02/2024	Electronic File	320000_5753000.las
64	PSM.5000.0001.0082	29/02/2024	Email	PSM5226-010E Proposal for geotechnical services - 10-12 View Point Rd, McRae
65	PSM.5000.0001.0085	29/02/2024	Attachment	Letter to D Pope 28.02.2024(15908238.1).pdf
66	PSM.5000.0001.0086	29/04/2024	Email	PSM5226-011E Shallow Landslide Barrier Design Parameters 10-12 View Point Rd, McRae [IMAN ACTIVE FID5022001]
67	PSM.5000.0001.0090	10/05/2024	Attachment	DJI_0966.JPG
68	PSM.5000.0001.0091	10/05/2024	Attachment	Area at toe of slope where barrier would be installed.HEIC
69	PSM.5000.0001.0092	10/05/2024	Attachment	Landslide Barrier Sketch.pdf
70	PSM.5000.0001.0093	20/05/2024	Email	PSM5226-012E Fees for addendum to advice
71	PSM.5000.0001.0094	13/08/2024	Email	PSM5226-013E Fees for discussion of rectification solutions with the Fence
72	PSM.5000.0001.0096	15/08/2024	Email	RE: PSM5226-013E Rev 1 Fees for discussion of rectification solutions with the Fence
73	PSM.5000.0001.0098	3/10/2024	Email	PSM5226-015E Proposed fees for discussion of debris fence solution
74	PSM.5000.0001.0099	24/10/2024	Email	PSM5226-016E Risk to life - Willigenburg
75	PSM.5000.0001.0102	14/11/2024	Attachment	PL Sim 4 50m3.pdf
76	PSM.5000.0001.0104	14/11/2024	Attachment	122573 Prep2 Rev1 - Report McCrae.pdf
77	PSM.5000.0001.0107	14/11/2024	Attachment	PL Sim 6 20m3.pdf
78	PSM.5000.0001.0109	26/12/2024	Electronic File	Concrete.Cast-In-Place.Flat.Grey.1.jpg
79	PSM.5000.0001.0110	6/01/2025	Electronic File	IMG_0748.HEIC
80	PSM.5000.0001.0111	6/01/2025	Electronic File	IMG_0749.HEIC
81	PSM.5000.0001.0112	6/01/2025	Electronic File	IMG_0750.HEIC
82	PSM.5000.0001.0113	6/01/2025	Electronic File	IMG_0751.HEIC
83	PSM.5000.0001.0114	6/01/2025	Electronic File	IMG_0752.HEIC
84	PSM.5000.0001.0115	6/01/2025	Electronic File	IMG_0753.HEIC
85	PSM.5000.0001.0116	6/01/2025	Electronic File	IMG_0754.HEIC
86	PSM.5000.0001.0117	6/01/2025	Electronic File	IMG_0755.HEIC
87	PSM.5000.0001.0118	6/01/2025	Electronic File	IMG_0756.HEIC
88	PSM.5000.0001.0119	6/01/2025	Electronic File	IMG_0757.HEIC
89	PSM.5000.0001.0120	6/01/2025	Electronic File	IMG_0758.HEIC
90	PSM.5000.0001.0121	6/01/2025	Electronic File	IMG_0759.HEIC
91	PSM.5000.0001.0122	6/01/2025	Electronic File	IMG_0760.HEIC
92	PSM.5000.0001.0123	6/01/2025	Electronic File	IMG_0761.MOV
93	PSM.5000.0001.0124	6/01/2025	Electronic File	IMG_0762.HEIC
94	PSM.5000.0001.0125	6/01/2025	Electronic File	IMG_0763.HEIC
95	PSM.5000.0001.0126	6/01/2025	Electronic File	IMG_0764.HEIC
96	PSM.5000.0001.0127	6/01/2025	Electronic File	IMG_0765.HEIC
97	PSM.5000.0001.0128	6/01/2025	Electronic File	IMG_0766.HEIC
98	PSM.5000.0001.0129	6/01/2025	Electronic File	IMG_0767.HEIC
99	PSM.5000.0001.0130	6/01/2025	Electronic File	IMG_0768.HEIC
100	PSM.5000.0001.0131	6/01/2025	Electronic File	IMG_0769.HEIC
101	PSM.5000.0001.0132	6/01/2025	Electronic File	IMG_0770.HEIC
102	PSM.5000.0001.0133	6/01/2025	Electronic File	IMG_0771.HEIC
103	PSM.5000.0001.0134	6/01/2025	Electronic File	IMG_0772.HEIC
104	PSM.5000.0001.0135	6/01/2025	Electronic File	IMG_0773.HEIC
105	PSM.5000.0001.0136	6/01/2025	Electronic File	IMG_0774.HEIC
106	PSM.5000.0001.0137	6/01/2025	Electronic File	IMG_0775.HEIC
107	PSM.5000.0001.0138	6/01/2025	Electronic File	IMG_0776.HEIC
108	PSM.5000.0001.0139	6/01/2025	Electronic File	IMG_0777.HEIC
109	PSM.5000.0001.0140	6/01/2025	Electronic File	IMG_0778.HEIC
110	PSM.5000.0001.0141	6/01/2025	Electronic File	IMG_0779.HEIC

Count	Document ID	Document Date	Document Type	Title
111	PSM.5000.0001.0142	6/01/2025	Electronic File	IMG_0780.HEIC
112	PSM.5000.0001.0143	6/01/2025	Electronic File	IMG_0781.HEIC
113	PSM.5000.0001.0144	6/01/2025	Electronic File	IMG_0782.HEIC
114	PSM.5000.0001.0145	6/01/2025	Electronic File	IMG_0783.HEIC
115	PSM.5000.0001.0146	6/01/2025	Electronic File	IMG_0784.HEIC
116	PSM.5000.0001.0147	6/01/2025	Electronic File	IMG_0785.HEIC
117	PSM.5000.0001.0148	6/01/2025	Electronic File	IMG_0786.HEIC
118	PSM.5000.0001.0149	6/01/2025	Electronic File	IMG_0787.MOV
119	PSM.5000.0001.0150	6/01/2025	Electronic File	IMG_0788.MOV
120	PSM.5000.0001.0151	6/01/2025	Electronic File	IMG_0789.HEIC
121	PSM.5000.0001.0152	6/01/2025	Electronic File	IMG_0790.HEIC
122	PSM.5000.0001.0153	6/01/2025	Electronic File	IMG_0791.HEIC
123	PSM.5000.0001.0154	6/01/2025	Electronic File	IMG_0792.HEIC
124	PSM.5000.0001.0155	6/01/2025	Electronic File	IMG_0793.HEIC
125	PSM.5000.0001.0156	6/01/2025	Electronic File	IMG_0794.HEIC
126	PSM.5000.0001.0157	6/01/2025	Electronic File	IMG_0795.HEIC
127	PSM.5000.0001.0158	6/01/2025	Electronic File	IMG_0796.HEIC
128	PSM.5000.0001.0159	6/01/2025	Electronic File	IMG_0797.MOV
129	PSM.5000.0001.0160	6/01/2025	Electronic File	IMG_0798.HEIC
130	PSM.5000.0001.0161	6/01/2025	Electronic File	IMG_0799.HEIC
131	PSM.5000.0001.0162	6/01/2025	Electronic File	IMG_0800.HEIC
132	PSM.5000.0001.0163	6/01/2025	Electronic File	IMG_0801.HEIC
133	PSM.5000.0001.0164	6/01/2025	Electronic File	IMG_0802.HEIC
134	PSM.5000.0001.0165	6/01/2025	Electronic File	IMG_0803.HEIC
135	PSM.5000.0001.0166	6/01/2025	Electronic File	IMG_0804.HEIC
136	PSM.5000.0001.0167	6/01/2025	Electronic File	IMG_0805.HEIC
137	PSM.5000.0001.0168	6/01/2025	Electronic File	IMG_0806.MOV
138	PSM.5000.0001.0169	6/01/2025	Electronic File	IMG_0807.HEIC
139	PSM.5000.0001.0170	6/01/2025	Electronic File	IMG_0808.HEIC
140	PSM.5000.0001.0171	6/01/2025	Electronic File	TH000384.JPG
141	PSM.5000.0001.0172	6/01/2025	Electronic File	TH000385.JPG
142	PSM.5000.0001.0173	6/01/2025	Electronic File	TH000386.JPG
143	PSM.5000.0001.0174	6/01/2025	Electronic File	TH000387.JPG
144	PSM.5000.0001.0175	6/01/2025	Electronic File	TH000388.JPG
145	PSM.5000.0001.0176	6/01/2025	Electronic File	IMG_0814.HEIC
146	PSM.5000.0001.0177	6/01/2025	Electronic File	TH000389.JPG
147	PSM.5000.0001.0178	6/01/2025	Electronic File	TH000390.JPG
148	PSM.5000.0001.0179	6/01/2025	Electronic File	TH000391.JPG
149	PSM.5000.0001.0180	6/01/2025	Electronic File	IMG_0818.HEIC
150	PSM.5000.0001.0181	6/01/2025	Electronic File	IMG_0819.HEIC
151	PSM.5000.0001.0182	6/01/2025	Electronic File	IMG_0820.HEIC
152	PSM.5000.0001.0183	6/01/2025	Electronic File	IMG_0821.PNG
153	PSM.5000.0001.0184	6/01/2025	Electronic File	IMG_0822.PNG
154	PSM.5000.0001.0185	6/01/2025	Electronic File	IMG_0823.PNG
155	PSM.5000.0001.0186	6/01/2025	Electronic File	IMG_0824.PNG
156	PSM.5000.0001.0187	6/01/2025	Electronic File	IMG_0825.PNG
157	PSM.5000.0001.0188	6/01/2025	Electronic File	IMG_0826.HEIC
158	PSM.5000.0001.0189	6/01/2025	Electronic File	IMG_0827.HEIC
159	PSM.5000.0001.0190	6/01/2025	Electronic File	IMG_0828.HEIC
160	PSM.5000.0001.0191	6/01/2025	Electronic File	IMG_0829.HEIC
161	PSM.5000.0001.0192	6/01/2025	Electronic File	TH000392.JPG
162	PSM.5000.0001.0193	6/01/2025	Electronic File	TH000393.JPG
163	PSM.5000.0001.0194	6/01/2025	Electronic File	IMG_0832.HEIC
164	PSM.5000.0001.0195	6/01/2025	Electronic File	IMG_0833.HEIC
165	PSM.5000.0001.0196	7/01/2025	Email	PSM5226-017E Preliminary landslide risk assessment 3 Penny Lynn McGinnis, USGS

Count	Document ID	Document Date	Document Type	Title
166	PSM.5000.0001.0198	7/01/2025	Attachment	Photo 1.HEIC
167	PSM.5000.0001.0199	7/01/2025	Attachment	Photo 2.HEIC
168	PSM.5000.0001.0200	7/01/2025	Attachment	Figure 1 .jpg
169	PSM.5000.0001.0201	10/01/2025	Electronic File	EHFD1586.JPG
170	PSM.5000.0001.0202	10/01/2025	Electronic File	GJOD9637.JPG
171	PSM.5000.0001.0203	13/01/2025	Email	PSM5226 McCrae landslide
172	PSM.5000.0001.0206	13/01/2025	Attachment	Methodology 10-12 Viewpoint Rd Dromana.pdf
173	PSM.5000.0001.0207	13/01/2025	Attachment	Proposed works 10-12 Voewpoint.pdf
174	PSM.5000.0001.0208	13/01/2025	Email	RE: PSM5226 McCrae landslide
175	PSM.5000.0001.0231	14/01/2025	Electronic File	IMG_6348.HEIC
176	PSM.5000.0001.0232	14/01/2025	Electronic File	IMG_0858.HEIC
177	PSM.5000.0001.0233	14/01/2025	Electronic File	IMG_0859.HEIC
178	PSM.5000.0001.0234	14/01/2025	Electronic File	IMG_0860.HEIC
179	PSM.5000.0001.0235	14/01/2025	Electronic File	IMG_0861.HEIC
180	PSM.5000.0001.0236	14/01/2025	Electronic File	IMG_7892.HEIC
181	PSM.5000.0001.0237	14/01/2025	Electronic File	IMG_7892.MOV
182	PSM.5000.0001.0238	14/01/2025	Electronic File	IMG_7893.MOV
183	PSM.5000.0001.0239	14/01/2025	Electronic File	IMG_7894.MOV
184	PSM.5000.0001.0240	14/01/2025	Electronic File	IMG_0866.HEIC
185	PSM.5000.0001.0241	14/01/2025	Electronic File	IMG_0867.HEIC
186	PSM.5000.0001.0242	14/01/2025	Electronic File	IMG_0868.HEIC
187	PSM.5000.0001.0243	14/01/2025	Electronic File	IMG_0869.MOV
188	PSM.5000.0001.0244	14/01/2025	Electronic File	IMG_0870.PNG
189	PSM.5000.0001.0245	15/01/2025	Electronic File	DJI_20250114133707_0001_Z.JPG
190	PSM.5000.0001.0246	15/01/2025	Electronic File	DJI_20250114133925_0006_Z.JPG
191	PSM.5000.0001.0247	15/01/2025	Electronic File	DJI_20250114134357_0012_Z.JPG
192	PSM.5000.0001.0248	15/01/2025	Electronic File	DJI_20250114135307_0014_Z.JPG
193	PSM.5000.0001.0249	15/01/2025	Electronic File	DJI_20250114124528_0019_W.JPG
194	PSM.5000.0001.0250	15/01/2025	Electronic File	DJI_20250114133724_0002_W.JPG
195	PSM.5000.0001.0251	15/01/2025	Electronic File	DJI_20250114133724_0002_Z.JPG
196	PSM.5000.0001.0252	15/01/2025	Electronic File	DJI_20250114133809_0003_Z.JPG
197	PSM.5000.0001.0253	15/01/2025	Electronic File	DJI_20250114133843_0004_Z.JPG
198	PSM.5000.0001.0254	15/01/2025	Electronic File	DJI_20250114133903_0005_W.JPG
199	PSM.5000.0001.0255	15/01/2025	Electronic File	DJI_20250114133903_0005_Z.JPG
200	PSM.5000.0001.0256	15/01/2025	Electronic File	DJI_20250114133941_0007_Z.JPG
201	PSM.5000.0001.0257	15/01/2025	Electronic File	DJI_20250114133957_0008_W.JPG
202	PSM.5000.0001.0258	15/01/2025	Electronic File	DJI_20250114133957_0008_Z.JPG
203	PSM.5000.0001.0259	15/01/2025	Electronic File	DJI_20250114134033_0009_Z.JPG
204	PSM.5000.0001.0260	15/01/2025	Electronic File	DJI_20250114134034_0009_W.JPG
205	PSM.5000.0001.0261	15/01/2025	Electronic File	DJI_20250114134237_0010_Z.JPG
206	PSM.5000.0001.0262	15/01/2025	Electronic File	DJI_20250114134438_0013_W.JPG
207	PSM.5000.0001.0263	15/01/2025	Electronic File	DJI_20250114123817_0015_Z.JPG
208	PSM.5000.0001.0264	15/01/2025	Electronic File	DJI_20250114124049_0017_W.JPG
209	PSM.5000.0001.0265	15/01/2025	Electronic File	DJI_20250114124049_0017_Z.JPG
210	PSM.5000.0001.0266	15/01/2025	Electronic File	DJI_20250114124412_0018_W.JPG
211	PSM.5000.0001.0267	15/01/2025	Electronic File	DJI_20250114124412_0018_Z.JPG
212	PSM.5000.0001.0268	15/01/2025	Electronic File	DJI_20250114124528_0019_Z.JPG
213	PSM.5000.0001.0269	15/01/2025	Electronic File	DJI_20250114133707_0001_W.JPG
214	PSM.5000.0001.0270	15/01/2025	Electronic File	DJI_20250114133809_0003_W.JPG
215	PSM.5000.0001.0271	15/01/2025	Electronic File	DJI_20250114133843_0004_W.JPG
216	PSM.5000.0001.0272	15/01/2025	Electronic File	DJI_20250114133925_0006_W.JPG
217	PSM.5000.0001.0273	15/01/2025	Electronic File	DJI_20250114133941_0007_W.JPG
218	PSM.5000.0001.0274	15/01/2025	Electronic File	DJI_20250114134247_0011_W.MP4
219	PSM.5000.0001.0277	15/01/2025	Electronic File	DJI_20250114134357_0012_W.JPG
220	PSM.5000.0001.0278	15/01/2025	Electronic File	DJI_20250114134438_0013_Z.JPG

Count	Document ID	Document Date	Document Type	Title
221	PSM.5000.0001.0279	15/01/2025	Electronic File	DJI_20250114135308_0014_W.JPG
222	PSM.5000.0001.0280	15/01/2025	Electronic File	DJI_20250114123228_0005_W.JPG
223	PSM.5000.0001.0281	15/01/2025	Electronic File	DJI_20250114123306_0006_W.JPG
224	PSM.5000.0001.0282	15/01/2025	Electronic File	DJI_20250114123306_0006_Z.JPG
225	PSM.5000.0001.0283	15/01/2025	Electronic File	DJI_20250114123431_0008_Z.JPG
226	PSM.5000.0001.0284	15/01/2025	Electronic File	DJI_20250114123449_0009_Z.JPG
227	PSM.5000.0001.0285	15/01/2025	Electronic File	DJI_20250114123527_0010_W.JPG
228	PSM.5000.0001.0286	15/01/2025	Electronic File	DJI_20250114123538_0011_Z.JPG
229	PSM.5000.0001.0287	15/01/2025	Electronic File	DJI_20250114123547_0012_W.JPG
230	PSM.5000.0001.0288	15/01/2025	Electronic File	DJI_20250114123548_0012_Z.JPG
231	PSM.5000.0001.0289	15/01/2025	Electronic File	DJI_20250114123639_0013_Z.JPG
232	PSM.5000.0001.0290	15/01/2025	Electronic File	DJI_20250114123738_0014_W.JPG
233	PSM.5000.0001.0291	15/01/2025	Electronic File	DJI_20250114123738_0014_Z.JPG
234	PSM.5000.0001.0292	15/01/2025	Electronic File	DJI_20250114123817_0015_W.JPG
235	PSM.5000.0001.0293	15/01/2025	Electronic File	DJI_20250114123903_0016_W.JPG
236	PSM.5000.0001.0294	15/01/2025	Electronic File	DJI_20250114123903_0016_Z.JPG
237	PSM.5000.0001.0295	15/01/2025	Electronic File	DJI_20250114134237_0010_W.JPG
238	PSM.5000.0001.0296	15/01/2025	Electronic File	DJI_20250114134247_0011_S.MP4
239	PSM.5000.0001.0299	15/01/2025	Electronic File	DJI_20250114123104_0001_W.JPG
240	PSM.5000.0001.0300	15/01/2025	Electronic File	DJI_20250114123104_0001_Z.JPG
241	PSM.5000.0001.0301	15/01/2025	Electronic File	DJI_20250114123127_0002_W.JPG
242	PSM.5000.0001.0302	15/01/2025	Electronic File	DJI_20250114123127_0002_Z.JPG
243	PSM.5000.0001.0303	15/01/2025	Electronic File	DJI_20250114123155_0003_W.JPG
244	PSM.5000.0001.0304	15/01/2025	Electronic File	DJI_20250114123155_0003_Z.JPG
245	PSM.5000.0001.0305	15/01/2025	Electronic File	DJI_20250114123218_0004_W.JPG
246	PSM.5000.0001.0306	15/01/2025	Electronic File	DJI_20250114123218_0004_Z.JPG
247	PSM.5000.0001.0307	15/01/2025	Electronic File	DJI_20250114123228_0005_Z.JPG
248	PSM.5000.0001.0308	15/01/2025	Electronic File	DJI_20250114123328_0007_W.JPG
249	PSM.5000.0001.0309	15/01/2025	Electronic File	DJI_20250114123328_0007_Z.JPG
250	PSM.5000.0001.0310	15/01/2025	Electronic File	DJI_20250114123431_0008_W.JPG
251	PSM.5000.0001.0311	15/01/2025	Electronic File	DJI_20250114123449_0009_W.JPG
252	PSM.5000.0001.0312	15/01/2025	Electronic File	DJI_20250114123527_0010_Z.JPG
253	PSM.5000.0001.0313	15/01/2025	Electronic File	DJI_20250114123538_0011_W.JPG
254	PSM.5000.0001.0314	15/01/2025	Electronic File	DJI_20250114123638_0013_W.JPG
255	PSM.5000.0001.0315	15/01/2025	Electronic File	DJI_20250114134247_0011_Z.MP4
256	PSM.5000.0001.0318	15/01/2025	Email	PSM5226 Preliminary advice following 14/01/2025 landslide
257	PSM.5000.0001.0319	15/01/2025	Electronic File	IMG_0874.HEIC
258	PSM.5000.0001.0320	15/01/2025	Electronic File	IMG_0875.HEIC
259	PSM.5000.0001.0321	15/01/2025	Electronic File	IMG_0876.HEIC
260	PSM.5000.0001.0322	15/01/2025	Electronic File	IMG_0877.HEIC
261	PSM.5000.0001.0323	15/01/2025	Electronic File	IMG_0878.HEIC
262	PSM.5000.0001.0324	15/01/2025	Electronic File	IMG_0879.HEIC
263	PSM.5000.0001.0325	15/01/2025	Electronic File	IMG_0880.MOV
264	PSM.5000.0001.0326	15/01/2025	Electronic File	IMG_0881.MOV
265	PSM.5000.0001.0327	15/01/2025	Electronic File	IMG_0882.HEIC
266	PSM.5000.0001.0328	15/01/2025	Electronic File	IMG_0883.HEIC
267	PSM.5000.0001.0329	15/01/2025	Electronic File	IMG_0884.HEIC
268	PSM.5000.0001.0330	15/01/2025	Electronic File	IMG_0885.HEIC
269	PSM.5000.0001.0331	15/01/2025	Electronic File	IMG_0886.HEIC
270	PSM.5000.0001.0332	15/01/2025	Electronic File	IMG_0887.MOV
271	PSM.5000.0001.0333	15/01/2025	Electronic File	IMG_0888.HEIC
272	PSM.5000.0001.0334	15/01/2025	Electronic File	IMG_0889.HEIC
273	PSM.5000.0001.0335	15/01/2025	Electronic File	IMG_0890.HEIC
274	PSM.5000.0001.0336	15/01/2025	Electronic File	IMG_0891.HEIC
275	PSM.5000.0001.0337	15/01/2025	Electronic File	IMG_0892.HEIC

Count	Document ID	Document Date	Document Type	Title
276	PSM.5000.0001.0338	15/01/2025	Electronic File	IMG_0893.HEIC
277	PSM.5000.0001.0339	15/01/2025	Electronic File	IMG_0894.HEIC
278	PSM.5000.0001.0340	15/01/2025	Electronic File	IMG_0895.HEIC
279	PSM.5000.0001.0341	15/01/2025	Electronic File	IMG_0896.HEIC
280	PSM.5000.0001.0342	15/01/2025	Electronic File	IMG_0897.HEIC
281	PSM.5000.0001.0343	15/01/2025	Electronic File	IMG_0898.HEIC
282	PSM.5000.0001.0344	15/01/2025	Electronic File	IMG_0899.HEIC
283	PSM.5000.0001.0345	15/01/2025	Electronic File	IMG_0900.HEIC
284	PSM.5000.0001.0346	15/01/2025	Electronic File	IMG_0901.HEIC
285	PSM.5000.0001.0347	15/01/2025	Electronic File	IMG_0902.HEIC
286	PSM.5000.0001.0348	15/01/2025	Electronic File	IMG_0903.HEIC
287	PSM.5000.0001.0349	15/01/2025	Electronic File	IMG_0904.HEIC
288	PSM.5000.0001.0350	15/01/2025	Electronic File	IMG_0905.HEIC
289	PSM.5000.0001.0351	15/01/2025	Electronic File	IMG_0906.HEIC
290	PSM.5000.0001.0352	15/01/2025	Electronic File	IMG_0907.HEIC
291	PSM.5000.0001.0353	15/01/2025	Electronic File	IMG_0908.HEIC
292	PSM.5000.0001.0354	15/01/2025	Electronic File	IMG_0909.HEIC
293	PSM.5000.0001.0355	15/01/2025	Electronic File	IMG_0910.HEIC
294	PSM.5000.0001.0356	15/01/2025	Electronic File	IMG_0911.MOV
295	PSM.5000.0001.0357	15/01/2025	Electronic File	IMG_0912.MOV
296	PSM.5000.0001.0358	15/01/2025	Electronic File	IMG_0913.HEIC
297	PSM.5000.0001.0359	15/01/2025	Electronic File	IMG_0915.HEIC
298	PSM.5000.0001.0360	15/01/2025	Electronic File	IMG_0916.HEIC
299	PSM.5000.0001.0361	15/01/2025	Electronic File	IMG_0917.HEIC
300	PSM.5000.0001.0362	15/01/2025	Electronic File	IMG_0918.HEIC
301	PSM.5000.0001.0363	15/01/2025	Electronic File	IMG_0919.HEIC
302	PSM.5000.0001.0364	15/01/2025	Electronic File	IMG_0920.HEIC
303	PSM.5000.0001.0365	15/01/2025	Electronic File	IMG_0921.HEIC
304	PSM.5000.0001.0366	15/01/2025	Electronic File	IMG_0922.HEIC
305	PSM.5000.0001.0367	15/01/2025	Electronic File	IMG_0923.HEIC
306	PSM.5000.0001.0368	15/01/2025	Electronic File	IMG_0924.HEIC
307	PSM.5000.0001.0369	15/01/2025	Email	RE: PSM5226 Preliminary advice following 14/01/2025 landslide
308	PSM.5000.0001.0371	15/01/2025	Electronic File	IMG_0925.PNG
309	PSM.5000.0001.0372	15/01/2025	Electronic File	IMG_0926.HEIC
310	PSM.5000.0001.0373	15/01/2025	Electronic File	IMG_0927.HEIC
311	PSM.5000.0001.0374	15/01/2025	Electronic File	IMG_0928.HEIC
312	PSM.5000.0001.0375	15/01/2025	Electronic File	IMG_0929.HEIC
313	PSM.5000.0001.0376	15/01/2025	Electronic File	IMG_0930.HEIC
314	PSM.5000.0001.0377	15/01/2025	Electronic File	IMG_0931.HEIC
315	PSM.5000.0001.0378	15/01/2025	Electronic File	IMG_0932.HEIC
316	PSM.5000.0001.0379	15/01/2025	Electronic File	IMG_0933.HEIC
317	PSM.5000.0001.0380	15/01/2025	Electronic File	IMG_0934.HEIC
318	PSM.5000.0001.0381	16/01/2025	Email	PSM5226 Lidar survey
319	PSM.5000.0001.0382	16/01/2025	Electronic File	BROS0576.JPG
320	PSM.5000.0001.0383	16/01/2025	Electronic File	STCK6275.JPG
321	PSM.5000.0001.0384	16/01/2025	Electronic File	PLAL1662.JPG
322	PSM.5000.0001.0385	16/01/2025	Electronic File	IMG_0938.MOV
323	PSM.5000.0001.0386	16/01/2025	Electronic File	IMG_0939.HEIC
324	PSM.5000.0001.0387	16/01/2025	Electronic File	IMG_0946.MOV
325	PSM.5000.0001.0388	16/01/2025	Electronic File	IMG_0947.HEIC
326	PSM.5000.0001.0389	16/01/2025	Electronic File	IMG_0948.HEIC
327	PSM.5000.0001.0390	16/01/2025	Electronic File	IMG_0949.HEIC
328	PSM.5000.0001.0391	16/01/2025	Electronic File	IMG_0950.HEIC
329	PSM.5000.0001.0392	16/01/2025	Electronic File	IMG_0951.HEIC
330	PSM.5000.0001.0393	16/01/2025	Electronic File	IMG_0952.HEIC

Count	Document ID	Document Date	Document Type	Title
331	PSM.5000.0001.0394	16/01/2025	Electronic File	IMG_0953.HEIC
332	PSM.5000.0001.0395	16/01/2025	Electronic File	IMG_0954.HEIC
333	PSM.5000.0001.0396	16/01/2025	Electronic File	IMG_0955.HEIC
334	PSM.5000.0001.0397	16/01/2025	Electronic File	IMG_0956.MOV
335	PSM.5000.0001.0398	16/01/2025	Electronic File	IMG_0957.HEIC
336	PSM.5000.0001.0399	16/01/2025	Electronic File	IMG_0958.HEIC
337	PSM.5000.0001.0400	16/01/2025	Electronic File	IMG_0959.HEIC
338	PSM.5000.0001.0401	16/01/2025	Electronic File	IMG_0960.MOV
339	PSM.5000.0001.0402	16/01/2025	Electronic File	IMG_0961.HEIC
340	PSM.5000.0001.0403	16/01/2025	Electronic File	IMG_0962.MOV
341	PSM.5000.0001.0404	16/01/2025	Electronic File	IMG_0963.HEIC
342	PSM.5000.0001.0405	16/01/2025	Electronic File	IMG_0964.MOV
343	PSM.5000.0001.0406	16/01/2025	Electronic File	IMG_0965.MOV
344	PSM.5000.0001.0407	16/01/2025	Electronic File	IMG_0966.MOV
345	PSM.5000.0001.0408	16/01/2025	Electronic File	IMG_0967.HEIC
346	PSM.5000.0001.0409	16/01/2025	Electronic File	IMG_0968.HEIC
347	PSM.5000.0001.0410	16/01/2025	Electronic File	IMG_0969.MOV
348	PSM.5000.0001.0411	16/01/2025	Electronic File	IMG_0970.HEIC
349	PSM.5000.0001.0412	16/01/2025	Electronic File	IMG_0971.HEIC
350	PSM.5000.0001.0413	16/01/2025	Electronic File	IMG_0972.HEIC
351	PSM.5000.0001.0414	16/01/2025	Electronic File	IMG_0973.HEIC
352	PSM.5000.0001.0415	16/01/2025	Electronic File	IMG_0974.HEIC
353	PSM.5000.0001.0416	16/01/2025	Electronic File	IMG_0975.HEIC
354	PSM.5000.0001.0417	16/01/2025	Electronic File	IMG_0976.HEIC
355	PSM.5000.0001.0418	16/01/2025	Electronic File	IMG_0977.HEIC
356	PSM.5000.0001.0419	16/01/2025	Electronic File	IMG_0978.HEIC
357	PSM.5000.0001.0420	16/01/2025	Electronic File	IMG_0979.MOV
358	PSM.5000.0001.0421	16/01/2025	Electronic File	IMG_0980.HEIC
359	PSM.5000.0001.0422	16/01/2025	Electronic File	IMG_0981.MOV
360	PSM.5000.0001.0423	16/01/2025	Electronic File	IMG_0982.MOV
361	PSM.5000.0001.0424	16/01/2025	Electronic File	IMG_0983.HEIC
362	PSM.5000.0001.0425	16/01/2025	Electronic File	IMG_0984.MOV
363	PSM.5000.0001.0426	16/01/2025	Electronic File	IMG_0985.MOV
364	PSM.5000.0001.0427	16/01/2025	Electronic File	IMG_0986.MOV
365	PSM.5000.0001.0428	16/01/2025	Electronic File	IMG_0987.MOV
366	PSM.5000.0001.0429	16/01/2025	Electronic File	IMG_0988.MOV
367	PSM.5000.0001.0430	16/01/2025	Electronic File	IMG_0989.HEIC
368	PSM.5000.0001.0431	16/01/2025	Electronic File	IMG_0990.HEIC
369	PSM.5000.0001.0432	16/01/2025	Electronic File	IMG_0991.HEIC
370	PSM.5000.0001.0433	16/01/2025	Electronic File	IMG_0992.HEIC
371	PSM.5000.0001.0434	16/01/2025	Electronic File	IMG_0993.MOV
372	PSM.5000.0001.0435	16/01/2025	Electronic File	IMG_0994.HEIC
373	PSM.5000.0001.0436	16/01/2025	Electronic File	IMG_0995.HEIC
374	PSM.5000.0001.0437	16/01/2025	Electronic File	IMG_0996.HEIC
375	PSM.5000.0001.0438	17/01/2025	Electronic File	IMG_7894.HEIC
376	PSM.5000.0001.0439	17/01/2025	Electronic File	IMG_7894.MOV
377	PSM.5000.0001.0440	17/01/2025	Electronic File	IMG_0156.JPG
378	PSM.5000.0001.0441	17/01/2025	Electronic File	IMG_0157.JPG
379	PSM.5000.0001.0442	17/01/2025	Electronic File	IMG_0158.JPG
380	PSM.5000.0001.0443	17/01/2025	Electronic File	IMG_0159.JPG
381	PSM.5000.0001.0444	17/01/2025	Electronic File	IMG_0160.JPG
382	PSM.5000.0001.0445	17/01/2025	Electronic File	IMG_0161.JPG
383	PSM.5000.0001.0446	17/01/2025	Electronic File	IMG_0162.JPG
384	PSM.5000.0001.0447	17/01/2025	Electronic File	IMG_0163.JPG
385	PSM.5000.0001.0448	17/01/2025	Electronic File	IMG_0164.JPG

Count	Document ID	Document Date	Document Type	Title
386	PSM.5000.0001.0449	17/01/2025	Electronic File	IMG_0165.JPG
387	PSM.5000.0001.0450	17/01/2025	Electronic File	IMG_0166.JPG
388	PSM.5000.0001.0451	17/01/2025	Electronic File	IMG_0168.JPG
389	PSM.5000.0001.0452	17/01/2025	Electronic File	IMG_0170.JPG
390	PSM.5000.0001.0453	17/01/2025	Electronic File	IMG_0171.JPG
391	PSM.5000.0001.0454	17/01/2025	Electronic File	IMG_0172.JPG
392	PSM.5000.0001.0455	17/01/2025	Electronic File	IMG_0173.JPG
393	PSM.5000.0001.0456	17/01/2025	Electronic File	IMG_0174.JPG
394	PSM.5000.0001.0457	17/01/2025	Electronic File	IMG_0175.JPG
395	PSM.5000.0001.0458	17/01/2025	Electronic File	IMG_0176.JPG
396	PSM.5000.0001.0459	17/01/2025	Electronic File	IMG_0177.JPG
397	PSM.5000.0001.0460	17/01/2025	Electronic File	IMG_0178.JPG
398	PSM.5000.0001.0461	17/01/2025	Electronic File	IMG_0179.JPG
399	PSM.5000.0001.0462	17/01/2025	Electronic File	IMG_0180.JPG
400	PSM.5000.0001.0463	17/01/2025	Electronic File	IMG_0181.JPG
401	PSM.5000.0001.0464	17/01/2025	Electronic File	IMG_0182.JPG
402	PSM.5000.0001.0465	17/01/2025	Electronic File	IMG_0183.JPG
403	PSM.5000.0001.0466	17/01/2025	Electronic File	IMG_0184.JPG
404	PSM.5000.0001.0467	17/01/2025	Electronic File	IMG_0185.JPG
405	PSM.5000.0001.0468	17/01/2025	Electronic File	IMG_0186.JPG
406	PSM.5000.0001.0469	17/01/2025	Electronic File	IMG_0187.JPG
407	PSM.5000.0001.0470	17/01/2025	Electronic File	IMG_0188.JPG
408	PSM.5000.0001.0471	17/01/2025	Electronic File	IMG_0189.JPG
409	PSM.5000.0001.0472	17/01/2025	Electronic File	IMG_0190.JPG
410	PSM.5000.0001.0473	17/01/2025	Electronic File	IMG_0191.JPG
411	PSM.5000.0001.0474	17/01/2025	Electronic File	IMG_0192.JPG
412	PSM.5000.0001.0475	17/01/2025	Electronic File	IMG_0193.JPG
413	PSM.5000.0001.0476	17/01/2025	Electronic File	IMG_0194.JPG
414	PSM.5000.0001.0477	17/01/2025	Electronic File	IMG_0195.JPG
415	PSM.5000.0001.0478	17/01/2025	Electronic File	IMG_0196.JPG
416	PSM.5000.0001.0479	17/01/2025	Electronic File	IMG_0197.JPG
417	PSM.5000.0001.0480	17/01/2025	Electronic File	IMG_0198.JPG
418	PSM.5000.0001.0481	17/01/2025	Electronic File	IMG_0199.JPG
419	PSM.5000.0001.0482	17/01/2025	Electronic File	IMG_0202.JPG
420	PSM.5000.0001.0483	17/01/2025	Electronic File	IMG_0203.JPG
421	PSM.5000.0001.0484	17/01/2025	Electronic File	IMG_0204.JPG
422	PSM.5000.0001.0485	17/01/2025	Electronic File	IMG_0205.JPG
423	PSM.5000.0001.0486	17/01/2025	Electronic File	IMG_0206.JPG
424	PSM.5000.0001.0487	17/01/2025	Electronic File	IMG_0207.JPG
425	PSM.5000.0001.0488	17/01/2025	Electronic File	IMG_0208.JPG
426	PSM.5000.0001.0489	17/01/2025	Electronic File	IMG_0209.JPG
427	PSM.5000.0001.0490	17/01/2025	Electronic File	IMG_0210.JPG
428	PSM.5000.0001.0491	17/01/2025	Electronic File	IMG_0211.JPG
429	PSM.5000.0001.0492	17/01/2025	Electronic File	IMG_0212.JPG
430	PSM.5000.0001.0493	17/01/2025	Electronic File	IMG_0213.JPG
431	PSM.5000.0001.0494	17/01/2025	Electronic File	IMG_0215.JPG
432	PSM.5000.0001.0495	17/01/2025	Electronic File	IMG_0145.JPG
433	PSM.5000.0001.0496	17/01/2025	Electronic File	IMG_0146.JPG
434	PSM.5000.0001.0497	17/01/2025	Electronic File	IMG_0147.JPG
435	PSM.5000.0001.0498	17/01/2025	Electronic File	IMG_0148.JPG
436	PSM.5000.0001.0499	17/01/2025	Electronic File	IMG_0149.JPG
437	PSM.5000.0001.0500	17/01/2025	Electronic File	IMG_0150.JPG
438	PSM.5000.0001.0501	17/01/2025	Electronic File	IMG_0151.JPG
439	PSM.5000.0001.0502	17/01/2025	Electronic File	IMG_0152.JPG
440	PSM.5000.0001.0503	17/01/2025	Electronic File	IMG_0153.JPG

Count	Document ID	Document Date	Document Type	Title
441	PSM.5000.0001.0504	17/01/2025	Electronic File	IMG_0154.JPG
442	PSM.5000.0001.0505	17/01/2025	Electronic File	IMG_0155.JPG
443	PSM.5000.0001.0506	17/01/2025	Electronic File	IMG_0167.JPG
444	PSM.5000.0001.0507	17/01/2025	Electronic File	IMG_0169.JPG
445	PSM.5000.0001.0508	17/01/2025	Electronic File	IMG_0200.JPG
446	PSM.5000.0001.0509	17/01/2025	Electronic File	IMG_0201.JPG
447	PSM.5000.0001.0510	17/01/2025	Electronic File	IMG_0214.JPG
448	PSM.5000.0001.0511	17/01/2025	Electronic File	IMG_0216.JPG
449	PSM.5000.0001.0512	17/01/2025	Electronic File	IMG_0217.JPG
450	PSM.5000.0001.0513	17/01/2025	Electronic File	IMG_0218.JPG
451	PSM.5000.0001.0514	17/01/2025	Electronic File	IMG_0219.JPG
452	PSM.5000.0001.0515	17/01/2025	Electronic File	IMG_0220.JPG
453	PSM.5000.0001.0516	17/01/2025	Electronic File	IMG_0221.JPG
454	PSM.5000.0001.0517	17/01/2025	Electronic File	IMG_1008.HEIC
455	PSM.5000.0001.0518	17/01/2025	Electronic File	McCrae 12 05 2023 V2.m4v
456	PSM.5000.0001.0526	17/01/2025	Electronic File	20210102_111747.jpg
457	PSM.5000.0001.0527	17/01/2025	Electronic File	DJI_0119-1.jpg
458	PSM.5000.0001.0528	17/01/2025	Electronic File	DJI_0120-4.jpg
459	PSM.5000.0001.0529	17/01/2025	Electronic File	DJI_0127-HDR-Edit-5.jpg
460	PSM.5000.0001.0530	17/01/2025	Electronic File	DJI_0139-6.jpg
461	PSM.5000.0001.0531	17/01/2025	Electronic File	DJI_0143-7.jpg
462	PSM.5000.0001.0532	17/01/2025	Electronic File	DJI_0144-Pano-Edit-8.jpg
463	PSM.5000.0001.0533	17/01/2025	Electronic File	DJI_0244.JPG
464	PSM.5000.0001.0534	17/01/2025	Electronic File	DJI_0248.JPG
465	PSM.5000.0001.0535	17/01/2025	Electronic File	PXL_20221018_230937764.jpg
466	PSM.5000.0001.0536	17/01/2025	Electronic File	PXL_20221207_041303368.jpg
467	PSM.5000.0001.0537	17/01/2025	Electronic File	PXL_20221207_041334187.jpg
468	PSM.5000.0001.0538	17/01/2025	Electronic File	PXL_20231225_065031816.jpg
469	PSM.5000.0001.0539	17/01/2025	Electronic File	PXL_20250107_021319065.jpg
470	PSM.5000.0001.0540	17/01/2025	Electronic File	PXL_20250107_021339253.jpg
471	PSM.5000.0001.0541	17/01/2025	Electronic File	PXL_20250107_021402654.jpg
472	PSM.5000.0001.0542	17/01/2025	Electronic File	PXL_20250107_033803621.jpg
473	PSM.5000.0001.0543	17/01/2025	Electronic File	PXL_20250107_041225624.jpg
474	PSM.5000.0001.0544	20/01/2025	Electronic File	IMG_1054.HEIC
475	PSM.5000.0001.0545	20/01/2025	Electronic File	IMG_1055.HEIC
476	PSM.5000.0001.0546	20/01/2025	Electronic File	IMG_1056.HEIC
477	PSM.5000.0001.0547	20/01/2025	Electronic File	IMG_1057.HEIC
478	PSM.5000.0001.0548	20/01/2025	Electronic File	IMG_1058.HEIC
479	PSM.5000.0001.0549	20/01/2025	Electronic File	IMG_1059.HEIC
480	PSM.5000.0001.0550	20/01/2025	Electronic File	IMG_1060.HEIC
481	PSM.5000.0001.0551	20/01/2025	Electronic File	IMG_1061.HEIC
482	PSM.5000.0001.0552	20/01/2025	Electronic File	IMG_1062.HEIC
483	PSM.5000.0001.0553	20/01/2025	Electronic File	IMG_1063.HEIC
484	PSM.5000.0001.0554	20/01/2025	Electronic File	TH000395.JPG
485	PSM.5000.0001.0555	20/01/2025	Electronic File	TH000396.JPG
486	PSM.5000.0001.0556	20/01/2025	Electronic File	TH000397.JPG
487	PSM.5000.0001.0557	20/01/2025	Electronic File	TH000398.JPG
488	PSM.5000.0001.0558	20/01/2025	Electronic File	IMG_1068.HEIC
489	PSM.5000.0001.0559	20/01/2025	Electronic File	TH000399.JPG
490	PSM.5000.0001.0560	20/01/2025	Electronic File	IMG_1070.HEIC
491	PSM.5000.0001.0561	20/01/2025	Electronic File	IMG_1071.MOV
492	PSM.5000.0001.0562	20/01/2025	Electronic File	IMG_1072.HEIC
493	PSM.5000.0001.0563	20/01/2025	Electronic File	IMG_1073.MOV
494	PSM.5000.0001.0564	20/01/2025	Electronic File	IMG_1074.MOV
495	PSM.5000.0001.0565	20/01/2025	Electronic File	IMG_1075.MOV

Count	Document ID	Document Date	Document Type	Title
496	PSM.5000.0001.0566	20/01/2025	Electronic File	IMG_1076.MOV
497	PSM.5000.0001.0567	20/01/2025	Electronic File	25010_McCrae_DTM.ecw
498	PSM.5000.0001.0568	20/01/2025	Electronic File	25010_McCrae_Ortho.ecw
499	PSM.5000.0001.0569	21/01/2025	Electronic File	Jan 2025 Landslip Extract for Bld Files..docx
500	PSM.5000.0001.0599	21/01/2025	Electronic File	Architecturals_stamped.pdf
501	PSM.5000.0001.0602	21/01/2025	Electronic File	Building Permit.pdf
502	PSM.5000.0001.0604	21/01/2025	Electronic File	Eng CofC.pdf
503	PSM.5000.0001.0605	21/01/2025	Electronic File	Eng Comps_stamped.pdf
504	PSM.5000.0001.0610	21/01/2025	Electronic File	Plan of Subdivision.pdf
505	PSM.5000.0001.0612	21/01/2025	Electronic File	Sec 30.pdf
506	PSM.5000.0001.0613	21/01/2025	Electronic File	Soil Report_stamped.pdf
507	PSM.5000.0001.0622	21/01/2025	Electronic File	Title.pdf
508	PSM.5000.0001.0623	21/01/2025	Electronic File	Certificate Final.pdf
509	PSM.5000.0001.0624	21/01/2025	Electronic File	Section_75_-_Advice_of_completion_with_letterhead.PDF
510	PSM.5000.0001.0625	21/01/2025	Electronic File	IMG_0224.JPG
511	PSM.5000.0001.0626	21/01/2025	Electronic File	IMG_0225.JPG
512	PSM.5000.0001.0627	21/01/2025	Electronic File	IMG_0226.JPG
513	PSM.5000.0001.0628	21/01/2025	Electronic File	IMG_0227.JPG
514	PSM.5000.0001.0629	21/01/2025	Electronic File	IMG_0228.JPG
515	PSM.5000.0001.0630	21/01/2025	Electronic File	IMG_0229.JPG
516	PSM.5000.0001.0631	21/01/2025	Electronic File	IMG_0230.MOV
517	PSM.5000.0001.0632	21/01/2025	Electronic File	IMG_0231.HEIC
518	PSM.5000.0001.0633	21/01/2025	Electronic File	IMG_0232.JPG
519	PSM.5000.0001.0634	21/01/2025	Electronic File	IMG_0233.JPG
520	PSM.5000.0001.0635	21/01/2025	Electronic File	IMG_0234.JPG
521	PSM.5000.0001.0636	21/01/2025	Electronic File	IMG_0235.JPG
522	PSM.5000.0001.0637	21/01/2025	Electronic File	IMG_0236.JPG
523	PSM.5000.0001.0638	21/01/2025	Electronic File	IMG_0237.JPG
524	PSM.5000.0001.0639	21/01/2025	Electronic File	IMG_0238.JPG
525	PSM.5000.0001.0640	21/01/2025	Electronic File	IMG_0239.JPG
526	PSM.5000.0001.0641	21/01/2025	Electronic File	IMG_0240.JPG
527	PSM.5000.0001.0642	21/01/2025	Electronic File	IMG_0241.JPG
528	PSM.5000.0001.0643	21/01/2025	Electronic File	IMG_0242.JPG
529	PSM.5000.0001.0644	21/01/2025	Electronic File	IMG_0243.JPG
530	PSM.5000.0001.0645	21/01/2025	Electronic File	IMG_0244.JPG
531	PSM.5000.0001.0646	21/01/2025	Electronic File	IMG_0245.JPG
532	PSM.5000.0001.0647	21/01/2025	Electronic File	IMG_0246.JPG
533	PSM.5000.0001.0648	21/01/2025	Electronic File	IMG_0247.JPG
534	PSM.5000.0001.0649	21/01/2025	Electronic File	IMG_0248.JPG
535	PSM.5000.0001.0650	21/01/2025	Electronic File	IMG_0249.JPG
536	PSM.5000.0001.0651	21/01/2025	Electronic File	IMG_0250.JPG
537	PSM.5000.0001.0652	21/01/2025	Electronic File	IMG_0251.JPG
538	PSM.5000.0001.0653	21/01/2025	Electronic File	IMG_0252.JPG
539	PSM.5000.0001.0654	21/01/2025	Electronic File	IMG_0253.JPG
540	PSM.5000.0001.0655	21/01/2025	Electronic File	IMG_0254.JPG
541	PSM.5000.0001.0656	21/01/2025	Electronic File	IMG_0255.JPG
542	PSM.5000.0001.0657	21/01/2025	Electronic File	IMG_0256.JPG
543	PSM.5000.0001.0658	21/01/2025	Electronic File	IMG_0257.JPG
544	PSM.5000.0001.0659	21/01/2025	Electronic File	IMG_0258.JPG
545	PSM.5000.0001.0660	21/01/2025	Electronic File	IMG_0259.JPG
546	PSM.5000.0001.0661	21/01/2025	Electronic File	IMG_0260.JPG
547	PSM.5000.0001.0662	21/01/2025	Electronic File	IMG_1089.HEIC
548	PSM.5000.0001.0663	21/01/2025	Electronic File	IMG_1090.HEIC
549	PSM.5000.0001.0664	21/01/2025	Electronic File	IMG_1091.HEIC
550	PSM.5000.0001.0665	21/01/2025	Electronic File	IMG_1092.HEIC

Count	Document ID	Document Date	Document Type	Title
551	PSM.5000.0001.0666	21/01/2025	Electronic File	IMG_1093.HEIC
552	PSM.5000.0001.0667	21/01/2025	Electronic File	IMG_1094.HEIC
553	PSM.5000.0001.0668	21/01/2025	Electronic File	IMG_1096.HEIC
554	PSM.5000.0001.0669	21/01/2025	Electronic File	TH000400.JPG
555	PSM.5000.0001.0670	21/01/2025	Electronic File	TH000401.JPG
556	PSM.5000.0001.0671	21/01/2025	Electronic File	IMG_1099.HEIC
557	PSM.5000.0001.0672	21/01/2025	Electronic File	IMG_1100.HEIC
558	PSM.5000.0001.0673	21/01/2025	Electronic File	IMG_1101.HEIC
559	PSM.5000.0001.0674	21/01/2025	Electronic File	IMG_1102.HEIC
560	PSM.5000.0001.0675	21/01/2025	Electronic File	IMG_1103.HEIC
561	PSM.5000.0001.0676	21/01/2025	Electronic File	IMG_1104.HEIC
562	PSM.5000.0001.0677	21/01/2025	Electronic File	IMG_1105.HEIC
563	PSM.5000.0001.0678	21/01/2025	Electronic File	IMG_1106.HEIC
564	PSM.5000.0001.0679	21/01/2025	Electronic File	IMG_1107.HEIC
565	PSM.5000.0001.0680	21/01/2025	Electronic File	IMG_1108.HEIC
566	PSM.5000.0001.0681	21/01/2025	Electronic File	IMG_1109.HEIC
567	PSM.5000.0001.0682	21/01/2025	Electronic File	IMG_1110.HEIC
568	PSM.5000.0001.0683	21/01/2025	Electronic File	IMG_1111.HEIC
569	PSM.5000.0001.0684	21/01/2025	Electronic File	IMG_1112.HEIC
570	PSM.5000.0001.0685	21/01/2025	Electronic File	IMG_1117.HEIC
571	PSM.5000.0001.0686	21/01/2025	Electronic File	IMG_1118.HEIC
572	PSM.5000.0001.0687	21/01/2025	Electronic File	IMG_1119.HEIC
573	PSM.5000.0001.0688	21/01/2025	Electronic File	IMG_1120.HEIC
574	PSM.5000.0001.0689	21/01/2025	Electronic File	IMG_1121.HEIC
575	PSM.5000.0001.0690	21/01/2025	Electronic File	IMG_1122.HEIC
576	PSM.5000.0001.0691	21/01/2025	Electronic File	IMG_1123.HEIC
577	PSM.5000.0001.0692	21/01/2025	Electronic File	IMG_1124.HEIC
578	PSM.5000.0001.0693	21/01/2025	Electronic File	IMG_1125.HEIC
579	PSM.5000.0001.0694	21/01/2025	Electronic File	IMG_1126.PNG
580	PSM.5000.0001.0695	21/01/2025	Electronic File	240116_25010_McCrae Landslip_Survey.dwg
581	PSM.5000.0001.0696	21/01/2025	Electronic File	240116_25010_McCrae Landslip_Survey.txt
582	PSM.5000.0001.0700	21/01/2025	Electronic File	DoT(Roads) General PDF DRAWING SUPPLY CONDITIONS.pdf
583	PSM.5000.0001.0702	21/01/2025	Electronic File	Piper Associates Report No. 21006.pdf
584	PSM.5000.0001.0710	24/01/2025	Electronic File	38491910.PDF
585	PSM.5000.0001.0712	24/01/2025	Electronic File	250051231.pdf
586	PSM.5000.0001.0759	24/01/2025	Electronic File	ASSET 250051228.pdf
587	PSM.5000.0001.0760	24/01/2025	Electronic File	Utility Installation Near Melbourne Water Assets 250051228.pdf
588	PSM.5000.0001.0761	24/01/2025	Electronic File	build_over_guide 250051228.pdf
589	PSM.5000.0001.0762	24/01/2025	Electronic File	Response body - 250051225.html
590	PSM.5000.0001.0763	24/01/2025	Electronic File	250051226 - Optus Response Letter.pdf
591	PSM.5000.0001.0775	24/01/2025	Electronic File	250051226 - Optus Plan.pdf
592	PSM.5000.0001.0788	24/01/2025	Electronic File	250051229.pdf
593	PSM.5000.0001.0808	24/01/2025	Email	Relay Mail 15ljpom3ev1d2a5k75qs9hpsoki8p5mbrasis401.eml
594	PSM.5000.0001.0810	8/01/2025	Attachment	Telstra Duty of Care v32.0c.pdf
595	PSM.5000.0001.0812	13/09/2024	Attachment	Telstra Map Legend 4.0b.pdf
596	PSM.5000.0001.0813	8/01/2025	Attachment	AccreditedPlantLocators 2025-01-08a.pdf
597	PSM.5000.0001.0814	24/01/2025	Attachment	250051235.dwf
598	PSM.5000.0001.0815	24/01/2025	Electronic File	250051235.dwf
599	PSM.5000.0001.0816	24/01/2025	Electronic File	AssetInfoOutput_48469849_828E16B1-8B68-4C47-AD3F-63389F611234_2.pdf
600	PSM.5000.0001.0821	24/01/2025	Electronic File	AssetInfoOutput_48469894_CB95DE4C-0BAF-4AEB-95C3-FF6C486C0F63_2.pdf
601	PSM.5000.0001.0826	24/01/2025	Electronic File	AssetInfoOutput_48469885_66FB727B-6657-4AC4-AEAD-831A5F132632_2.pdf
602	PSM.5000.0001.0831	24/01/2025	Electronic File	250051230_20250124_005247582984_2.pdf
603	PSM.5000.0001.0845	24/01/2025	Electronic File	250051230_20250124_005247582984_1.pdf
604	PSM.5000.0001.0875	24/01/2025	Electronic File	250051230_20250124_005247582984_pwc_1.pdf
605	PSM.5000.0001.0919	24/01/2025	Electronic File	IMG_1137.HEIC

Count	Document ID	Document Date	Document Type	Title
606	PSM.5000.0001.0920	24/01/2025	Electronic File	IMG_1138.HEIC
607	PSM.5000.0001.0921	24/01/2025	Electronic File	IMG_1139.HEIC
608	PSM.5000.0001.0922	24/01/2025	Electronic File	IMG_1140.HEIC
609	PSM.5000.0001.0923	24/01/2025	Electronic File	IMG_1141.HEIC
610	PSM.5000.0001.0924	24/01/2025	Electronic File	IMG_1142.HEIC
611	PSM.5000.0001.0925	24/01/2025	Electronic File	IMG_1143.HEIC
612	PSM.5000.0001.0926	24/01/2025	Electronic File	IMG_1144.HEIC
613	PSM.5000.0001.0927	24/01/2025	Electronic File	IMG_1145.HEIC
614	PSM.5000.0001.0928	24/01/2025	Electronic File	IMG_1146.HEIC
615	PSM.5000.0001.0929	24/01/2025	Electronic File	IMG_1147.HEIC
616	PSM.5000.0001.0930	24/01/2025	Electronic File	IMG_1148.HEIC
617	PSM.5000.0001.0931	24/01/2025	Electronic File	IMG_1149.HEIC
618	PSM.5000.0001.0932	24/01/2025	Electronic File	IMG_1150.HEIC
619	PSM.5000.0001.0933	24/01/2025	Electronic File	IMG_1151.HEIC
620	PSM.5000.0001.0934	24/01/2025	Electronic File	IMG_1152.HEIC
621	PSM.5000.0001.0935	24/01/2025	Electronic File	IMG_1153.HEIC
622	PSM.5000.0001.0936	24/01/2025	Electronic File	IMG_1154.HEIC
623	PSM.5000.0001.0937	24/01/2025	Electronic File	IMG_1155.PNG
624	PSM.5000.0001.0938	24/01/2025	Electronic File	IMG_1156.HEIC
625	PSM.5000.0001.0939	24/01/2025	Electronic File	IMG_1157.HEIC
626	PSM.5000.0001.0940	24/01/2025	Electronic File	250051227 - United Energy Overview Plan.pdf
627	PSM.5000.0001.0941	24/01/2025	Electronic File	250051227 - United Energy Response letter.pdf
628	PSM.5000.0001.0944	24/01/2025	Electronic File	United Energy - Area too Large.pdf
629	PSM.5000.0001.0945	24/01/2025	Electronic File	IMG_1158.HEIC
630	PSM.5000.0001.0946	24/01/2025	Electronic File	IMG_1159.HEIC
631	PSM.5000.0001.0947	24/01/2025	Electronic File	IMG_1160.MOV
632	PSM.5000.0001.0948	24/01/2025	Electronic File	IMG_1161.HEIC
633	PSM.5000.0001.0949	24/01/2025	Electronic File	IMG_1162.MOV
634	PSM.5000.0001.0950	24/01/2025	Electronic File	IMG_1163.HEIC
635	PSM.5000.0001.0951	24/01/2025	Electronic File	IMG_1164.HEIC
636	PSM.5000.0001.0952	24/01/2025	Electronic File	IMG_1165.HEIC
637	PSM.5000.0001.0953	24/01/2025	Electronic File	IMG_1166.HEIC
638	PSM.5000.0001.0954	24/01/2025	Electronic File	IMG_1167.HEIC
639	PSM.5000.0001.0955	24/01/2025	Electronic File	IMG_1168.HEIC
640	PSM.5000.0001.0956	24/01/2025	Electronic File	IMG_1169.HEIC
641	PSM.5000.0001.0957	24/01/2025	Electronic File	IMG_1170.HEIC
642	PSM.5000.0001.0958	24/01/2025	Electronic File	IMG_1171.HEIC
643	PSM.5000.0001.0959	24/01/2025	Electronic File	IMG_1172.HEIC
644	PSM.5000.0001.0960	24/01/2025	Electronic File	IMG_1173.HEIC
645	PSM.5000.0001.0961	24/01/2025	Electronic File	IMG_1174.MOV
646	PSM.5000.0001.0962	24/01/2025	Electronic File	IMG_1175.HEIC
647	PSM.5000.0001.0963	24/01/2025	Electronic File	IMG_1176.HEIC
648	PSM.5000.0001.0964	24/01/2025	Electronic File	IMG_1177.HEIC
649	PSM.5000.0001.0965	24/01/2025	Electronic File	IMG_1178.HEIC
650	PSM.5000.0001.0966	24/01/2025	Electronic File	IMG_1179.HEIC
651	PSM.5000.0001.0967	24/01/2025	Electronic File	IMG_1180.HEIC
652	PSM.5000.0001.0968	24/01/2025	Electronic File	IMG_1181.MOV
653	PSM.5000.0001.0969	24/01/2025	Electronic File	IMG_1182.HEIC
654	PSM.5000.0001.0970	24/01/2025	Electronic File	IMG_1183.HEIC
655	PSM.5000.0001.0971	24/01/2025	Electronic File	IMG_1184.HEIC
656	PSM.5000.0001.0972	24/01/2025	Electronic File	IMG_1185.HEIC
657	PSM.5000.0001.0973	24/01/2025	Electronic File	IMG_1186.HEIC
658	PSM.5000.0001.0974	24/01/2025	Electronic File	IMG_1187.HEIC
659	PSM.5000.0001.0975	24/01/2025	Electronic File	IMG_1188.MOV
660	PSM.5000.0001.0976	24/01/2025	Electronic File	IMG_1189.HEIC

Count	Document ID	Document Date	Document Type	Title
661	PSM.5000.0001.0977	24/01/2025	Electronic File	IMG_1190.HEIC
662	PSM.5000.0001.0978	24/01/2025	Electronic File	IMG_1191.HEIC
663	PSM.5000.0001.0979	24/01/2025	Electronic File	IMG_1192.MOV
664	PSM.5000.0001.0980	24/01/2025	Electronic File	IMG_1193.HEIC
665	PSM.5000.0001.0981	24/01/2025	Electronic File	IMG_1194.MOV
666	PSM.5000.0001.0982	24/01/2025	Electronic File	IMG_1195.HEIC
667	PSM.5000.0001.0983	24/01/2025	Electronic File	IMG_1196.HEIC
668	PSM.5000.0001.0984	24/01/2025	Electronic File	IMG_1197.MOV
669	PSM.5000.0001.0985	24/01/2025	Electronic File	IMG_1198.HEIC
670	PSM.5000.0001.0986	24/01/2025	Electronic File	IMG_1199.MOV
671	PSM.5000.0001.0987	24/01/2025	Electronic File	IMG_1200.HEIC
672	PSM.5000.0001.0988	25/01/2025	Electronic File	IMG_0222.JPG
673	PSM.5000.0001.0989	25/01/2025	Electronic File	IMG_0223.JPG
674	PSM.5000.0001.0990	25/01/2025	Electronic File	IMG_0261.JPG
675	PSM.5000.0001.0991	25/01/2025	Electronic File	IMG_0262.JPG
676	PSM.5000.0001.0992	25/01/2025	Electronic File	IMG_0263.JPG
677	PSM.5000.0001.0993	25/01/2025	Electronic File	IMG_0264.JPG
678	PSM.5000.0001.0994	25/01/2025	Electronic File	IMG_0265.JPG
679	PSM.5000.0001.0995	25/01/2025	Electronic File	IMG_0266.JPG
680	PSM.5000.0001.0996	25/01/2025	Electronic File	IMG_0267.JPG
681	PSM.5000.0001.0997	25/01/2025	Electronic File	IMG_0268.HEIC
682	PSM.5000.0001.0998	25/01/2025	Electronic File	240116_25010_McCrae Landslip_RADAR TIN-v1.dxf
683	PSM.5000.0001.0999	30/01/2025	Electronic File	IMG_1033.HEIC
684	PSM.5000.0001.1000	30/01/2025	Electronic File	IMG_1034.HEIC
685	PSM.5000.0001.1001	30/01/2025	Electronic File	IMG_1035.HEIC
686	PSM.5000.0001.1002	30/01/2025	Electronic File	IMG_1036.HEIC
687	PSM.5000.0001.1003	30/01/2025	Electronic File	IMG_1037.HEIC
688	PSM.5000.0001.1004	30/01/2025	Electronic File	IMG_1038.HEIC
689	PSM.5000.0001.1005	30/01/2025	Electronic File	IMG_1264.HEIC
690	PSM.5000.0001.1006	30/01/2025	Electronic File	IMG_1265.HEIC
691	PSM.5000.0001.1007	30/01/2025	Electronic File	IMG_1266.MOV
692	PSM.5000.0001.1008	30/01/2025	Electronic File	IMG_1267.HEIC
693	PSM.5000.0001.1009	30/01/2025	Electronic File	IMG_1268.HEIC
694	PSM.5000.0001.1010	30/01/2025	Electronic File	IMG_1269.HEIC
695	PSM.5000.0001.1011	30/01/2025	Electronic File	IMG_1270.HEIC
696	PSM.5000.0001.1012	30/01/2025	Electronic File	IMG_1271.HEIC
697	PSM.5000.0001.1013	30/01/2025	Electronic File	IMG_1272.HEIC
698	PSM.5000.0001.1014	30/01/2025	Electronic File	IMG_1273.HEIC
699	PSM.5000.0001.1015	30/01/2025	Electronic File	IMG_1274.HEIC
700	PSM.5000.0001.1016	30/01/2025	Electronic File	IMG_1039.HEIC
701	PSM.5000.0001.1017	30/01/2025	Electronic File	IMG_1275.HEIC
702	PSM.5000.0001.1018	30/01/2025	Electronic File	IMG_1040.HEIC
703	PSM.5000.0001.1019	30/01/2025	Electronic File	IMG_1276.HEIC
704	PSM.5000.0001.1020	30/01/2025	Electronic File	IMG_1277.HEIC
705	PSM.5000.0001.1021	30/01/2025	Electronic File	IMG_1278.HEIC
706	PSM.5000.0001.1022	30/01/2025	Electronic File	IMG_1279.HEIC
707	PSM.5000.0001.1023	30/01/2025	Electronic File	IMG_1280.HEIC
708	PSM.5000.0001.1024	30/01/2025	Electronic File	IMG_1281.HEIC
709	PSM.5000.0001.1025	30/01/2025	Electronic File	IMG_1282.HEIC
710	PSM.5000.0001.1026	30/01/2025	Electronic File	IMG_1041.HEIC
711	PSM.5000.0001.1027	30/01/2025	Electronic File	TH000402.JPG
712	PSM.5000.0001.1028	30/01/2025	Electronic File	IMG_1284.HEIC
713	PSM.5000.0001.1029	30/01/2025	Electronic File	IMG_1285.HEIC
714	PSM.5000.0001.1030	30/01/2025	Electronic File	IMG_1286.HEIC
715	PSM.5000.0001.1031	30/01/2025	Electronic File	IMG_1287.HEIC

Count	Document ID	Document Date	Document Type	Title
716	PSM.5000.0001.1032	30/01/2025	Electronic File	IMG_1288.HEIC
717	PSM.5000.0001.1033	30/01/2025	Electronic File	IMG_1042.HEIC
718	PSM.5000.0001.1034	30/01/2025	Electronic File	IMG_1289.HEIC
719	PSM.5000.0001.1035	30/01/2025	Electronic File	IMG_1290.HEIC
720	PSM.5000.0001.1036	30/01/2025	Electronic File	IMG_1291.HEIC
721	PSM.5000.0001.1037	30/01/2025	Electronic File	IMG_1292.HEIC
722	PSM.5000.0001.1038	30/01/2025	Electronic File	IMG_1293.HEIC
723	PSM.5000.0001.1039	30/01/2025	Electronic File	IMG_1043.HEIC
724	PSM.5000.0001.1040	30/01/2025	Electronic File	IMG_1044.HEIC
725	PSM.5000.0001.1041	30/01/2025	Electronic File	IMG_1045.HEIC
726	PSM.5000.0001.1042	30/01/2025	Electronic File	IMG_1046.HEIC
727	PSM.5000.0001.1043	30/01/2025	Electronic File	IMG_1047.HEIC
728	PSM.5000.0001.1044	30/01/2025	Electronic File	IMG_1048.HEIC
729	PSM.5000.0001.1045	30/01/2025	Electronic File	IMG_1294.HEIC
730	PSM.5000.0001.1046	30/01/2025	Electronic File	IMG_1049.HEIC
731	PSM.5000.0001.1047	30/01/2025	Electronic File	IMG_1050.HEIC
732	PSM.5000.0001.1048	30/01/2025	Electronic File	IMG_1051.HEIC
733	PSM.5000.0001.1049	30/01/2025	Electronic File	IMG_1052.HEIC
734	PSM.5000.0001.1050	30/01/2025	Electronic File	IMG_1053.HEIC
735	PSM.5000.0001.1051	30/01/2025	Electronic File	IMG_1054.HEIC
736	PSM.5000.0001.1052	30/01/2025	Electronic File	IMG_1055.HEIC
737	PSM.5000.0001.1053	30/01/2025	Electronic File	IMG_1056.HEIC
738	PSM.5000.0001.1054	30/01/2025	Electronic File	IMG_1057.HEIC
739	PSM.5000.0001.1055	30/01/2025	Electronic File	IMG_1058.HEIC
740	PSM.5000.0001.1056	30/01/2025	Electronic File	IMG_1059.HEIC
741	PSM.5000.0001.1057	30/01/2025	Electronic File	IMG_1060.HEIC
742	PSM.5000.0001.1058	30/01/2025	Electronic File	IMG_1061.HEIC
743	PSM.5000.0001.1059	30/01/2025	Electronic File	IMG_1062.HEIC
744	PSM.5000.0001.1060	30/01/2025	Electronic File	IMG_1063.HEIC
745	PSM.5000.0001.1061	30/01/2025	Electronic File	IMG_1064.HEIC
746	PSM.5000.0001.1062	30/01/2025	Electronic File	IMG_1065.HEIC
747	PSM.5000.0001.1063	30/01/2025	Electronic File	IMG_1066.HEIC
748	PSM.5000.0001.1064	30/01/2025	Electronic File	IMG_1067.HEIC
749	PSM.5000.0001.1065	30/01/2025	Electronic File	IMG_1068.HEIC
750	PSM.5000.0001.1066	30/01/2025	Electronic File	IMG_1069.HEIC
751	PSM.5000.0001.1067	30/01/2025	Electronic File	IMG_1070.HEIC
752	PSM.5000.0001.1068	30/01/2025	Electronic File	IMG_1071.HEIC
753	PSM.5000.0001.1069	30/01/2025	Electronic File	IMG_1295.HEIC
754	PSM.5000.0001.1070	30/01/2025	Electronic File	IMG_1072.HEIC
755	PSM.5000.0001.1071	30/01/2025	Electronic File	IMG_1073.HEIC
756	PSM.5000.0001.1072	30/01/2025	Electronic File	IMG_1074.HEIC
757	PSM.5000.0001.1073	30/01/2025	Electronic File	IMG_1075.HEIC
758	PSM.5000.0001.1074	30/01/2025	Electronic File	TH000403.JPG
759	PSM.5000.0001.1075	30/01/2025	Electronic File	IMG_1076.HEIC
760	PSM.5000.0001.1076	30/01/2025	Electronic File	IMG_1077.HEIC
761	PSM.5000.0001.1077	30/01/2025	Electronic File	IMG_1078.HEIC
762	PSM.5000.0001.1078	30/01/2025	Electronic File	IMG_1079.HEIC
763	PSM.5000.0001.1079	30/01/2025	Electronic File	IMG_1297.HEIC
764	PSM.5000.0001.1080	30/01/2025	Electronic File	IMG_1298.HEIC
765	PSM.5000.0001.1081	30/01/2025	Electronic File	IMG_1299.HEIC
766	PSM.5000.0001.1082	30/01/2025	Electronic File	IMG_1300.HEIC
767	PSM.5000.0001.1083	30/01/2025	Electronic File	IMG_1301.HEIC
768	PSM.5000.0001.1084	30/01/2025	Electronic File	IMG_1080.HEIC
769	PSM.5000.0001.1085	30/01/2025	Electronic File	IMG_1081.HEIC
770	PSM.5000.0001.1086	30/01/2025	Electronic File	IMG_1302.HEIC

Count	Document ID	Document Date	Document Type	Title
771	PSM.5000.0001.1087	30/01/2025	Electronic File	IMG_1303.HEIC
772	PSM.5000.0001.1088	30/01/2025	Electronic File	IMG_1304.HEIC
773	PSM.5000.0001.1089	30/01/2025	Electronic File	IMG_1305.HEIC
774	PSM.5000.0001.1090	30/01/2025	Electronic File	IMG_1082.HEIC
775	PSM.5000.0001.1091	30/01/2025	Electronic File	IMG_1083.HEIC
776	PSM.5000.0001.1092	30/01/2025	Electronic File	IMG_1084.HEIC
777	PSM.5000.0001.1093	30/01/2025	Electronic File	IMG_1085.HEIC
778	PSM.5000.0001.1094	30/01/2025	Electronic File	IMG_1086.HEIC
779	PSM.5000.0001.1095	30/01/2025	Electronic File	IMG_1306.HEIC
780	PSM.5000.0001.1096	30/01/2025	Electronic File	IMG_1307.HEIC
781	PSM.5000.0001.1097	30/01/2025	Electronic File	IMG_1308.HEIC
782	PSM.5000.0001.1098	30/01/2025	Electronic File	IMG_1087.HEIC
783	PSM.5000.0001.1099	30/01/2025	Electronic File	IMG_1088.HEIC
784	PSM.5000.0001.1100	30/01/2025	Electronic File	IMG_1309.HEIC
785	PSM.5000.0001.1101	30/01/2025	Electronic File	IMG_1089.HEIC
786	PSM.5000.0001.1102	30/01/2025	Electronic File	IMG_1310.HEIC
787	PSM.5000.0001.1103	30/01/2025	Electronic File	IMG_1311.HEIC
788	PSM.5000.0001.1104	30/01/2025	Electronic File	IMG_1090.HEIC
789	PSM.5000.0001.1105	30/01/2025	Electronic File	IMG_1091.HEIC
790	PSM.5000.0001.1106	30/01/2025	Electronic File	IMG_1092.HEIC
791	PSM.5000.0001.1107	30/01/2025	Electronic File	IMG_1093.HEIC
792	PSM.5000.0001.1108	30/01/2025	Electronic File	IMG_1094.HEIC
793	PSM.5000.0001.1109	30/01/2025	Electronic File	IMG_1095.HEIC
794	PSM.5000.0001.1110	30/01/2025	Electronic File	IMG_1097.HEIC
795	PSM.5000.0001.1111	30/01/2025	Electronic File	IMG_1098.HEIC
796	PSM.5000.0001.1112	30/01/2025	Electronic File	IMG_1099.HEIC
797	PSM.5000.0001.1113	30/01/2025	Electronic File	IMG_1312.HEIC
798	PSM.5000.0001.1114	30/01/2025	Electronic File	IMG_1100.HEIC
799	PSM.5000.0001.1115	30/01/2025	Electronic File	IMG_1313.HEIC
800	PSM.5000.0001.1116	30/01/2025	Electronic File	IMG_1101.HEIC
801	PSM.5000.0001.1117	30/01/2025	Electronic File	IMG_1314.HEIC
802	PSM.5000.0001.1118	30/01/2025	Electronic File	IMG_1315.HEIC
803	PSM.5000.0001.1119	30/01/2025	Electronic File	IMG_1102.HEIC
804	PSM.5000.0001.1120	30/01/2025	Electronic File	IMG_1103.HEIC
805	PSM.5000.0001.1121	30/01/2025	Electronic File	IMG_1104.HEIC
806	PSM.5000.0001.1122	30/01/2025	Electronic File	IMG_1105.HEIC
807	PSM.5000.0001.1123	30/01/2025	Electronic File	IMG_1106.HEIC
808	PSM.5000.0001.1124	30/01/2025	Electronic File	IMG_1107.HEIC
809	PSM.5000.0001.1125	30/01/2025	Electronic File	IMG_1108.HEIC
810	PSM.5000.0001.1126	30/01/2025	Electronic File	IMG_1316.HEIC
811	PSM.5000.0001.1127	30/01/2025	Electronic File	IMG_1109.HEIC
812	PSM.5000.0001.1128	30/01/2025	Electronic File	IMG_1317.HEIC
813	PSM.5000.0001.1129	30/01/2025	Electronic File	IMG_1318.HEIC
814	PSM.5000.0001.1130	30/01/2025	Electronic File	IMG_1110.HEIC
815	PSM.5000.0001.1131	30/01/2025	Electronic File	IMG_1111.HEIC
816	PSM.5000.0001.1132	30/01/2025	Electronic File	IMG_1112.HEIC
817	PSM.5000.0001.1133	30/01/2025	Electronic File	IMG_1113.HEIC
818	PSM.5000.0001.1134	30/01/2025	Electronic File	IMG_1114.HEIC
819	PSM.5000.0001.1135	30/01/2025	Electronic File	IMG_1115.HEIC
820	PSM.5000.0001.1136	30/01/2025	Electronic File	IMG_1319.HEIC
821	PSM.5000.0001.1137	30/01/2025	Electronic File	IMG_1116.HEIC
822	PSM.5000.0001.1138	30/01/2025	Electronic File	IMG_1117.HEIC
823	PSM.5000.0001.1139	30/01/2025	Electronic File	IMG_1320.HEIC
824	PSM.5000.0001.1140	30/01/2025	Electronic File	IMG_1118.HEIC
825	PSM.5000.0001.1141	30/01/2025	Electronic File	IMG_1119.HEIC

Count	Document ID	Document Date	Document Type	Title
826	PSM.5000.0001.1142	30/01/2025	Electronic File	IMG_1120.HEIC
827	PSM.5000.0001.1143	30/01/2025	Electronic File	IMG_1121.HEIC
828	PSM.5000.0001.1144	30/01/2025	Electronic File	IMG_1321.HEIC
829	PSM.5000.0001.1145	30/01/2025	Electronic File	IMG_1322.HEIC
830	PSM.5000.0001.1146	30/01/2025	Electronic File	IMG_1323.HEIC
831	PSM.5000.0001.1147	30/01/2025	Electronic File	IMG_1324.HEIC
832	PSM.5000.0001.1148	30/01/2025	Electronic File	IMG_1325.MOV
833	PSM.5000.0001.1149	30/01/2025	Electronic File	IMG_1326.HEIC
834	PSM.5000.0001.1150	30/01/2025	Electronic File	IMG_1327.HEIC
835	PSM.5000.0001.1151	30/01/2025	Electronic File	IMG_1328.HEIC
836	PSM.5000.0001.1152	30/01/2025	Electronic File	IMG_1329.HEIC
837	PSM.5000.0001.1153	30/01/2025	Electronic File	IMG_1330.HEIC
838	PSM.5000.0001.1154	30/01/2025	Electronic File	IMG_1331.HEIC
839	PSM.5000.0001.1155	30/01/2025	Electronic File	IMG_1332.HEIC
840	PSM.5000.0001.1156	30/01/2025	Electronic File	IMG_1333.HEIC
841	PSM.5000.0001.1157	30/01/2025	Electronic File	IMG_1334.HEIC
842	PSM.5000.0001.1158	30/01/2025	Electronic File	IMG_1335.HEIC
843	PSM.5000.0001.1159	30/01/2025	Electronic File	IMG_1336.HEIC
844	PSM.5000.0001.1160	30/01/2025	Electronic File	IMG_1337.HEIC
845	PSM.5000.0001.1161	30/01/2025	Electronic File	IMG_1338.MOV
846	PSM.5000.0001.1162	30/01/2025	Electronic File	IMG_1122.PNG
847	PSM.5000.0001.1163	30/01/2025	Electronic File	IMG_1339.HEIC
848	PSM.5000.0001.1164	30/01/2025	Electronic File	IMG_1340.HEIC
849	PSM.5000.0001.1165	30/01/2025	Electronic File	IMG_1123.HEIC
850	PSM.5000.0001.1166	30/01/2025	Electronic File	IMG_1124.HEIC
851	PSM.5000.0001.1167	30/01/2025	Electronic File	IMG_1125.HEIC
852	PSM.5000.0001.1168	30/01/2025	Electronic File	IMG_1126.HEIC
853	PSM.5000.0001.1169	30/01/2025	Electronic File	IMG_1127.HEIC
854	PSM.5000.0001.1170	30/01/2025	Electronic File	IMG_1128.HEIC
855	PSM.5000.0001.1171	30/01/2025	Electronic File	IMG_1129.HEIC
856	PSM.5000.0001.1172	30/01/2025	Electronic File	IMG_1130.HEIC
857	PSM.5000.0001.1173	30/01/2025	Electronic File	IMG_1131.HEIC
858	PSM.5000.0001.1174	30/01/2025	Electronic File	IMG_1132.HEIC
859	PSM.5000.0001.1175	30/01/2025	Electronic File	IMG_1133.HEIC
860	PSM.5000.0001.1176	30/01/2025	Electronic File	IMG_1341.HEIC
861	PSM.5000.0001.1177	30/01/2025	Electronic File	IMG_1342.HEIC
862	PSM.5000.0001.1178	30/01/2025	Electronic File	IMG_1343.HEIC
863	PSM.5000.0001.1179	30/01/2025	Electronic File	IMG_1344.HEIC
864	PSM.5000.0001.1180	30/01/2025	Electronic File	IMG_1345.HEIC
865	PSM.5000.0001.1181	30/01/2025	Electronic File	IMG_1134.HEIC
866	PSM.5000.0001.1182	30/01/2025	Electronic File	IMG_1346.HEIC
867	PSM.5000.0001.1183	30/01/2025	Electronic File	IMG_1347.HEIC
868	PSM.5000.0001.1184	30/01/2025	Electronic File	IMG_1135.HEIC
869	PSM.5000.0001.1185	30/01/2025	Electronic File	IMG_1136.HEIC
870	PSM.5000.0001.1186	30/01/2025	Electronic File	IMG_1348.HEIC
871	PSM.5000.0001.1187	30/01/2025	Electronic File	IMG_1349.HEIC
872	PSM.5000.0001.1188	30/01/2025	Electronic File	IMG_1350.HEIC
873	PSM.5000.0001.1189	30/01/2025	Electronic File	IMG_1137.HEIC
874	PSM.5000.0001.1190	30/01/2025	Electronic File	IMG_1138.HEIC
875	PSM.5000.0001.1191	30/01/2025	Electronic File	IMG_1139.HEIC
876	PSM.5000.0001.1192	30/01/2025	Electronic File	IMG_1140.HEIC
877	PSM.5000.0001.1193	30/01/2025	Electronic File	IMG_1141.HEIC
878	PSM.5000.0001.1194	30/01/2025	Electronic File	IMG_1142.HEIC
879	PSM.5000.0001.1195	30/01/2025	Electronic File	IMG_1143.HEIC
880	PSM.5000.0001.1196	30/01/2025	Electronic File	IMG_1351.HEIC

Count	Document ID	Document Date	Document Type	Title
881	PSM.5000.0001.1197	30/01/2025	Electronic File	IMG_1144.HEIC
882	PSM.5000.0001.1198	30/01/2025	Electronic File	IMG_1352.HEIC
883	PSM.5000.0001.1199	30/01/2025	Electronic File	IMG_1353.HEIC
884	PSM.5000.0001.1200	30/01/2025	Electronic File	IMG_1354.MOV
885	PSM.5000.0001.1201	30/01/2025	Electronic File	IMG_1145.HEIC
886	PSM.5000.0001.1202	30/01/2025	Electronic File	IMG_1355.HEIC
887	PSM.5000.0001.1203	30/01/2025	Electronic File	IMG_1146.HEIC
888	PSM.5000.0001.1204	30/01/2025	Electronic File	IMG_1147.HEIC
889	PSM.5000.0001.1205	30/01/2025	Electronic File	IMG_1148.HEIC
890	PSM.5000.0001.1206	30/01/2025	Electronic File	IMG_1149.HEIC
891	PSM.5000.0001.1207	30/01/2025	Electronic File	IMG_1150.HEIC
892	PSM.5000.0001.1208	30/01/2025	Electronic File	IMG_1151.HEIC
893	PSM.5000.0001.1209	30/01/2025	Electronic File	IMG_1152.HEIC
894	PSM.5000.0001.1210	30/01/2025	Electronic File	IMG_1153.HEIC
895	PSM.5000.0001.1211	30/01/2025	Electronic File	IMG_1154.HEIC
896	PSM.5000.0001.1212	30/01/2025	Electronic File	IMG_1155.HEIC
897	PSM.5000.0001.1213	30/01/2025	Electronic File	IMG_1156.HEIC
898	PSM.5000.0001.1214	30/01/2025	Electronic File	IMG_1157.HEIC
899	PSM.5000.0001.1215	30/01/2025	Electronic File	IMG_1158.HEIC
900	PSM.5000.0001.1216	30/01/2025	Electronic File	IMG_1159.HEIC
901	PSM.5000.0001.1217	30/01/2025	Electronic File	IMG_1160.HEIC
902	PSM.5000.0001.1218	30/01/2025	Electronic File	IMG_1161.HEIC
903	PSM.5000.0001.1219	30/01/2025	Electronic File	IMG_1162.MOV
904	PSM.5000.0001.1220	30/01/2025	Electronic File	IMG_1163.MOV
905	PSM.5000.0001.1221	30/01/2025	Electronic File	IMG_1356.HEIC
906	PSM.5000.0001.1222	30/01/2025	Electronic File	IMG_1357.HEIC
907	PSM.5000.0001.1223	30/01/2025	Electronic File	IMG_1358.HEIC
908	PSM.5000.0001.1224	30/01/2025	Electronic File	IMG_1359.HEIC
909	PSM.5000.0001.1225	30/01/2025	Electronic File	IMG_1360.HEIC
910	PSM.5000.0001.1226	30/01/2025	Electronic File	IMG_1361.HEIC
911	PSM.5000.0001.1227	30/01/2025	Electronic File	IMG_1362.HEIC
912	PSM.5000.0001.1228	30/01/2025	Electronic File	IMG_1363.HEIC
913	PSM.5000.0001.1229	30/01/2025	Electronic File	IMG_1364.HEIC
914	PSM.5000.0001.1230	30/01/2025	Electronic File	IMG_1365.HEIC
915	PSM.5000.0001.1231	30/01/2025	Electronic File	IMG_1366.HEIC
916	PSM.5000.0001.1232	30/01/2025	Electronic File	IMG_1367.HEIC
917	PSM.5000.0001.1233	30/01/2025	Electronic File	IMG_1368.HEIC
918	PSM.5000.0001.1234	30/01/2025	Electronic File	IMG_1369.HEIC
919	PSM.5000.0001.1235	30/01/2025	Electronic File	IMG_1370.PNG
920	PSM.5000.0001.1236	30/01/2025	Electronic File	IMG_1371.PNG
921	PSM.5000.0001.1237	30/01/2025	Electronic File	IMG_1164.HEIC
922	PSM.5000.0001.1238	30/01/2025	Electronic File	IMG_1372.HEIC
923	PSM.5000.0001.1239	30/01/2025	Electronic File	IMG_1373.HEIC
924	PSM.5000.0001.1240	30/01/2025	Electronic File	IMG_1165.HEIC
925	PSM.5000.0001.1241	30/01/2025	Electronic File	IMG_1166.HEIC
926	PSM.5000.0001.1242	30/01/2025	Electronic File	IMG_1374.HEIC
927	PSM.5000.0001.1243	30/01/2025	Electronic File	IMG_1375.MOV
928	PSM.5000.0001.1244	30/01/2025	Electronic File	IMG_1376.HEIC
929	PSM.5000.0001.1245	30/01/2025	Electronic File	IMG_1377.HEIC
930	PSM.5000.0001.1246	30/01/2025	Electronic File	IMG_1378.HEIC
931	PSM.5000.0001.1247	30/01/2025	Electronic File	IMG_1379.HEIC
932	PSM.5000.0001.1248	30/01/2025	Electronic File	IMG_1380.HEIC
933	PSM.5000.0001.1249	30/01/2025	Electronic File	IMG_1381.MOV
934	PSM.5000.0001.1250	30/01/2025	Electronic File	IMG_1382.HEIC
935	PSM.5000.0001.1251	30/01/2025	Electronic File	IMG_1383.HEIC

Count	Document ID	Document Date	Document Type	Title
936	PSM.5000.0001.1252	30/01/2025	Electronic File	Lotsearch LS072062_EA - 3 Penny Lane, McCrae, VIC 3938.pdf
937	PSM.5000.0001.1277	31/01/2025	Electronic File	BH 01.pdf
938	PSM.5000.0001.1278	31/01/2025	Electronic File	BH 02.pdf
939	PSM.5000.0001.1279	31/01/2025	Electronic File	BH 03.pdf
940	PSM.5000.0001.1280	31/01/2025	Electronic File	BH 04.pdf
941	PSM.5000.0001.1281	31/01/2025	Electronic File	BH 05.pdf
942	PSM.5000.0001.1284	31/01/2025	Electronic File	BH 06&07.pdf
943	PSM.5000.0001.1285	31/01/2025	Electronic File	BH 08&09&10.pdf
944	PSM.5000.0001.1287	31/01/2025	Electronic File	BH 11.png
945	PSM.5000.0001.1288	31/01/2025	Electronic File	BH 12.png
946	PSM.5000.0001.1289	31/01/2025	Electronic File	BH 13.png
947	PSM.5000.0001.1290	31/01/2025	Electronic File	BH 14.pdf
948	PSM.5000.0001.1293	31/01/2025	Electronic File	BH 15.pdf
949	PSM.5000.0001.1294	31/01/2025	Electronic File	BH 16.pdf
950	PSM.5000.0001.1295	31/01/2025	Electronic File	BH 17.pdf
951	PSM.5000.0001.1296	31/01/2025	Electronic File	BH 18.pdf
952	PSM.5000.0001.1297	31/01/2025	Electronic File	BH 19.pdf
953	PSM.5000.0001.1298	31/01/2025	Electronic File	BH 20.pdf
954	PSM.5000.0001.1299	31/01/2025	Electronic File	BH 21.pdf
955	PSM.5000.0001.1300	31/01/2025	Electronic File	BH 22.pdf
956	PSM.5000.0001.1301	31/01/2025	Electronic File	BH 23.pdf
957	PSM.5000.0001.1302	31/01/2025	Electronic File	BH 24.pdf
958	PSM.5000.0001.1303	31/01/2025	Electronic File	BH 25.pdf
959	PSM.5000.0001.1304	31/01/2025	Electronic File	BH 26.pdf
960	PSM.5000.0001.1305	31/01/2025	Electronic File	BH 27.pdf
961	PSM.5000.0001.1306	31/01/2025	Electronic File	BH 28.pdf
962	PSM.5000.0001.1307	31/01/2025	Electronic File	BH 29.pdf
963	PSM.5000.0001.1308	31/01/2025	Electronic File	BH 30.pdf
964	PSM.5000.0001.1309	31/01/2025	Electronic File	BH 31.pdf
965	PSM.5000.0001.1310	1/02/2025	Electronic File	Boreholes.csv
966	PSM.5000.0001.1311	4/02/2025	Electronic File	IMG_1190.HEIC
967	PSM.5000.0001.1312	4/02/2025	Electronic File	IMG_1191.HEIC
968	PSM.5000.0001.1313	4/02/2025	Electronic File	IMG_1192.HEIC
969	PSM.5000.0001.1314	4/02/2025	Electronic File	IMG_1193.HEIC
970	PSM.5000.0001.1315	4/02/2025	Electronic File	IMG_1194.HEIC
971	PSM.5000.0001.1316	4/02/2025	Electronic File	IMG_1195.HEIC
972	PSM.5000.0001.1317	4/02/2025	Electronic File	IMG_1196.HEIC
973	PSM.5000.0001.1318	4/02/2025	Electronic File	IMG_1197.HEIC
974	PSM.5000.0001.1319	4/02/2025	Electronic File	IMG_1198.HEIC
975	PSM.5000.0001.1320	4/02/2025	Electronic File	IMG_1199.HEIC
976	PSM.5000.0001.1321	4/02/2025	Electronic File	IMG_1200.HEIC
977	PSM.5000.0001.1322	4/02/2025	Electronic File	IMG_1201.HEIC
978	PSM.5000.0001.1323	4/02/2025	Electronic File	IMG_1202.HEIC
979	PSM.5000.0001.1324	4/02/2025	Electronic File	IMG_1203.HEIC
980	PSM.5000.0001.1325	4/02/2025	Electronic File	IMG_1204.HEIC
981	PSM.5000.0001.1326	4/02/2025	Electronic File	IMG_1205.HEIC
982	PSM.5000.0001.1327	4/02/2025	Electronic File	IMG_1206.HEIC
983	PSM.5000.0001.1328	4/02/2025	Electronic File	IMG_1207.HEIC
984	PSM.5000.0001.1329	4/02/2025	Electronic File	IMG_1208.HEIC
985	PSM.5000.0001.1330	4/02/2025	Electronic File	IMG_1209.HEIC
986	PSM.5000.0001.1331	4/02/2025	Electronic File	IMG_1210.HEIC
987	PSM.5000.0001.1332	4/02/2025	Electronic File	IMG_1211.HEIC
988	PSM.5000.0001.1333	4/02/2025	Electronic File	IMG_1212.HEIC
989	PSM.5000.0001.1334	4/02/2025	Electronic File	IMG_1213.HEIC
990	PSM.5000.0001.1335	4/02/2025	Electronic File	IMG_1214.HEIC

Count	Document ID	Document Date	Document Type	Title
991	PSM.5000.0001.1336	4/02/2025	Electronic File	IMG_1215.HEIC
992	PSM.5000.0001.1337	4/02/2025	Electronic File	IMG_1216.HEIC
993	PSM.5000.0001.1338	4/02/2025	Electronic File	IMG_1217.HEIC
994	PSM.5000.0001.1339	4/02/2025	Electronic File	IMG_1218.HEIC
995	PSM.5000.0001.1340	4/02/2025	Electronic File	IMG_1219.HEIC
996	PSM.5000.0001.1341	4/02/2025	Electronic File	IMG_1220.HEIC
997	PSM.5000.0001.1342	4/02/2025	Electronic File	IMG_1221.HEIC
998	PSM.5000.0001.1343	4/02/2025	Electronic File	IMG_1222.HEIC
999	PSM.5000.0001.1344	4/02/2025	Electronic File	IMG_1223.HEIC
1000	PSM.5000.0001.1345	4/02/2025	Electronic File	IMG_1224.HEIC
1001	PSM.5000.0001.1346	4/02/2025	Electronic File	IMG_1225.HEIC
1002	PSM.5000.0001.1347	4/02/2025	Electronic File	IMG_1226.HEIC
1003	PSM.5000.0001.1348	4/02/2025	Electronic File	IMG_1227.HEIC
1004	PSM.5000.0001.1349	4/02/2025	Electronic File	IMG_1228.HEIC
1005	PSM.5000.0001.1350	4/02/2025	Electronic File	IMG_1229.HEIC
1006	PSM.5000.0001.1351	4/02/2025	Electronic File	IMG_1230.HEIC
1007	PSM.5000.0001.1352	4/02/2025	Electronic File	IMG_1231.HEIC
1008	PSM.5000.0001.1353	4/02/2025	Electronic File	IMG_1232.HEIC
1009	PSM.5000.0001.1354	4/02/2025	Electronic File	IMG_1233.HEIC
1010	PSM.5000.0001.1355	4/02/2025	Electronic File	IMG_1234.HEIC
1011	PSM.5000.0001.1356	4/02/2025	Electronic File	IMG_1235.HEIC
1012	PSM.5000.0001.1357	4/02/2025	Electronic File	IMG_1236.HEIC
1013	PSM.5000.0001.1358	4/02/2025	Electronic File	IMG_1237.HEIC
1014	PSM.5000.0001.1359	4/02/2025	Electronic File	IMG_1238.HEIC
1015	PSM.5000.0001.1360	4/02/2025	Electronic File	IMG_1239.HEIC
1016	PSM.5000.0001.1361	4/02/2025	Electronic File	IMG_1240.HEIC
1017	PSM.5000.0001.1362	4/02/2025	Electronic File	IMG_1241.HEIC
1018	PSM.5000.0001.1363	4/02/2025	Electronic File	IMG_1242.HEIC
1019	PSM.5000.0001.1364	4/02/2025	Electronic File	IMG_1243.HEIC
1020	PSM.5000.0001.1365	4/02/2025	Electronic File	IMG_1244.HEIC
1021	PSM.5000.0001.1366	4/02/2025	Electronic File	IMG_1245.HEIC
1022	PSM.5000.0001.1367	4/02/2025	Electronic File	IMG_1246.HEIC
1023	PSM.5000.0001.1368	4/02/2025	Electronic File	IMG_1247.HEIC
1024	PSM.5000.0001.1369	4/02/2025	Electronic File	IMG_1248.HEIC
1025	PSM.5000.0001.1370	4/02/2025	Electronic File	IMG_1249.HEIC
1026	PSM.5000.0001.1371	4/02/2025	Electronic File	IMG_1250.HEIC
1027	PSM.5000.0001.1372	4/02/2025	Electronic File	IMG_1251.HEIC
1028	PSM.5000.0001.1373	4/02/2025	Electronic File	IMG_1252.HEIC
1029	PSM.5000.0001.1374	4/02/2025	Electronic File	IMG_1253.HEIC
1030	PSM.5000.0001.1375	4/02/2025	Electronic File	IMG_1254.HEIC
1031	PSM.5000.0001.1376	4/02/2025	Electronic File	IMG_1255.HEIC
1032	PSM.5000.0001.1377	4/02/2025	Electronic File	IMG_1256.HEIC
1033	PSM.5000.0001.1378	4/02/2025	Electronic File	IMG_1257.HEIC
1034	PSM.5000.0001.1379	4/02/2025	Electronic File	IMG_1259.HEIC
1035	PSM.5000.0001.1380	4/02/2025	Electronic File	IMG_1260.HEIC
1036	PSM.5000.0001.1381	4/02/2025	Electronic File	IMG_1261.HEIC
1037	PSM.5000.0001.1382	4/02/2025	Electronic File	IMG_1262.HEIC
1038	PSM.5000.0001.1383	4/02/2025	Electronic File	IMG_1263.HEIC
1039	PSM.5000.0001.1384	4/02/2025	Electronic File	IMG_1264.HEIC
1040	PSM.5000.0001.1385	4/02/2025	Electronic File	IMG_1265.HEIC
1041	PSM.5000.0001.1386	4/02/2025	Electronic File	IMG_1266.HEIC
1042	PSM.5000.0001.1387	4/02/2025	Electronic File	IMG_1267.HEIC
1043	PSM.5000.0001.1388	4/02/2025	Electronic File	IMG_1268.HEIC
1044	PSM.5000.0001.1389	4/02/2025	Electronic File	IMG_1269.HEIC
1045	PSM.5000.0001.1390	4/02/2025	Electronic File	IMG_1270.HEIC

Count	Document ID	Document Date	Document Type	Title
1046	PSM.5000.0001.1391	4/02/2025	Electronic File	IMG_1271.HEIC
1047	PSM.5000.0001.1392	4/02/2025	Electronic File	IMG_1272.HEIC
1048	PSM.5000.0001.1393	4/02/2025	Electronic File	IMG_1273.HEIC
1049	PSM.5000.0001.1394	4/02/2025	Electronic File	IMG_1274.HEIC
1050	PSM.5000.0001.1395	4/02/2025	Electronic File	IMG_1275.HEIC
1051	PSM.5000.0001.1396	4/02/2025	Electronic File	IMG_1276.HEIC
1052	PSM.5000.0001.1397	4/02/2025	Electronic File	IMG_1277.HEIC
1053	PSM.5000.0001.1398	4/02/2025	Electronic File	IMG_1278.HEIC
1054	PSM.5000.0001.1399	4/02/2025	Electronic File	IMG_1279.HEIC
1055	PSM.5000.0001.1400	4/02/2025	Electronic File	IMG_1280.HEIC
1056	PSM.5000.0001.1401	4/02/2025	Electronic File	IMG_1281.HEIC
1057	PSM.5000.0001.1402	4/02/2025	Electronic File	IMG_1282.HEIC
1058	PSM.5000.0001.1403	4/02/2025	Electronic File	IMG_1283.HEIC
1059	PSM.5000.0001.1404	4/02/2025	Electronic File	IMG_1284.HEIC
1060	PSM.5000.0001.1405	4/02/2025	Electronic File	IMG_1285.HEIC
1061	PSM.5000.0001.1406	4/02/2025	Electronic File	IMG_1286.HEIC
1062	PSM.5000.0001.1407	4/02/2025	Electronic File	IMG_1287.HEIC
1063	PSM.5000.0001.1408	4/02/2025	Electronic File	IMG_1288.HEIC
1064	PSM.5000.0001.1409	4/02/2025	Electronic File	IMG_1289.HEIC
1065	PSM.5000.0001.1410	4/02/2025	Electronic File	IMG_1290.HEIC
1066	PSM.5000.0001.1411	4/02/2025	Electronic File	IMG_1291.HEIC
1067	PSM.5000.0001.1412	4/02/2025	Electronic File	IMG_1292.HEIC
1068	PSM.5000.0001.1413	4/02/2025	Electronic File	IMG_1293.HEIC
1069	PSM.5000.0001.1414	4/02/2025	Electronic File	IMG_1294.HEIC
1070	PSM.5000.0001.1415	4/02/2025	Electronic File	IMG_1295.HEIC
1071	PSM.5000.0001.1416	4/02/2025	Electronic File	IMG_1296.HEIC
1072	PSM.5000.0001.1417	4/02/2025	Electronic File	IMG_1297.HEIC
1073	PSM.5000.0001.1418	4/02/2025	Electronic File	IMG_1298.HEIC
1074	PSM.5000.0001.1419	4/02/2025	Electronic File	IMG_1299.HEIC
1075	PSM.5000.0001.1420	4/02/2025	Electronic File	IMG_1300.HEIC
1076	PSM.5000.0001.1421	4/02/2025	Electronic File	IMG_1301.HEIC
1077	PSM.5000.0001.1422	4/02/2025	Electronic File	IMG_1302.HEIC
1078	PSM.5000.0001.1423	4/02/2025	Electronic File	IMG_1303.HEIC
1079	PSM.5000.0001.1424	4/02/2025	Electronic File	IMG_1304.HEIC
1080	PSM.5000.0001.1425	4/02/2025	Electronic File	IMG_1305.HEIC
1081	PSM.5000.0001.1426	4/02/2025	Electronic File	IMG_1306.HEIC
1082	PSM.5000.0001.1427	4/02/2025	Electronic File	IMG_1307.HEIC
1083	PSM.5000.0001.1428	4/02/2025	Electronic File	IMG_1308.HEIC
1084	PSM.5000.0001.1429	4/02/2025	Electronic File	IMG_1309.HEIC
1085	PSM.5000.0001.1430	4/02/2025	Electronic File	IMG_1310.HEIC
1086	PSM.5000.0001.1431	4/02/2025	Electronic File	IMG_1311.HEIC
1087	PSM.5000.0001.1432	4/02/2025	Electronic File	IMG_1312.HEIC
1088	PSM.5000.0001.1433	4/02/2025	Electronic File	IMG_1313.HEIC
1089	PSM.5000.0001.1434	4/02/2025	Electronic File	IMG_1314.HEIC
1090	PSM.5000.0001.1435	4/02/2025	Electronic File	108 Base Map - Cropped with Drains.pdf
1091	PSM.5000.0001.1436	4/02/2025	Electronic File	108 Base Map - Cropped.pdf
1092	PSM.5000.0001.1437	4/02/2025	Electronic File	108 Base Map - With Drains.pdf
1093	PSM.5000.0001.1438	4/02/2025	Electronic File	108 Base Map.pdf
1094	PSM.5000.0001.1439	4/02/2025	Electronic File	108 Base Map.tif
1095	PSM.5000.0001.1440	4/02/2025	Electronic File	IMG_1315.HEIC
1096	PSM.5000.0001.1441	4/02/2025	Electronic File	IMG_1316.HEIC
1097	PSM.5000.0001.1442	4/02/2025	Electronic File	IMG_1317.HEIC
1098	PSM.5000.0001.1443	4/02/2025	Electronic File	IMG_1318.HEIC
1099	PSM.5000.0001.1444	4/02/2025	Electronic File	IMG_1320.HEIC
1100	PSM.5000.0001.1445	4/02/2025	Electronic File	IMG_1321.HEIC

Count	Document ID	Document Date	Document Type	Title
1101	PSM.5000.0001.1446	4/02/2025	Electronic File	IMG_1322.HEIC
1102	PSM.5000.0001.1447	4/02/2025	Electronic File	IMG_1323.HEIC
1103	PSM.5000.0001.1448	4/02/2025	Electronic File	IMG_1324.HEIC
1104	PSM.5000.0001.1449	4/02/2025	Electronic File	IMG_1325.HEIC
1105	PSM.5000.0001.1450	4/02/2025	Electronic File	IMG_1326.HEIC
1106	PSM.5000.0001.1451	4/02/2025	Electronic File	IMG_1327.HEIC
1107	PSM.5000.0001.1452	4/02/2025	Electronic File	IMG_1329.HEIC
1108	PSM.5000.0001.1453	4/02/2025	Electronic File	IMG_1330.HEIC
1109	PSM.5000.0001.1454	4/02/2025	Electronic File	IMG_1331.HEIC
1110	PSM.5000.0001.1455	4/02/2025	Electronic File	IMG_1332.HEIC
1111	PSM.5000.0001.1456	4/02/2025	Electronic File	IMG_1333.HEIC
1112	PSM.5000.0001.1457	4/02/2025	Electronic File	IMG_1334.HEIC
1113	PSM.5000.0001.1458	4/02/2025	Electronic File	IMG_1335.HEIC
1114	PSM.5000.0001.1459	4/02/2025	Electronic File	IMG_1258.HEIC
1115	PSM.5000.0001.1460	4/02/2025	Electronic File	IMG_1328.HEIC
1116	PSM.5000.0001.1461	4/02/2025	Electronic File	IMG_1319.HEIC
1117	PSM.5000.0001.1462	5/02/2025	Electronic File	IMG_2276.HEIC
1118	PSM.5000.0001.1463	5/02/2025	Electronic File	IMG_2269.HEIC
1119	PSM.5000.0001.1464	5/02/2025	Electronic File	IMG_2274.HEIC
1120	PSM.5000.0001.1465	5/02/2025	Electronic File	IMG_2279.HEIC
1121	PSM.5000.0001.1466	5/02/2025	Electronic File	IMG_2271.HEIC
1122	PSM.5000.0001.1467	5/02/2025	Electronic File	IMG_2273.HEIC
1123	PSM.5000.0001.1468	5/02/2025	Electronic File	IMG_2272.HEIC
1124	PSM.5000.0001.1469	5/02/2025	Electronic File	IMG_2277.HEIC
1125	PSM.5000.0001.1470	5/02/2025	Electronic File	IMG_2275.HEIC
1126	PSM.5000.0001.1471	5/02/2025	Electronic File	IMG_2278.HEIC
1127	PSM.5000.0001.1472	5/02/2025	Electronic File	IMG_2270.HEIC
1128	PSM.5000.0001.1473	5/02/2025	Electronic File	IMG_2238.HEIC
1129	PSM.5000.0001.1474	5/02/2025	Electronic File	IMG_2234.HEIC
1130	PSM.5000.0001.1475	5/02/2025	Electronic File	IMG_2241.JPG
1131	PSM.5000.0001.1476	5/02/2025	Electronic File	IMG_2225.HEIC
1132	PSM.5000.0001.1477	5/02/2025	Electronic File	IMG_2236.HEIC
1133	PSM.5000.0001.1478	5/02/2025	Electronic File	IMG_2237.HEIC
1134	PSM.5000.0001.1479	5/02/2025	Electronic File	IMG_2240.JPG
1135	PSM.5000.0001.1480	5/02/2025	Electronic File	IMG_2227.HEIC
1136	PSM.5000.0001.1481	5/02/2025	Electronic File	IMG_2235.HEIC
1137	PSM.5000.0001.1482	5/02/2025	Electronic File	IMG_2230.HEIC
1138	PSM.5000.0001.1483	5/02/2025	Electronic File	IMG_2239.HEIC
1139	PSM.5000.0001.1484	5/02/2025	Electronic File	IMG_2233.HEIC
1140	PSM.5000.0001.1485	5/02/2025	Electronic File	IMG_2226.HEIC
1141	PSM.5000.0001.1486	5/02/2025	Electronic File	IMG_2228.HEIC
1142	PSM.5000.0001.1487	5/02/2025	Electronic File	IMG_2232.HEIC
1143	PSM.5000.0001.1488	5/02/2025	Electronic File	IMG_2224.HEIC
1144	PSM.5000.0001.1489	5/02/2025	Electronic File	IMG_2229.HEIC
1145	PSM.5000.0001.1490	5/02/2025	Electronic File	IMG_2231.HEIC
1146	PSM.5000.0001.1491	5/02/2025	Electronic File	IMG_2261.HEIC
1147	PSM.5000.0001.1492	5/02/2025	Electronic File	IMG_2262.HEIC
1148	PSM.5000.0001.1493	5/02/2025	Electronic File	IMG_2265.HEIC
1149	PSM.5000.0001.1494	5/02/2025	Electronic File	IMG_2260.HEIC
1150	PSM.5000.0001.1495	5/02/2025	Electronic File	IMG_2263.HEIC
1151	PSM.5000.0001.1496	5/02/2025	Electronic File	IMG_2267.HEIC
1152	PSM.5000.0001.1497	5/02/2025	Electronic File	IMG_2264.HEIC
1153	PSM.5000.0001.1498	5/02/2025	Electronic File	IMG_2255.HEIC
1154	PSM.5000.0001.1499	5/02/2025	Electronic File	IMG_2251.HEIC
1155	PSM.5000.0001.1500	5/02/2025	Electronic File	IMG_2245.HEIC

Count	Document ID	Document Date	Document Type	Title
1156	PSM.5000.0001.1501	5/02/2025	Electronic File	IMG_2252.HEIC
1157	PSM.5000.0001.1502	5/02/2025	Electronic File	IMG_2254.HEIC
1158	PSM.5000.0001.1503	5/02/2025	Electronic File	IMG_2250.HEIC
1159	PSM.5000.0001.1504	5/02/2025	Electronic File	IMG_2253.HEIC
1160	PSM.5000.0001.1505	5/02/2025	Electronic File	IMG_2243.HEIC
1161	PSM.5000.0001.1506	5/02/2025	Electronic File	IMG_2244.HEIC
1162	PSM.5000.0001.1507	5/02/2025	Electronic File	IMG_2249.HEIC
1163	PSM.5000.0001.1508	5/02/2025	Electronic File	IMG_2246.HEIC
1164	PSM.5000.0001.1509	5/02/2025	Electronic File	IMG_2248.HEIC
1165	PSM.5000.0001.1510	5/02/2025	Electronic File	IMG_2247.HEIC
1166	PSM.5000.0001.1511	5/02/2025	Electronic File	IMG_2313.HEIC
1167	PSM.5000.0001.1512	5/02/2025	Electronic File	IMG_2315.HEIC
1168	PSM.5000.0001.1513	5/02/2025	Electronic File	IMG_2314.HEIC
1169	PSM.5000.0001.1514	5/02/2025	Electronic File	IMG_2312.HEIC
1170	PSM.5000.0001.1515	5/02/2025	Electronic File	IMG_2301.HEIC
1171	PSM.5000.0001.1516	5/02/2025	Electronic File	IMG_2303.HEIC
1172	PSM.5000.0001.1517	5/02/2025	Electronic File	IMG_2302.HEIC
1173	PSM.5000.0001.1518	5/02/2025	Electronic File	IMG_2307.HEIC
1174	PSM.5000.0001.1519	5/02/2025	Electronic File	IMG_2305.HEIC
1175	PSM.5000.0001.1520	5/02/2025	Electronic File	IMG_2306.HEIC
1176	PSM.5000.0001.1521	5/02/2025	Electronic File	IMG_2298.HEIC
1177	PSM.5000.0001.1522	5/02/2025	Electronic File	IMG_2304.HEIC
1178	PSM.5000.0001.1523	5/02/2025	Electronic File	IMG_2299.HEIC
1179	PSM.5000.0001.1524	5/02/2025	Electronic File	IMG_2300.HEIC
1180	PSM.5000.0001.1525	5/02/2025	Electronic File	IMG_2360.HEIC
1181	PSM.5000.0001.1526	5/02/2025	Electronic File	IMG_2355.HEIC
1182	PSM.5000.0001.1527	5/02/2025	Electronic File	IMG_2359.HEIC
1183	PSM.5000.0001.1528	5/02/2025	Electronic File	IMG_2358.HEIC
1184	PSM.5000.0001.1529	5/02/2025	Electronic File	IMG_2357.HEIC
1185	PSM.5000.0001.1530	5/02/2025	Electronic File	IMG_2351.HEIC
1186	PSM.5000.0001.1531	5/02/2025	Electronic File	IMG_2356.HEIC
1187	PSM.5000.0001.1532	5/02/2025	Electronic File	IMG_2349.HEIC
1188	PSM.5000.0001.1533	5/02/2025	Electronic File	IMG_2340.HEIC
1189	PSM.5000.0001.1534	5/02/2025	Electronic File	IMG_2354.HEIC
1190	PSM.5000.0001.1535	5/02/2025	Electronic File	IMG_2353.HEIC
1191	PSM.5000.0001.1536	5/02/2025	Electronic File	IMG_2337.HEIC
1192	PSM.5000.0001.1537	5/02/2025	Electronic File	IMG_2352.HEIC
1193	PSM.5000.0001.1538	5/02/2025	Electronic File	IMG_2350.HEIC
1194	PSM.5000.0001.1539	5/02/2025	Electronic File	IMG_2347.HEIC
1195	PSM.5000.0001.1540	5/02/2025	Electronic File	IMG_2339.HEIC
1196	PSM.5000.0001.1541	5/02/2025	Electronic File	IMG_2344.HEIC
1197	PSM.5000.0001.1542	5/02/2025	Electronic File	IMG_2348.HEIC
1198	PSM.5000.0001.1543	5/02/2025	Electronic File	IMG_2335.HEIC
1199	PSM.5000.0001.1544	5/02/2025	Electronic File	IMG_2257.HEIC
1200	PSM.5000.0001.1545	5/02/2025	Electronic File	IMG_2338.HEIC
1201	PSM.5000.0001.1546	5/02/2025	Electronic File	IMG_2310.HEIC
1202	PSM.5000.0001.1547	5/02/2025	Electronic File	IMG_2309.HEIC
1203	PSM.5000.0001.1548	5/02/2025	Electronic File	IMG_2317.HEIC
1204	PSM.5000.0001.1549	5/02/2025	Electronic File	IMG_2345.HEIC
1205	PSM.5000.0001.1550	5/02/2025	Electronic File	IMG_2336.HEIC
1206	PSM.5000.0001.1551	5/02/2025	Electronic File	IMG_2256.HEIC
1207	PSM.5000.0001.1552	5/02/2025	Electronic File	IMG_2258.HEIC
1208	PSM.5000.0001.1553	5/02/2025	Electronic File	IMG_2346.HEIC
1209	PSM.5000.0001.1554	5/02/2025	Electronic File	IMG_2316.HEIC
1210	PSM.5000.0001.1555	5/02/2025	Electronic File	IMG_2308.HEIC

Count	Document ID	Document Date	Document Type	Title
1211	PSM.5000.0001.1556	5/02/2025	Electronic File	IMG_2370.HEIC
1212	PSM.5000.0001.1557	5/02/2025	Electronic File	IMG_2366.HEIC
1213	PSM.5000.0001.1558	5/02/2025	Electronic File	IMG_2372.HEIC
1214	PSM.5000.0001.1559	5/02/2025	Electronic File	IMG_2367.HEIC
1215	PSM.5000.0001.1560	5/02/2025	Electronic File	IMG_2371.HEIC
1216	PSM.5000.0001.1561	5/02/2025	Electronic File	IMG_2368.HEIC
1217	PSM.5000.0001.1562	5/02/2025	Electronic File	IMG_2369.HEIC
1218	PSM.5000.0001.1563	5/02/2025	Electronic File	IMG_2364.HEIC
1219	PSM.5000.0001.1564	5/02/2025	Electronic File	IMG_2365.HEIC
1220	PSM.5000.0001.1565	5/02/2025	Electronic File	IMG_2334.HEIC
1221	PSM.5000.0001.1566	5/02/2025	Electronic File	IMG_2328.HEIC
1222	PSM.5000.0001.1567	5/02/2025	Electronic File	IMG_2333.HEIC
1223	PSM.5000.0001.1568	5/02/2025	Electronic File	IMG_2332.HEIC
1224	PSM.5000.0001.1569	5/02/2025	Electronic File	IMG_2331.HEIC
1225	PSM.5000.0001.1570	5/02/2025	Electronic File	IMG_2326.HEIC
1226	PSM.5000.0001.1571	5/02/2025	Electronic File	IMG_2329.HEIC
1227	PSM.5000.0001.1572	5/02/2025	Electronic File	IMG_2324.HEIC
1228	PSM.5000.0001.1573	5/02/2025	Electronic File	IMG_2330.HEIC
1229	PSM.5000.0001.1574	5/02/2025	Electronic File	IMG_2327.HEIC
1230	PSM.5000.0001.1575	5/02/2025	Electronic File	IMG_2295.HEIC
1231	PSM.5000.0001.1576	5/02/2025	Electronic File	IMG_2294.HEIC
1232	PSM.5000.0001.1577	5/02/2025	Electronic File	IMG_2291.HEIC
1233	PSM.5000.0001.1578	5/02/2025	Electronic File	IMG_2320.HEIC
1234	PSM.5000.0001.1579	5/02/2025	Electronic File	IMG_2319.HEIC
1235	PSM.5000.0001.1580	5/02/2025	Electronic File	IMG_2318.HEIC
1236	PSM.5000.0001.1581	5/02/2025	Electronic File	IMG_2285.HEIC
1237	PSM.5000.0001.1582	5/02/2025	Electronic File	IMG_2286.HEIC
1238	PSM.5000.0001.1583	5/02/2025	Electronic File	IMG_2293.HEIC
1239	PSM.5000.0001.1584	5/02/2025	Electronic File	IMG_2284.HEIC
1240	PSM.5000.0001.1585	5/02/2025	Electronic File	IMG_2282.HEIC
1241	PSM.5000.0001.1586	5/02/2025	Electronic File	IMG_2281.HEIC
1242	PSM.5000.0001.1587	5/02/2025	Electronic File	IMG_2283.HEIC
1243	PSM.5000.0001.1588	5/02/2025	Electronic File	IMG_2287.HEIC
1244	PSM.5000.0001.1589	5/02/2025	Electronic File	IMG_2292.HEIC
1245	PSM.5000.0001.1590	5/02/2025	Electronic File	IMG_2323.HEIC
1246	PSM.5000.0001.1591	5/02/2025	Electronic File	IMG_2322.HEIC
1247	PSM.5000.0001.1592	5/02/2025	Electronic File	IMG_2325.HEIC
1248	PSM.5000.0001.1593	5/02/2025	Electronic File	IMG_2288.HEIC
1249	PSM.5000.0001.1594	5/02/2025	Electronic File	IMG_2289.HEIC
1250	PSM.5000.0001.1595	5/02/2025	Electronic File	IMG_2321.HEIC
1251	PSM.5000.0001.1596	5/02/2025	Electronic File	IMG_2290.HEIC
1252	PSM.5000.0001.1597	6/02/2025	Electronic File	PSP - 2 View Point Road.pdf
1253	PSM.5000.0001.1600	6/02/2025	Electronic File	PSP - 4 View Point Road.pdf
1254	PSM.5000.0001.1603	6/02/2025	Electronic File	PSP - 18 View Point Road.pdf
1255	PSM.5000.0001.1605	6/02/2025	Electronic File	Asset Info - 22 View Point Road.pdf
1256	PSM.5000.0001.1608	6/02/2025	Electronic File	PSP - 14 Prospect Hill Road.pdf
1257	PSM.5000.0001.1610	6/02/2025	Electronic File	PSP - 16 Prospect Hill Road.pdf
1258	PSM.5000.0001.1612	6/02/2025	Electronic File	PSP - 20 The Eyrie.pdf
1259	PSM.5000.0001.1614	6/02/2025	Electronic File	PSP - 16 The Eyrie.pdf
1260	PSM.5000.0001.1618	6/02/2025	Electronic File	PSP - 14 The Eyrie.pdf
1261	PSM.5000.0001.1621	6/02/2025	Electronic File	PSP - 12 The Eyrie.pdf
1262	PSM.5000.0001.1623	6/02/2025	Electronic File	PSP - 10 The Eyrie.pdf
1263	PSM.5000.0001.1625	6/02/2025	Electronic File	PSP - 6-8 The Eyrie.pdf
1264	PSM.5000.0001.1627	6/02/2025	Electronic File	PSP - 2 The Eyrie.pdf
1265	PSM.5000.0001.1630	6/02/2025	Electronic File	PSP - 1 Wonga Grove.pdf

Count	Document ID	Document Date	Document Type	Title
1266	PSM.5000.0001.1633	6/02/2025	Electronic File	PSP - 22 View Point Road.pdf
1267	PSM.5000.0001.1636	6/02/2025	Electronic File	PSP - 14-16 View Point Road.pdf
1268	PSM.5000.0001.1639	6/02/2025	Electronic File	20250107_120049.jpg
1269	PSM.5000.0001.1640	6/02/2025	Electronic File	20250107_124339.jpg
1270	PSM.5000.0001.1641	6/02/2025	Electronic File	20250107_124343.jpg
1271	PSM.5000.0001.1642	6/02/2025	Electronic File	20250107_120055.jpg
1272	PSM.5000.0001.1643	6/02/2025	Electronic File	20250107_120826.jpg
1273	PSM.5000.0001.1644	6/02/2025	Electronic File	20250107_120859.jpg
1274	PSM.5000.0001.1645	6/02/2025	Electronic File	20250107_120900.jpg
1275	PSM.5000.0001.1646	6/02/2025	Electronic File	20250107_121457.jpg
1276	PSM.5000.0001.1647	6/02/2025	Electronic File	20250107_121607.jpg
1277	PSM.5000.0001.1648	6/02/2025	Electronic File	20250107_121628.jpg
1278	PSM.5000.0001.1649	6/02/2025	Electronic File	20250107_121700.jpg
1279	PSM.5000.0001.1650	6/02/2025	Electronic File	20250107_123815.jpg
1280	PSM.5000.0001.1651	6/02/2025	Electronic File	20250107_124148.jpg
1281	PSM.5000.0001.1652	6/02/2025	Electronic File	20250107_124359.jpg
1282	PSM.5000.0001.1653	6/02/2025	Electronic File	20250107_124551.jpg
1283	PSM.5000.0001.1654	6/02/2025	Electronic File	20250107_121501.mp4
1284	PSM.5000.0001.1660	6/02/2025	Electronic File	20250107_123850.jpg
1285	PSM.5000.0001.1661	6/02/2025	Electronic File	20250107_123909.mp4
1286	PSM.5000.0001.1664	6/02/2025	Electronic File	20250107_124428.mp4
1287	PSM.5000.0001.1669	7/02/2025	Electronic File	38593257.pdf
1288	PSM.5000.0001.1671	7/02/2025	Electronic File	38593346.pdf
1289	PSM.5000.0001.1673	7/02/2025	Electronic File	ASSET 250655557.pdf
1290	PSM.5000.0001.3935	7/02/2025	Electronic File	Address_Data_Point.dbf
1291	PSM.5000.0001.3936	7/02/2025	Electronic File	Address_Data_Point.sbn
1292	PSM.5000.0001.3937	7/02/2025	Electronic File	Address_Data_Point.sbx
1293	PSM.5000.0001.3938	7/02/2025	Electronic File	Address_Data_Point.shp
1294	PSM.5000.0001.3939	7/02/2025	Electronic File	Address_Data_Point.shp.xml
1295	PSM.5000.0001.3940	7/02/2025	Electronic File	Address_Data_Point.shx
1296	PSM.5000.0001.3941	7/02/2025	Electronic File	Heritage_Overlay.dbf
1297	PSM.5000.0001.3942	7/02/2025	Electronic File	Heritage_Overlay.shp.xml
1298	PSM.5000.0001.3944	7/02/2025	Electronic File	Landfill_Buffer.dbf
1299	PSM.5000.0001.3945	7/02/2025	Electronic File	Landfill_Buffer.shp.xml
1300	PSM.5000.0001.3946	7/02/2025	Electronic File	Landfill_Site.dbf
1301	PSM.5000.0001.3947	7/02/2025	Electronic File	Landfill_Site.shp.xml
1302	PSM.5000.0001.3949	7/02/2025	Electronic File	Parcel.dbf
1303	PSM.5000.0001.3950	7/02/2025	Electronic File	Parcel.sbn
1304	PSM.5000.0001.3951	7/02/2025	Electronic File	Parcel.sbx
1305	PSM.5000.0001.3952	7/02/2025	Electronic File	Parcel.shp
1306	PSM.5000.0001.3953	7/02/2025	Electronic File	Parcel.shp.xml
1307	PSM.5000.0001.3955	7/02/2025	Electronic File	Parcel.shx
1308	PSM.5000.0001.3956	7/02/2025	Electronic File	Pipes_-_Council.dbf
1309	PSM.5000.0001.3957	7/02/2025	Electronic File	Pipes_-_Council.sbn
1310	PSM.5000.0001.3958	7/02/2025	Electronic File	Pipes_-_Council.sbx
1311	PSM.5000.0001.3959	7/02/2025	Electronic File	Pipes_-_Council.shp
1312	PSM.5000.0001.3960	7/02/2025	Electronic File	Pipes_-_Council.shp.xml
1313	PSM.5000.0001.3962	7/02/2025	Electronic File	Pipes_-_Council.shx
1314	PSM.5000.0001.3963	7/02/2025	Electronic File	Pipes_-_Melbourne_Water.dbf
1315	PSM.5000.0001.3964	7/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
1316	PSM.5000.0001.3966	7/02/2025	Electronic File	Pipes_-_Unconfirmed.dbf
1317	PSM.5000.0001.3967	7/02/2025	Electronic File	Pipes_-_Unconfirmed.sbn
1318	PSM.5000.0001.3968	7/02/2025	Electronic File	Pipes_-_Unconfirmed.sbx
1319	PSM.5000.0001.3969	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shp
1320	PSM.5000.0001.3970	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml

Count	Document ID	Document Date	Document Type	Title
1321	PSM.5000.0001.3972	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shx
1322	PSM.5000.0001.3973	7/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
1323	PSM.5000.0001.3975	7/02/2025	Electronic File	Pits_-_Council.dbf
1324	PSM.5000.0001.3976	7/02/2025	Electronic File	Pits_-_Council.sbn
1325	PSM.5000.0001.3977	7/02/2025	Electronic File	Pits_-_Council.sbx
1326	PSM.5000.0001.3978	7/02/2025	Electronic File	Pits_-_Council.shp
1327	PSM.5000.0001.3979	7/02/2025	Electronic File	Pits_-_Council.shp.xml
1328	PSM.5000.0001.3981	7/02/2025	Electronic File	Pits_-_Council.shx
1329	PSM.5000.0001.3982	7/02/2025	Electronic File	Pits_-_Melbourne_Water.dbf
1330	PSM.5000.0001.3983	7/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
1331	PSM.5000.0001.3985	7/02/2025	Electronic File	Pits_-_Unconfirmed.dbf
1332	PSM.5000.0001.3986	7/02/2025	Electronic File	Pits_-_Unconfirmed.sbn
1333	PSM.5000.0001.3987	7/02/2025	Electronic File	Pits_-_Unconfirmed.sbx
1334	PSM.5000.0001.3988	7/02/2025	Electronic File	Pits_-_Unconfirmed.shp
1335	PSM.5000.0001.3989	7/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
1336	PSM.5000.0001.3991	7/02/2025	Electronic File	Pits_-_Unconfirmed.shx
1337	PSM.5000.0001.3992	7/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
1338	PSM.5000.0001.3994	7/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1339	PSM.5000.0001.3995	7/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1340	PSM.5000.0001.3997	7/02/2025	Electronic File	Water_Sensitive_Urban_Design.dbf
1341	PSM.5000.0001.3998	7/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
1342	PSM.5000.0001.4000	7/02/2025	Electronic File	ASSET 250656087.pdf
1343	PSM.5000.0001.6075	7/02/2025	Electronic File	Address_Data_Point.dbf
1344	PSM.5000.0001.6076	7/02/2025	Electronic File	Address_Data_Point.sbn
1345	PSM.5000.0001.6077	7/02/2025	Electronic File	Address_Data_Point.sbx
1346	PSM.5000.0001.6078	7/02/2025	Electronic File	Address_Data_Point.shp
1347	PSM.5000.0001.6079	7/02/2025	Electronic File	Address_Data_Point.shp.xml
1348	PSM.5000.0001.6080	7/02/2025	Electronic File	Address_Data_Point.shx
1349	PSM.5000.0001.6081	7/02/2025	Electronic File	Heritage_Overlay.dbf
1350	PSM.5000.0001.6082	7/02/2025	Electronic File	Heritage_Overlay.sbn
1351	PSM.5000.0001.6083	7/02/2025	Electronic File	Heritage_Overlay.sbx
1352	PSM.5000.0001.6084	7/02/2025	Electronic File	Heritage_Overlay.shp
1353	PSM.5000.0001.6085	7/02/2025	Electronic File	Heritage_Overlay.shp.xml
1354	PSM.5000.0001.6087	7/02/2025	Electronic File	Heritage_Overlay.shx
1355	PSM.5000.0001.6088	7/02/2025	Electronic File	Landfill_Buffer.shp.xml
1356	PSM.5000.0001.6089	7/02/2025	Electronic File	Landfill_Site.shp.xml
1357	PSM.5000.0001.6091	7/02/2025	Electronic File	Parcel.dbf
1358	PSM.5000.0001.6092	7/02/2025	Electronic File	Parcel.sbn
1359	PSM.5000.0001.6093	7/02/2025	Electronic File	Parcel.sbx
1360	PSM.5000.0001.6094	7/02/2025	Electronic File	Parcel.shp
1361	PSM.5000.0001.6095	7/02/2025	Electronic File	Parcel.shp.xml
1362	PSM.5000.0001.6097	7/02/2025	Electronic File	Parcel.shx
1363	PSM.5000.0001.6098	7/02/2025	Electronic File	Pipes_-_Council2.dbf
1364	PSM.5000.0001.6099	7/02/2025	Electronic File	Pipes_-_Council2.sbn
1365	PSM.5000.0001.6100	7/02/2025	Electronic File	Pipes_-_Council2.sbx
1366	PSM.5000.0001.6101	7/02/2025	Electronic File	Pipes_-_Council2.shp
1367	PSM.5000.0001.6102	7/02/2025	Electronic File	Pipes_-_Council2.shp.xml
1368	PSM.5000.0001.6104	7/02/2025	Electronic File	Pipes_-_Council2.shx
1369	PSM.5000.0001.6105	7/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
1370	PSM.5000.0001.6107	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml
1371	PSM.5000.0001.6109	7/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
1372	PSM.5000.0001.6111	7/02/2025	Electronic File	Pits_-_Council2.dbf
1373	PSM.5000.0001.6112	7/02/2025	Electronic File	Pits_-_Council2.sbn
1374	PSM.5000.0001.6113	7/02/2025	Electronic File	Pits_-_Council2.sbx
1375	PSM.5000.0001.6114	7/02/2025	Electronic File	Pits_-_Council2.shp

Count	Document ID	Document Date	Document Type	Title
1376	PSM.5000.0001.6115	7/02/2025	Electronic File	Pits_-_Council2.shp.xml
1377	PSM.5000.0001.6117	7/02/2025	Electronic File	Pits_-_Council2.shx
1378	PSM.5000.0001.6118	7/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
1379	PSM.5000.0001.6120	7/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
1380	PSM.5000.0001.6122	7/02/2025	Electronic File	Pits_-_VicRoads.dbf
1381	PSM.5000.0001.6123	7/02/2025	Electronic File	Pits_-_VicRoads.sbn
1382	PSM.5000.0001.6124	7/02/2025	Electronic File	Pits_-_VicRoads.sbx
1383	PSM.5000.0001.6125	7/02/2025	Electronic File	Pits_-_VicRoads.shp
1384	PSM.5000.0001.6126	7/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
1385	PSM.5000.0001.6128	7/02/2025	Electronic File	Pits_-_VicRoads.shx
1386	PSM.5000.0001.6129	7/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1387	PSM.5000.0001.6131	7/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
1388	PSM.5000.0001.6133	7/02/2025	Electronic File	38595340.PDF
1389	PSM.5000.0001.6135	7/02/2025	Electronic File	ASSET 250678851.pdf
1390	PSM.5000.0001.9386	7/02/2025	Electronic File	Address_Data_Point.dbf
1391	PSM.5000.0001.9387	7/02/2025	Electronic File	Address_Data_Point.sbn
1392	PSM.5000.0001.9388	7/02/2025	Electronic File	Address_Data_Point.sbx
1393	PSM.5000.0001.9389	7/02/2025	Electronic File	Address_Data_Point.shp
1394	PSM.5000.0001.9390	7/02/2025	Electronic File	Address_Data_Point.shp.xml
1395	PSM.5000.0001.9391	7/02/2025	Electronic File	Address_Data_Point.shx
1396	PSM.5000.0001.9392	7/02/2025	Electronic File	Heritage_Overlay.dbf
1397	PSM.5000.0001.9393	7/02/2025	Electronic File	Heritage_Overlay.sbn
1398	PSM.5000.0001.9394	7/02/2025	Electronic File	Heritage_Overlay.sbx
1399	PSM.5000.0001.9395	7/02/2025	Electronic File	Heritage_Overlay.shp
1400	PSM.5000.0001.9396	7/02/2025	Electronic File	Heritage_Overlay.shp.xml
1401	PSM.5000.0001.9398	7/02/2025	Electronic File	Heritage_Overlay.shx
1402	PSM.5000.0001.9399	7/02/2025	Electronic File	Landfill_Buffer.shp.xml
1403	PSM.5000.0001.9400	7/02/2025	Electronic File	Landfill_Site.shp.xml
1404	PSM.5000.0001.9402	7/02/2025	Electronic File	Parcel.dbf
1405	PSM.5000.0001.9403	7/02/2025	Electronic File	Parcel.sbn
1406	PSM.5000.0001.9404	7/02/2025	Electronic File	Parcel.sbx
1407	PSM.5000.0001.9405	7/02/2025	Electronic File	Parcel.shp
1408	PSM.5000.0001.9406	7/02/2025	Electronic File	Parcel.shp.xml
1409	PSM.5000.0001.9408	7/02/2025	Electronic File	Parcel.shx
1410	PSM.5000.0001.9409	7/02/2025	Electronic File	Pipes_-_Council3.dbf
1411	PSM.5000.0001.9410	7/02/2025	Electronic File	Pipes_-_Council3.sbn
1412	PSM.5000.0001.9411	7/02/2025	Electronic File	Pipes_-_Council3.sbx
1413	PSM.5000.0001.9412	7/02/2025	Electronic File	Pipes_-_Council3.shp
1414	PSM.5000.0001.9413	7/02/2025	Electronic File	Pipes_-_Council3.shp.xml
1415	PSM.5000.0001.9415	7/02/2025	Electronic File	Pipes_-_Council3.shx
1416	PSM.5000.0001.9416	7/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
1417	PSM.5000.0001.9418	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml
1418	PSM.5000.0001.9420	7/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
1419	PSM.5000.0001.9422	7/02/2025	Electronic File	Pits_-_Council3.dbf
1420	PSM.5000.0001.9423	7/02/2025	Electronic File	Pits_-_Council3.sbn
1421	PSM.5000.0001.9424	7/02/2025	Electronic File	Pits_-_Council3.sbx
1422	PSM.5000.0001.9425	7/02/2025	Electronic File	Pits_-_Council3.shp
1423	PSM.5000.0001.9426	7/02/2025	Electronic File	Pits_-_Council3.shp.xml
1424	PSM.5000.0001.9428	7/02/2025	Electronic File	Pits_-_Council3.shx
1425	PSM.5000.0001.9429	7/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
1426	PSM.5000.0001.9431	7/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
1427	PSM.5000.0001.9433	7/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
1428	PSM.5000.0001.9435	7/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1429	PSM.5000.0001.9437	7/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
1430	PSM.5000.0001.9439	7/02/2025	Electronic File	38597320.PDF

Count	Document ID	Document Date	Document Type	Title
1431	PSM.5000.0001.9441	7/02/2025	Electronic File	38597400.PDF
1432	PSM.5000.0001.9443	7/02/2025	Electronic File	38597411.PDF
1433	PSM.5000.0001.9445	7/02/2025	Electronic File	ASSET 250679311.pdf
1434	PSM.5000.0002.2038	7/02/2025	Electronic File	Address_Data_Point.dbf
1435	PSM.5000.0002.2039	7/02/2025	Electronic File	Address_Data_Point.sbn
1436	PSM.5000.0002.2040	7/02/2025	Electronic File	Address_Data_Point.sbx
1437	PSM.5000.0002.2041	7/02/2025	Electronic File	Address_Data_Point.shp
1438	PSM.5000.0002.2042	7/02/2025	Electronic File	Address_Data_Point.shp.xml
1439	PSM.5000.0002.2043	7/02/2025	Electronic File	Address_Data_Point.shx
1440	PSM.5000.0002.2044	7/02/2025	Electronic File	Heritage_Overlay.shp.xml
1441	PSM.5000.0002.2046	7/02/2025	Electronic File	Landfill_Buffer.shp.xml
1442	PSM.5000.0002.2047	7/02/2025	Electronic File	Landfill_Site.shp.xml
1443	PSM.5000.0002.2049	7/02/2025	Electronic File	Parcel.dbf
1444	PSM.5000.0002.2050	7/02/2025	Electronic File	Parcel.sbn
1445	PSM.5000.0002.2051	7/02/2025	Electronic File	Parcel.sbx
1446	PSM.5000.0002.2052	7/02/2025	Electronic File	Parcel.shp
1447	PSM.5000.0002.2053	7/02/2025	Electronic File	Parcel.shp.xml
1448	PSM.5000.0002.2055	7/02/2025	Electronic File	Parcel.shx
1449	PSM.5000.0002.2056	7/02/2025	Electronic File	Pipes_-_Council4.dbf
1450	PSM.5000.0002.2057	7/02/2025	Electronic File	Pipes_-_Council4.sbn
1451	PSM.5000.0002.2058	7/02/2025	Electronic File	Pipes_-_Council4.sbx
1452	PSM.5000.0002.2059	7/02/2025	Electronic File	Pipes_-_Council4.shp
1453	PSM.5000.0002.2060	7/02/2025	Electronic File	Pipes_-_Council4.shp.xml
1454	PSM.5000.0002.2062	7/02/2025	Electronic File	Pipes_-_Council4.shx
1455	PSM.5000.0002.2063	7/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
1456	PSM.5000.0002.2065	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml
1457	PSM.5000.0002.2067	7/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
1458	PSM.5000.0002.2069	7/02/2025	Electronic File	Pits_-_Council4.dbf
1459	PSM.5000.0002.2070	7/02/2025	Electronic File	Pits_-_Council4.sbn
1460	PSM.5000.0002.2071	7/02/2025	Electronic File	Pits_-_Council4.sbx
1461	PSM.5000.0002.2072	7/02/2025	Electronic File	Pits_-_Council4.shp
1462	PSM.5000.0002.2073	7/02/2025	Electronic File	Pits_-_Council4.shp.xml
1463	PSM.5000.0002.2075	7/02/2025	Electronic File	Pits_-_Council4.shx
1464	PSM.5000.0002.2076	7/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
1465	PSM.5000.0002.2078	7/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
1466	PSM.5000.0002.2080	7/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
1467	PSM.5000.0002.2082	7/02/2025	Electronic File	Pit_Underground_Footprint_Call_03_5950_1040_to_arrange_o
1468	PSM.5000.0002.2084	7/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
1469	PSM.5000.0002.2086	7/02/2025	Electronic File	ASSET 250679375.pdf
1470	PSM.5000.0002.4600	7/02/2025	Electronic File	Address_Data_Point.dbf
1471	PSM.5000.0002.4601	7/02/2025	Electronic File	Address_Data_Point.sbn
1472	PSM.5000.0002.4602	7/02/2025	Electronic File	Address_Data_Point.sbx
1473	PSM.5000.0002.4603	7/02/2025	Electronic File	Address_Data_Point.shp
1474	PSM.5000.0002.4604	7/02/2025	Electronic File	Address_Data_Point.shp.xml
1475	PSM.5000.0002.4605	7/02/2025	Electronic File	Address_Data_Point.shx
1476	PSM.5000.0002.4606	7/02/2025	Electronic File	Heritage_Overlay.shp.xml
1477	PSM.5000.0002.4608	7/02/2025	Electronic File	Landfill_Buffer.shp.xml
1478	PSM.5000.0002.4609	7/02/2025	Electronic File	Landfill_Site.shp.xml
1479	PSM.5000.0002.4611	7/02/2025	Electronic File	Parcel.dbf
1480	PSM.5000.0002.4612	7/02/2025	Electronic File	Parcel.sbn
1481	PSM.5000.0002.4613	7/02/2025	Electronic File	Parcel.sbx
1482	PSM.5000.0002.4614	7/02/2025	Electronic File	Parcel.shp
1483	PSM.5000.0002.4615	7/02/2025	Electronic File	Parcel.shp.xml
1484	PSM.5000.0002.4617	7/02/2025	Electronic File	Parcel.shx
1485	PSM.5000.0002.4618	7/02/2025	Electronic File	Pipes_-_Council5.dbf

Count	Document ID	Document Date	Document Type	Title
1486	PSM.5000.0002.4619	7/02/2025	Electronic File	Pipes_-_Council5.sbn
1487	PSM.5000.0002.4620	7/02/2025	Electronic File	Pipes_-_Council5.sbx
1488	PSM.5000.0002.4621	7/02/2025	Electronic File	Pipes_-_Council5.shp
1489	PSM.5000.0002.4622	7/02/2025	Electronic File	Pipes_-_Council5.shp.xml
1490	PSM.5000.0002.4624	7/02/2025	Electronic File	Pipes_-_Council5.shx
1491	PSM.5000.0002.4625	7/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
1492	PSM.5000.0002.4627	7/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml
1493	PSM.5000.0002.4629	7/02/2025	Electronic File	Pipes_-_Vicroads.dbf
1494	PSM.5000.0002.4630	7/02/2025	Electronic File	Pipes_-_Vicroads.sbn
1495	PSM.5000.0002.4631	7/02/2025	Electronic File	Pipes_-_Vicroads.sbx
1496	PSM.5000.0002.4632	7/02/2025	Electronic File	Pipes_-_Vicroads.shp
1497	PSM.5000.0002.4633	7/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
1498	PSM.5000.0002.4635	7/02/2025	Electronic File	Pipes_-_Vicroads.shx
1499	PSM.5000.0002.4636	7/02/2025	Electronic File	Pits_-_Council5.dbf
1500	PSM.5000.0002.4637	7/02/2025	Electronic File	Pits_-_Council5.sbn
1501	PSM.5000.0002.4638	7/02/2025	Electronic File	Pits_-_Council5.sbx
1502	PSM.5000.0002.4639	7/02/2025	Electronic File	Pits_-_Council5.shp
1503	PSM.5000.0002.4640	7/02/2025	Electronic File	Pits_-_Council5.shp.xml
1504	PSM.5000.0002.4642	7/02/2025	Electronic File	Pits_-_Council5.shx
1505	PSM.5000.0002.4643	7/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
1506	PSM.5000.0002.4645	7/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
1507	PSM.5000.0002.4647	7/02/2025	Electronic File	Pits_-_VicRoads.dbf
1508	PSM.5000.0002.4648	7/02/2025	Electronic File	Pits_-_VicRoads.sbn
1509	PSM.5000.0002.4649	7/02/2025	Electronic File	Pits_-_VicRoads.sbx
1510	PSM.5000.0002.4650	7/02/2025	Electronic File	Pits_-_VicRoads.shp
1511	PSM.5000.0002.4651	7/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
1512	PSM.5000.0002.4653	7/02/2025	Electronic File	Pits_-_VicRoads.shx
1513	PSM.5000.0002.4654	7/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1514	PSM.5000.0002.4656	7/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
1515	PSM.5000.0002.4658	7/02/2025	Electronic File	Services around Gully near The Eyrie.pptx
1516	PSM.5000.0002.4667	10/02/2025	Electronic File	IMG_1454.HEIC
1517	PSM.5000.0002.4668	10/02/2025	Electronic File	IMG_1455.HEIC
1518	PSM.5000.0002.4669	10/02/2025	Electronic File	IMG_1456.HEIC
1519	PSM.5000.0002.4670	10/02/2025	Electronic File	IMG_1457.HEIC
1520	PSM.5000.0002.4671	10/02/2025	Electronic File	IMG_1458.HEIC
1521	PSM.5000.0002.4672	10/02/2025	Electronic File	IMG_1459.HEIC
1522	PSM.5000.0002.4673	10/02/2025	Electronic File	IMG_1460.HEIC
1523	PSM.5000.0002.4674	10/02/2025	Electronic File	IMG_1461.HEIC
1524	PSM.5000.0002.4675	10/02/2025	Electronic File	IMG_1462.HEIC
1525	PSM.5000.0002.4676	10/02/2025	Electronic File	IMG_1463.HEIC
1526	PSM.5000.0002.4677	10/02/2025	Electronic File	IMG_1464.HEIC
1527	PSM.5000.0002.4678	10/02/2025	Electronic File	TH000405.JPG
1528	PSM.5000.0002.4679	10/02/2025	Electronic File	TH000406.JPG
1529	PSM.5000.0002.4680	10/02/2025	Electronic File	TH000407.JPG
1530	PSM.5000.0002.4681	10/02/2025	Electronic File	IMG_1468.HEIC
1531	PSM.5000.0002.4682	10/02/2025	Electronic File	IMG_1469.HEIC
1532	PSM.5000.0002.4683	10/02/2025	Electronic File	IMG_1470.HEIC
1533	PSM.5000.0002.4684	10/02/2025	Electronic File	TH000408.JPG
1534	PSM.5000.0002.4685	10/02/2025	Electronic File	TH000409.JPG
1535	PSM.5000.0002.4686	10/02/2025	Electronic File	TH000410.JPG
1536	PSM.5000.0002.4687	10/02/2025	Electronic File	IMG_1474.HEIC
1537	PSM.5000.0002.4688	10/02/2025	Electronic File	IMG_1475.HEIC
1538	PSM.5000.0002.4689	10/02/2025	Electronic File	IMG_1476.HEIC
1539	PSM.5000.0002.4690	10/02/2025	Electronic File	IMG_1477.HEIC
1540	PSM.5000.0002.4691	10/02/2025	Electronic File	TH000411.JPG

Count	Document ID	Document Date	Document Type	Title
1541	PSM.5000.0002.4692	10/02/2025	Electronic File	IMG_1479.HEIC
1542	PSM.5000.0002.4693	10/02/2025	Electronic File	IMG_1480.HEIC
1543	PSM.5000.0002.4694	10/02/2025	Electronic File	IMG_1481.HEIC
1544	PSM.5000.0002.4695	10/02/2025	Electronic File	IMG_1482.MOV
1545	PSM.5000.0002.4696	10/02/2025	Electronic File	IMG_1483.HEIC
1546	PSM.5000.0002.4697	10/02/2025	Electronic File	IMG_1484.HEIC
1547	PSM.5000.0002.4698	10/02/2025	Electronic File	IMG_1485.HEIC
1548	PSM.5000.0002.4699	10/02/2025	Electronic File	IMG_1486.HEIC
1549	PSM.5000.0002.4700	10/02/2025	Electronic File	IMG_1487.HEIC
1550	PSM.5000.0002.4701	10/02/2025	Electronic File	IMG_1488.HEIC
1551	PSM.5000.0002.4702	10/02/2025	Electronic File	IMG_1489.HEIC
1552	PSM.5000.0002.4703	10/02/2025	Electronic File	IMG_1490.HEIC
1553	PSM.5000.0002.4704	10/02/2025	Electronic File	PSP - 4 The Eyrie.pdf
1554	PSM.5000.0002.4707	10/02/2025	Electronic File	IMG_1491.HEIC
1555	PSM.5000.0002.4708	10/02/2025	Electronic File	IMG_1492.HEIC
1556	PSM.5000.0002.4709	10/02/2025	Electronic File	IMG_1493.HEIC
1557	PSM.5000.0002.4710	10/02/2025	Electronic File	IMG_1494.HEIC
1558	PSM.5000.0002.4711	10/02/2025	Electronic File	IMG_1495.HEIC
1559	PSM.5000.0002.4712	10/02/2025	Electronic File	IMG_1496.HEIC
1560	PSM.5000.0002.4713	10/02/2025	Electronic File	IMG_1497.HEIC
1561	PSM.5000.0002.4714	10/02/2025	Electronic File	IMG_1498.HEIC
1562	PSM.5000.0002.4715	10/02/2025	Electronic File	IMG_1499.HEIC
1563	PSM.5000.0002.4716	10/02/2025	Electronic File	IMG_1500.HEIC
1564	PSM.5000.0002.4717	10/02/2025	Electronic File	IMG_1501.HEIC
1565	PSM.5000.0002.4718	10/02/2025	Electronic File	TH000412.JPG
1566	PSM.5000.0002.4719	10/02/2025	Electronic File	TH000413.JPG
1567	PSM.5000.0002.4720	10/02/2025	Electronic File	TH000414.JPG
1568	PSM.5000.0002.4721	10/02/2025	Electronic File	TH000415.JPG
1569	PSM.5000.0002.4722	10/02/2025	Electronic File	IMG_1506.HEIC
1570	PSM.5000.0002.4723	10/02/2025	Electronic File	IMG_1507.HEIC
1571	PSM.5000.0002.4724	10/02/2025	Electronic File	IMG_1508.HEIC
1572	PSM.5000.0002.4725	10/02/2025	Electronic File	IMG_1509.HEIC
1573	PSM.5000.0002.4726	10/02/2025	Electronic File	IMG_1510.HEIC
1574	PSM.5000.0002.4727	10/02/2025	Electronic File	IMG_1511.MOV
1575	PSM.5000.0002.4728	10/02/2025	Electronic File	IMG_1512.HEIC
1576	PSM.5000.0002.4729	10/02/2025	Electronic File	IMG_1513.HEIC
1577	PSM.5000.0002.4730	10/02/2025	Electronic File	IMG_1514.HEIC
1578	PSM.5000.0002.4731	10/02/2025	Electronic File	IMG_1515.HEIC
1579	PSM.5000.0002.4732	10/02/2025	Electronic File	IMG_1516.HEIC
1580	PSM.5000.0002.4733	10/02/2025	Electronic File	IMG_1517.HEIC
1581	PSM.5000.0002.4734	10/02/2025	Electronic File	IMG_1518.HEIC
1582	PSM.5000.0002.4735	10/02/2025	Electronic File	IMG_1519.HEIC
1583	PSM.5000.0002.4736	10/02/2025	Electronic File	IMG_1520.HEIC
1584	PSM.5000.0002.4737	10/02/2025	Electronic File	IMG_1521.HEIC
1585	PSM.5000.0002.4738	10/02/2025	Electronic File	IMG_1522.HEIC
1586	PSM.5000.0002.4739	10/02/2025	Electronic File	IMG_1523.HEIC
1587	PSM.5000.0002.4740	10/02/2025	Electronic File	IMG_1524.HEIC
1588	PSM.5000.0002.4741	10/02/2025	Electronic File	IMG_1525.HEIC
1589	PSM.5000.0002.4742	10/02/2025	Electronic File	IMG_1526.HEIC
1590	PSM.5000.0002.4743	10/02/2025	Electronic File	IMG_1527.HEIC
1591	PSM.5000.0002.4744	10/02/2025	Electronic File	IMG_1528.HEIC
1592	PSM.5000.0002.4745	10/02/2025	Electronic File	IMG_1529.HEIC
1593	PSM.5000.0002.4746	10/02/2025	Electronic File	250667853.pdf
1594	PSM.5000.0002.4769	10/02/2025	Electronic File	400-STD-AM-0001_2 Guidelines for Works Near Existing Gas Assets.pdf
1595	PSM.5000.0002.4810	10/02/2025	Electronic File	Response Body.html

Count	Document ID	Document Date	Document Type	Title
1596	PSM.5000.0002.4811	10/02/2025	Electronic File	ASSET 250667849.pdf
1597	PSM.5000.0002.8116	10/02/2025	Electronic File	DBYD cover letter (A9941786) 250667849.pdf
1598	PSM.5000.0002.8117	10/02/2025	Electronic File	Response Body.html
1599	PSM.5000.0002.8118	10/02/2025	Electronic File	Tree Protection Brochure 250667849.pdf
1600	PSM.5000.0002.8119	10/02/2025	Electronic File	250667852_20250207_070546073170_1.pdf
1601	PSM.5000.0002.8136	10/02/2025	Electronic File	250667852_20250207_070546073170_pwc_1.pdf
1602	PSM.5000.0002.8153	10/02/2025	Electronic File	4678_NBN_Dial_Before_You_Dig_Poster_20170517.pdf
1603	PSM.5000.0002.8155	10/02/2025	Electronic File	Disclaimer_250667852_20250207_070546073170.pdf
1604	PSM.5000.0002.8159	10/02/2025	Electronic File	Mail Body.html
1605	PSM.5000.0002.8160	10/02/2025	Electronic File	250667850 - Optus Plan.pdf
1606	PSM.5000.0002.8165	10/02/2025	Electronic File	250667850 - Optus Response Letter.pdf
1607	PSM.5000.0002.8177	10/02/2025	Electronic File	Mail Body.html
1608	PSM.5000.0002.8178	10/02/2025	Electronic File	250667851.pdf
1609	PSM.5000.0002.8184	10/02/2025	Electronic File	Response Body.html
1610	PSM.5000.0002.8185	10/02/2025	Electronic File	AssetInfoOutput_48574530_DC8B7FD4-7A78-47F3-8B65-86CA75D452F5.pdf
1611	PSM.5000.0002.8190	10/02/2025	Electronic File	BodyImg0
1612	PSM.5000.0002.8191	10/02/2025	Electronic File	Mail Body.html
1613	PSM.5000.0002.8193	10/02/2025	Electronic File	250667855 - United Energy Response letter.pdf
1614	PSM.5000.0002.8196	10/02/2025	Electronic File	250667855 - United Energy Response Plan.pdf
1615	PSM.5000.0002.8205	10/02/2025	Electronic File	Mail Body.html
1616	PSM.5000.0002.8206	10/02/2025	Electronic File	UE5-06-10348.TIF
1617	PSM.5000.0002.8207	10/02/2025	Electronic File	UE5-06-12351.TIF
1618	PSM.5000.0002.8208	10/02/2025	Electronic File	UE5-06-12936.TIF
1619	PSM.5000.0002.8209	10/02/2025	Electronic File	UE5-06-14876.TIF
1620	PSM.5000.0002.8210	10/02/2025	Electronic File	UE5-06-16671.TIF
1621	PSM.5000.0002.8211	10/02/2025	Electronic File	UE5-06-18927.TIF
1622	PSM.5000.0002.8212	10/02/2025	Electronic File	UE5-06-4023.TIF
1623	PSM.5000.0002.8213	10/02/2025	Electronic File	UE5-06-5784.TIF
1624	PSM.5000.0002.8214	10/02/2025	Electronic File	UE5-06-6193.TIF
1625	PSM.5000.0002.8215	10/02/2025	Electronic File	UE5-06-6195.TIF
1626	PSM.5000.0002.8216	10/02/2025	Electronic File	UE5-06-6283.TIF
1627	PSM.5000.0002.8217	10/02/2025	Electronic File	UE5-06-6296.TIF
1628	PSM.5000.0002.8218	10/02/2025	Electronic File	UE5-06-6603.TIF
1629	PSM.5000.0002.8219	10/02/2025	Electronic File	UE5-07-26211.tif
1630	PSM.5000.0002.8220	10/02/2025	Electronic File	UE5-07-27662.pdf
1631	PSM.5000.0002.8221	10/02/2025	Electronic File	UE5-07-28910.PDF
1632	PSM.5000.0002.8222	10/02/2025	Electronic File	UE5-07-31137.pdf
1633	PSM.5000.0002.8223	10/02/2025	Electronic File	UE5-07-32608.pdf
1634	PSM.5000.0002.8224	10/02/2025	Electronic File	UE5-07-38908.pdf
1635	PSM.5000.0002.8225	10/02/2025	Electronic File	UE5-07-41718.pdf
1636	PSM.5000.0002.8226	10/02/2025	Electronic File	UE5-07-44797.pdf
1637	PSM.5000.0002.8227	10/02/2025	Electronic File	UE5-07-45802.pdf
1638	PSM.5000.0002.8228	10/02/2025	Electronic File	UE5-07-47069.pdf
1639	PSM.5000.0002.8229	10/02/2025	Electronic File	UE5-07-48295.pdf
1640	PSM.5000.0002.8230	10/02/2025	Electronic File	UE5-07-48974.pdf
1641	PSM.5000.0002.8231	10/02/2025	Electronic File	UE5-07-49145.pdf
1642	PSM.5000.0002.8232	10/02/2025	Electronic File	UE5-11-1067.TIF
1643	PSM.5000.0002.8233	10/02/2025	Electronic File	UE5-11-1185.TIF
1644	PSM.5000.0002.8234	10/02/2025	Electronic File	UE5-11-1357.TIF
1645	PSM.5000.0002.8235	10/02/2025	Electronic File	UE5-11-1763.TIF
1646	PSM.5000.0002.8236	10/02/2025	Electronic File	UE5-11-2017.TIF
1647	PSM.5000.0002.8237	10/02/2025	Electronic File	UE5-11-3125.TIF
1648	PSM.5000.0002.8238	10/02/2025	Electronic File	UE5-11-3771.TIF
1649	PSM.5000.0002.8239	10/02/2025	Electronic File	UE5-11-4004.TIF
1650	PSM.5000.0002.8240	10/02/2025	Electronic File	UE5-11-414.TIF

Count	Document ID	Document Date	Document Type	Title
1651	PSM.5000.0002.8241	10/02/2025	Electronic File	UE5-11-4276.TIF
1652	PSM.5000.0002.8242	10/02/2025	Electronic File	UE5-11-5392.TIF
1653	PSM.5000.0002.8243	10/02/2025	Electronic File	UE5-11-557.pdf
1654	PSM.5000.0002.8244	10/02/2025	Electronic File	UE5-11-8169.TIF
1655	PSM.5000.0002.8245	10/02/2025	Electronic File	UE5-11-8174.TIF
1656	PSM.5000.0002.8246	10/02/2025	Electronic File	UE5-11-8177.TIF
1657	PSM.5000.0002.8247	10/02/2025	Electronic File	UE5-11-8178.TIF
1658	PSM.5000.0002.8248	10/02/2025	Electronic File	UE5-17-319387.pdf
1659	PSM.5000.0002.8249	10/02/2025	Electronic File	UE5-17-347092.pdf
1660	PSM.5000.0002.8250	10/02/2025	Electronic File	UE5-18-729409.pdf
1661	PSM.5000.0002.8251	10/02/2025	Electronic File	UE5-19-021281.pdf
1662	PSM.5000.0002.8252	10/02/2025	Electronic File	250667856.dwf
1663	PSM.5000.0002.8253	10/02/2025	Electronic File	AccreditedPlantLocators 2025-01-08a.pdf
1664	PSM.5000.0002.8254	10/02/2025	Electronic File	Mail Body.html
1665	PSM.5000.0002.8255	10/02/2025	Electronic File	Telstra Duty of Care v32.0c.pdf
1666	PSM.5000.0002.8257	10/02/2025	Electronic File	Telstra Map Legend 4.0b.pdf
1667	PSM.5000.0002.8258	10/02/2025	Electronic File	UE5-20-1337.TIF
1668	PSM.5000.0002.8259	10/02/2025	Electronic File	UE5-20-1394.TIF
1669	PSM.5000.0002.8260	10/02/2025	Electronic File	UE5-20-1476.TIF
1670	PSM.5000.0002.8261	10/02/2025	Electronic File	UE5-20-1479.TIF
1671	PSM.5000.0002.8262	10/02/2025	Electronic File	UE5-20-1524.TIF
1672	PSM.5000.0002.8263	10/02/2025	Electronic File	UE5-20-1841.TIF
1673	PSM.5000.0002.8264	10/02/2025	Electronic File	UE5-20-2424.TIF
1674	PSM.5000.0002.8265	10/02/2025	Electronic File	UE5-20-251444.pdf
1675	PSM.5000.0002.8266	10/02/2025	Electronic File	UE5-20-2655.TIF
1676	PSM.5000.0002.8267	10/02/2025	Electronic File	UE5-20-2668.TIF
1677	PSM.5000.0002.8268	10/02/2025	Electronic File	UE5-20-385589.pdf
1678	PSM.5000.0002.8269	10/02/2025	Electronic File	UE5-20-47.TIF
1679	PSM.5000.0002.8270	10/02/2025	Electronic File	UE5-20-989.TIF
1680	PSM.5000.0002.8271	10/02/2025	Electronic File	UE5-21-606138.pdf
1681	PSM.5000.0002.8272	10/02/2025	Electronic File	UE5-21-628801.pdf
1682	PSM.5000.0002.8273	10/02/2025	Electronic File	UE5-21-645062.pdf
1683	PSM.5000.0002.8274	10/02/2025	Electronic File	UE5-21-786976.pdf
1684	PSM.5000.0002.8275	10/02/2025	Electronic File	UE5-RBD-30274.pdf
1685	PSM.5000.0002.8276	10/02/2025	Electronic File	Summary.pptx
1686	PSM.5000.0002.8284	10/02/2025	Electronic File	IMG_1530.HEIC
1687	PSM.5000.0002.8285	10/02/2025	Electronic File	IMG_1531.HEIC
1688	PSM.5000.0002.8286	10/02/2025	Electronic File	IMG_1532.HEIC
1689	PSM.5000.0002.8287	10/02/2025	Electronic File	IMG_1533.HEIC
1690	PSM.5000.0002.8288	10/02/2025	Electronic File	IMG_1534.HEIC
1691	PSM.5000.0002.8289	10/02/2025	Electronic File	IMG_1535.HEIC
1692	PSM.5000.0002.8290	10/02/2025	Electronic File	IMG_1536.HEIC
1693	PSM.5000.0002.8291	10/02/2025	Electronic File	IMG_1537.HEIC
1694	PSM.5000.0002.8292	10/02/2025	Electronic File	IMG_1538.HEIC
1695	PSM.5000.0002.8293	10/02/2025	Electronic File	IMG_1539.HEIC
1696	PSM.5000.0002.8294	10/02/2025	Electronic File	IMG_1540.HEIC
1697	PSM.5000.0002.8295	10/02/2025	Electronic File	IMG_1541.HEIC
1698	PSM.5000.0002.8296	10/02/2025	Electronic File	IMG_1542.HEIC
1699	PSM.5000.0002.8297	10/02/2025	Electronic File	IMG_1543.HEIC
1700	PSM.5000.0002.8298	10/02/2025	Electronic File	IMG_1544.HEIC
1701	PSM.5000.0002.8299	10/02/2025	Electronic File	IMG_1545.HEIC
1702	PSM.5000.0002.8300	10/02/2025	Electronic File	IMG_1546.HEIC
1703	PSM.5000.0002.8301	10/02/2025	Electronic File	TH000416.JPG
1704	PSM.5000.0002.8302	10/02/2025	Electronic File	TH000417.JPG
1705	PSM.5000.0002.8303	10/02/2025	Electronic File	IMG_1549.HEIC

Count	Document ID	Document Date	Document Type	Title
1706	PSM.5000.0002.8304	10/02/2025	Electronic File	IMG_1550.HEIC
1707	PSM.5000.0002.8305	10/02/2025	Electronic File	IMG_1551.HEIC
1708	PSM.5000.0002.8306	10/02/2025	Electronic File	IMG_1552.HEIC
1709	PSM.5000.0002.8307	10/02/2025	Electronic File	IMG_1553.HEIC
1710	PSM.5000.0002.8308	10/02/2025	Electronic File	IMG_1554.HEIC
1711	PSM.5000.0002.8309	10/02/2025	Electronic File	IMG_1555.HEIC
1712	PSM.5000.0002.8310	10/02/2025	Electronic File	TH000418.JPG
1713	PSM.5000.0002.8311	10/02/2025	Electronic File	Address_Data_Point.cpg
1714	PSM.5000.0002.8312	10/02/2025	Electronic File	Address_Data_Point.dbf
1715	PSM.5000.0002.8313	10/02/2025	Electronic File	Address_Data_Point.prj
1716	PSM.5000.0002.8314	10/02/2025	Electronic File	Address_Data_Point.sbn
1717	PSM.5000.0002.8315	10/02/2025	Electronic File	Address_Data_Point.sbx
1718	PSM.5000.0002.8316	10/02/2025	Electronic File	Address_Data_Point.shp
1719	PSM.5000.0002.8317	10/02/2025	Electronic File	Address_Data_Point.shp.xml
1720	PSM.5000.0002.8318	10/02/2025	Electronic File	Address_Data_Point.shx
1721	PSM.5000.0002.8319	10/02/2025	Electronic File	Disclaimer.txt
1722	PSM.5000.0002.8320	10/02/2025	Electronic File	Heritage_Overlay.dbf
1723	PSM.5000.0002.8321	10/02/2025	Electronic File	Heritage_Overlay.sbn
1724	PSM.5000.0002.8322	10/02/2025	Electronic File	Heritage_Overlay.sbx
1725	PSM.5000.0002.8323	10/02/2025	Electronic File	Heritage_Overlay.shp
1726	PSM.5000.0002.8324	10/02/2025	Electronic File	Heritage_Overlay.shp.xml
1727	PSM.5000.0002.8326	10/02/2025	Electronic File	Heritage_Overlay.shx
1728	PSM.5000.0002.8327	10/02/2025	Electronic File	Landfill_Buffer.dbf
1729	PSM.5000.0002.8328	10/02/2025	Electronic File	Landfill_Buffer.sbn
1730	PSM.5000.0002.8329	10/02/2025	Electronic File	Landfill_Buffer.sbx
1731	PSM.5000.0002.8330	10/02/2025	Electronic File	Landfill_Buffer.shp
1732	PSM.5000.0002.8331	10/02/2025	Electronic File	Landfill_Buffer.shp.xml
1733	PSM.5000.0002.8332	10/02/2025	Electronic File	Landfill_Site.dbf
1734	PSM.5000.0002.8333	10/02/2025	Electronic File	Landfill_Site.shp.xml
1735	PSM.5000.0002.8335	10/02/2025	Electronic File	Parcel.dbf
1736	PSM.5000.0002.8336	10/02/2025	Electronic File	Parcel.sbn
1737	PSM.5000.0002.8337	10/02/2025	Electronic File	Parcel.sbx
1738	PSM.5000.0002.8338	10/02/2025	Electronic File	Parcel.shp
1739	PSM.5000.0002.8339	10/02/2025	Electronic File	Parcel.shp.xml
1740	PSM.5000.0002.8341	10/02/2025	Electronic File	Parcel.shx
1741	PSM.5000.0002.8342	10/02/2025	Electronic File	Pipes_-_Council.dbf
1742	PSM.5000.0002.8343	10/02/2025	Electronic File	Pipes_-_Council.sbn
1743	PSM.5000.0002.8344	10/02/2025	Electronic File	Pipes_-_Council.sbx
1744	PSM.5000.0002.8345	10/02/2025	Electronic File	Pipes_-_Council.shp
1745	PSM.5000.0002.8346	10/02/2025	Electronic File	Pipes_-_Council.shp.xml
1746	PSM.5000.0002.8348	10/02/2025	Electronic File	Pipes_-_Council.shx
1747	PSM.5000.0002.8349	10/02/2025	Electronic File	Pipes_-_Melbourne_Water.dbf
1748	PSM.5000.0002.8350	10/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp
1749	PSM.5000.0002.8351	10/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
1750	PSM.5000.0002.8353	10/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml
1751	PSM.5000.0002.8355	10/02/2025	Electronic File	Pipes_-_Vicroads.dbf
1752	PSM.5000.0002.8356	10/02/2025	Electronic File	Pipes_-_Vicroads.sbn
1753	PSM.5000.0002.8357	10/02/2025	Electronic File	Pipes_-_Vicroads.sbx
1754	PSM.5000.0002.8358	10/02/2025	Electronic File	Pipes_-_Vicroads.shp
1755	PSM.5000.0002.8359	10/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
1756	PSM.5000.0002.8361	10/02/2025	Electronic File	Pipes_-_Vicroads.shx
1757	PSM.5000.0002.8362	10/02/2025	Electronic File	Pits_-_Council.dbf
1758	PSM.5000.0002.8363	10/02/2025	Electronic File	Pits_-_Council.sbn
1759	PSM.5000.0002.8364	10/02/2025	Electronic File	Pits_-_Council.sbx
1760	PSM.5000.0002.8365	10/02/2025	Electronic File	Pits_-_Council.shp

Count	Document ID	Document Date	Document Type	Title
1761	PSM.5000.0002.8366	10/02/2025	Electronic File	Pits_-_Council.shp.xml
1762	PSM.5000.0002.8368	10/02/2025	Electronic File	Pits_-_Council.shx
1763	PSM.5000.0002.8369	10/02/2025	Electronic File	Pits_-_Melbourne_Water.dbf
1764	PSM.5000.0002.8370	10/02/2025	Electronic File	Pits_-_Melbourne_Water.shp
1765	PSM.5000.0002.8371	10/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
1766	PSM.5000.0002.8373	10/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
1767	PSM.5000.0002.8375	10/02/2025	Electronic File	Pits_-_VicRoads.dbf
1768	PSM.5000.0002.8376	10/02/2025	Electronic File	Pits_-_VicRoads.sbn
1769	PSM.5000.0002.8377	10/02/2025	Electronic File	Pits_-_VicRoads.sbx
1770	PSM.5000.0002.8378	10/02/2025	Electronic File	Pits_-_VicRoads.shp
1771	PSM.5000.0002.8379	10/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
1772	PSM.5000.0002.8381	10/02/2025	Electronic File	Pits_-_VicRoads.shx
1773	PSM.5000.0002.8382	10/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1774	PSM.5000.0002.8383	10/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
1775	PSM.5000.0002.8385	10/02/2025	Electronic File	Water_Sensitive_Urban_Design.dbf
1776	PSM.5000.0002.8386	10/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
1777	PSM.5000.0002.8388	11/02/2025	Electronic File	Lotsearch LS071302_EA - 3 Penny Lane, McCrae, VIC 3938.pdf
1778	PSM.5000.0002.8425	11/02/2025	Electronic File	10-12 View Point Rd MCCRAE - GeoTech Report - 5.12.2022.pdf
1779	PSM.5000.0002.8438	11/02/2025	Electronic File	P15_0321 - 10-12 Point View Road - vegetation removal.PDF
1780	PSM.5000.0002.8439	11/02/2025	Electronic File	P15_1503.01 - 10-12 View Point Road McCrae - dwelling
1781	PSM.5000.0002.8447	11/02/2025	Electronic File	14-16 View Point Road McCrae Eng14_0465 P13_2073 EMP
1782	PSM.5000.0002.8450	11/02/2025	Electronic File	C2242_17 - Council Report Consent for Flood Prone Land
1783	PSM.5000.0002.8453	11/02/2025	Electronic File	C2242_17 - land stability material rev_1.PDF
1784	PSM.5000.0002.8460	11/02/2025	Electronic File	P11_0170 - 14-16 Point View Road McCrae - Geotech report -
1785	PSM.5000.0002.8521	11/02/2025	Electronic File	P11_0170 - 14-16 View Point Road McCrae - Geotech report
1786	PSM.5000.0002.8525	11/02/2025	Electronic File	Addresses McCrae.xlsx
1787	PSM.5000.0002.8526	11/02/2025	Electronic File	P13_2073 - 14-16 View Point Road McCrae - Development
1788	PSM.5000.0002.8531	11/02/2025	Electronic File	P13_2073 - 14-16 View Point Road McCrae - Geotech Report
1789	PSM.5000.0002.8578	11/02/2025	Electronic File	P13_2073 - 14-16 View Point Road McCrae - Peer Review.pdf
1790	PSM.5000.0002.8580	11/02/2025	Electronic File	C1493_06 - 16 Prospect Hill Road McCrae BUILDING PERMIT
1791	PSM.5000.0002.8635	11/02/2025	Electronic File	P03_2943 - 16 Prospect Hill Road McCrae - Endorsed Plans.PDF
1792	PSM.5000.0002.8641	11/02/2025	Electronic File	Soil Report - 16 Prospect Hill Road MCCRAE.pdf
1793	PSM.5000.0002.8648	11/02/2025	Electronic File	P22_0674 - 18-20 View Point Road McCrae - Endorsed Plans.PDF
1794	PSM.5000.0002.8652	11/02/2025	Electronic File	P03_0500 - 22 View Point Road McCrae - development
1795	PSM.5000.0002.8657	11/02/2025	Electronic File	Extract of permits and planning approvals for 3 Penny Lane and
1796	PSM.5000.0002.8689	11/02/2025	Electronic File	P02_2535 - 3 Penny Lane~MCCRAE VIC 3938 __ Scanned
1797	PSM.5000.0002.8749	11/02/2025	Electronic File	P12_0666 - 3 Penny Lane McCrae - Planning Permit, Endorsed
1798	PSM.5000.0002.8760	11/02/2025	Electronic File	Planning and geotechnical documents in relation to 3 Penny
1799	PSM.5000.0002.8788	11/02/2025	Electronic File	C7476_2001 - 4 View Point Road McCrae - Subfloor building
1800	PSM.5000.0002.8792	11/02/2025	Electronic File	P00_2457 - 4 View Point Road McCrae - Dwelling plans.PDF
1801	PSM.5000.0002.8795	11/02/2025	Electronic File	P04_2662 - 4 View Point Road McCrae - Planning permit and
1802	PSM.5000.0002.8798	11/02/2025	Electronic File	P17_0980 - ENDORSED PLANS.pdf
1803	PSM.5000.0002.8806	11/02/2025	Electronic File	Soil Report - 5 Prospect Hill Road MCCRAE.pdf
1804	PSM.5000.0002.8811	11/02/2025	Electronic File	VCAT amended PERMIT notice copy.docx
1805	PSM.5000.0002.8818	11/02/2025	Electronic File	C4542_21 - Soil Reports(2)_stamped.pdf
1806	PSM.5000.0002.8868	11/02/2025	Electronic File	P18_0533 - GeoTech Report endorsed.pdf
1807	PSM.5000.0002.8903	11/02/2025	Electronic File	P18_0533.06 - 599-601 Point Nepean Road McCrae - Endorsed
1808	PSM.5000.0002.8943	11/02/2025	Electronic File	P18_0533.06 - GeoTech Letter.pdf
1809	PSM.5000.0002.8946	11/02/2025	Electronic File	C1302_04 - 6 Point View Road McCrae - BUILDING PERMIT
1810	PSM.5000.0002.8977	11/02/2025	Electronic File	p02_1833.01 - 6 View Point Road McCrae - dwelling.PDF
1811	PSM.5000.0002.8982	11/02/2025	Electronic File	P20_0578 - Endorsed Plans.PDF
1812	PSM.5000.0002.8985	11/02/2025	Electronic File	P04_1497 - 611 Point Nepean Road - Endorsed Plans
1813	PSM.5000.0002.8993	11/02/2025	Electronic File	P04_1497.01 - 611 Point Nepean Road - Endorsed Plans.PDF
1814	PSM.5000.0002.8994	11/02/2025	Electronic File	Endorsed drawings.PDF
1815	PSM.5000.0002.8999	11/02/2025	Electronic File	P20_0716 - PERMIT notice alias.docx

Count	Document ID	Document Date	Document Type	Title
1871	PSM.5000.0002.9103	11/02/2025	Electronic File	Email from Matt Glover to Dan Pope dated 10.01.2025 with
1872	PSM.5000.0002.9105	11/02/2025	Electronic File	Escarpemnt image.jpg
1873	PSM.5000.0002.9106	11/02/2025	Electronic File	Extract of The Herald newspaper 14 July 1952 in relation to
1874	PSM.5000.0002.9107	11/02/2025	Electronic File	Map of MPS site observations on 22 January 2025.pdf
1875	PSM.5000.0002.9108	11/02/2025	Electronic File	South East Water report works in Mornington Shire Council
1876	PSM.5000.0002.9111	11/02/2025	Electronic File	Email from Claudio Flores to Dane Pope dated 7.01.2025.pdf
1877	PSM.5000.0002.9112	11/02/2025	Electronic File	Email from Matt Glover to Dan Pope dated 10.01.2025
1878	PSM.5000.0002.9120	11/02/2025	Electronic File	ViewPoint Drainage design.pdf
1879	PSM.5000.0002.9121	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_083859_A TOO
1880	PSM.5000.0002.9128	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_083859_A TOO
1881	PSM.5000.0002.9130	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_090054_A TOO
1882	PSM.5000.0002.9139	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_090054_A TOO
1883	PSM.5000.0002.9143	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_102122_B TOO
1884	PSM.5000.0002.9154	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_102122_B TOO
1885	PSM.5000.0002.9157	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_104134_C TOO
1886	PSM.5000.0002.9166	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_104134_C TOO
1887	PSM.5000.0002.9169	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_114611_C TOO
1888	PSM.5000.0002.9204	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_114611_C TOO
1889	PSM.5000.0002.9209	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_132020_D TOO
1890	PSM.5000.0002.9247	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_132020_D TOO
1891	PSM.5000.0002.9255	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_135956_D TOO
1892	PSM.5000.0002.9264	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_135956_D TOO
1893	PSM.5000.0002.9270	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_141137_E TOO
1894	PSM.5000.0002.9283	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_141137_E TOO
1895	PSM.5000.0002.9299	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_142844_F TOO
1896	PSM.5000.0002.9306	11/02/2025	Electronic File	10-12 VIEW POINT ROAD MCCRAE_15.01.2025_142844_F TOO
1897	PSM.5000.0002.9313	11/02/2025	Electronic File	1175992-W-V2_report.obr
1898	PSM.5000.0002.9314	11/02/2025	Electronic File	1175992-W_report.pdf
1899	PSM.5000.0002.9320	11/02/2025	Electronic File	AR-25-NV-000603-01_Sample_202.obr
1900	PSM.5000.0002.9321	11/02/2025	Electronic File	Australian-Drinking-Water-Guidelines-6-Version-3-9.pdf
1901	PSM.5000.0003.0533	11/02/2025	Electronic File	EPA ERS Number 1.obr
1902	PSM.5000.0003.0534	11/02/2025	Electronic File	Sample Request Forms 9th January.obr
1903	PSM.5000.0003.0535	11/02/2025	Electronic File	Water sampling results with Council's notes.pdf
1904	PSM.5000.0003.0538	11/02/2025	Electronic File	IMG_1414.HEIC
1905	PSM.5000.0003.0539	11/02/2025	Electronic File	IMG_1415.HEIC
1906	PSM.5000.0003.0540	11/02/2025	Electronic File	IMG_1421.HEIC
1907	PSM.5000.0003.0541	11/02/2025	Electronic File	IMG_1422.HEIC
1908	PSM.5000.0003.0542	11/02/2025	Electronic File	IMG_1423.HEIC
1909	PSM.5000.0003.0543	11/02/2025	Electronic File	IMG_1424.HEIC
1910	PSM.5000.0003.0544	11/02/2025	Electronic File	IMG_1425.HEIC
1911	PSM.5000.0003.0545	12/02/2025	Electronic File	IMG_1438.HEIC
1912	PSM.5000.0003.0546	12/02/2025	Electronic File	IMG_1439.HEIC
1913	PSM.5000.0003.0547	12/02/2025	Electronic File	IMG_1440.HEIC
1914	PSM.5000.0003.0548	12/02/2025	Electronic File	IMG_1441.HEIC
1915	PSM.5000.0003.0549	12/02/2025	Electronic File	IMG_1442.HEIC
1916	PSM.5000.0003.0550	12/02/2025	Electronic File	IMG_1443.HEIC
1917	PSM.5000.0003.0551	12/02/2025	Electronic File	IMG_1444.HEIC
1918	PSM.5000.0003.0552	12/02/2025	Electronic File	IMG_1445.HEIC
1919	PSM.5000.0003.0553	12/02/2025	Electronic File	IMG_1446.HEIC
1920	PSM.5000.0003.0554	12/02/2025	Electronic File	IMG_1447.HEIC
1921	PSM.5000.0003.0555	12/02/2025	Electronic File	IMG_1448.HEIC
1922	PSM.5000.0003.0556	12/02/2025	Electronic File	IMG_1449.HEIC
1923	PSM.5000.0003.0557	12/02/2025	Electronic File	IMG_1450.HEIC
1924	PSM.5000.0003.0558	12/02/2025	Electronic File	IMG_1451.HEIC
1925	PSM.5000.0003.0559	12/02/2025	Electronic File	IMG_1452.HEIC

Count	Document ID	Document Date	Document Type	Title
1926	PSM.5000.0003.0560	12/02/2025	Electronic File	IMG_1453.HEIC
1927	PSM.5000.0003.0561	12/02/2025	Electronic File	IMG_1454.HEIC
1928	PSM.5000.0003.0562	12/02/2025	Electronic File	IMG_1455.HEIC
1929	PSM.5000.0003.0563	12/02/2025	Electronic File	IMG_1456.HEIC
1930	PSM.5000.0003.0564	12/02/2025	Electronic File	IMG_1457.HEIC
1931	PSM.5000.0003.0565	12/02/2025	Electronic File	IMG_1458.HEIC
1932	PSM.5000.0003.0566	12/02/2025	Electronic File	IMG_1459.HEIC
1933	PSM.5000.0003.0567	12/02/2025	Electronic File	IMG_1460.HEIC
1934	PSM.5000.0003.0568	12/02/2025	Electronic File	IMG_1461.HEIC
1935	PSM.5000.0003.0569	12/02/2025	Electronic File	IMG_1462.HEIC
1936	PSM.5000.0003.0570	12/02/2025	Electronic File	IMG_1463.HEIC
1937	PSM.5000.0003.0571	12/02/2025	Electronic File	IMG_1464.HEIC
1938	PSM.5000.0003.0572	12/02/2025	Electronic File	IMG_1465.HEIC
1939	PSM.5000.0003.0573	12/02/2025	Electronic File	IMG_1466.HEIC
1940	PSM.5000.0003.0574	12/02/2025	Electronic File	IMG_1467.HEIC
1941	PSM.5000.0003.0575	12/02/2025	Electronic File	IMG_1468.HEIC
1942	PSM.5000.0003.0576	12/02/2025	Electronic File	IMG_1469.HEIC
1943	PSM.5000.0003.0577	12/02/2025	Electronic File	IMG_1470.HEIC
1944	PSM.5000.0003.0578	12/02/2025	Electronic File	IMG_1471.HEIC
1945	PSM.5000.0003.0579	12/02/2025	Electronic File	IMG_1472.HEIC
1946	PSM.5000.0003.0580	12/02/2025	Electronic File	IMG_1473.HEIC
1947	PSM.5000.0003.0581	12/02/2025	Electronic File	IMG_1474.HEIC
1948	PSM.5000.0003.0582	12/02/2025	Electronic File	IMG_1475.HEIC
1949	PSM.5000.0003.0583	12/02/2025	Electronic File	IMG_1476.HEIC
1950	PSM.5000.0003.0584	12/02/2025	Electronic File	IMG_1574.HEIC
1951	PSM.5000.0003.0585	12/02/2025	Electronic File	IMG_1575.HEIC
1952	PSM.5000.0003.0586	12/02/2025	Electronic File	IMG_1576.HEIC
1953	PSM.5000.0003.0587	12/02/2025	Electronic File	IMG_1577.HEIC
1954	PSM.5000.0003.0588	12/02/2025	Electronic File	IMG_1578.HEIC
1955	PSM.5000.0003.0589	12/02/2025	Electronic File	IMG_1579.HEIC
1956	PSM.5000.0003.0590	12/02/2025	Electronic File	IMG_1580.HEIC
1957	PSM.5000.0003.0591	12/02/2025	Electronic File	IMG_1581.HEIC
1958	PSM.5000.0003.0592	12/02/2025	Electronic File	IMG_1582.HEIC
1959	PSM.5000.0003.0593	12/02/2025	Electronic File	IMG_1583.HEIC
1960	PSM.5000.0003.0594	12/02/2025	Electronic File	IMG_1584.HEIC
1961	PSM.5000.0003.0595	12/02/2025	Electronic File	IMG_1585.HEIC
1962	PSM.5000.0003.0596	12/02/2025	Electronic File	IMG_1586.HEIC
1963	PSM.5000.0003.0597	12/02/2025	Electronic File	IMG_1587.HEIC
1964	PSM.5000.0003.0598	12/02/2025	Electronic File	IMG_1588.HEIC
1965	PSM.5000.0003.0599	12/02/2025	Electronic File	IMG_1477.HEIC
1966	PSM.5000.0003.0600	12/02/2025	Electronic File	IMG_1478.HEIC
1967	PSM.5000.0003.0601	12/02/2025	Electronic File	IMG_1479.HEIC
1968	PSM.5000.0003.0602	12/02/2025	Electronic File	IMG_1589.MOV
1969	PSM.5000.0003.0603	12/02/2025	Electronic File	IMG_1590.HEIC
1970	PSM.5000.0003.0604	12/02/2025	Electronic File	IMG_1591.HEIC
1971	PSM.5000.0003.0605	12/02/2025	Electronic File	IMG_1592.HEIC
1972	PSM.5000.0003.0606	12/02/2025	Electronic File	IMG_1593.HEIC
1973	PSM.5000.0003.0607	12/02/2025	Electronic File	IMG_1594.HEIC
1974	PSM.5000.0003.0608	12/02/2025	Electronic File	IMG_1480.HEIC
1975	PSM.5000.0003.0609	12/02/2025	Electronic File	IMG_1481.HEIC
1976	PSM.5000.0003.0610	12/02/2025	Electronic File	IMG_1482.HEIC
1977	PSM.5000.0003.0611	12/02/2025	Electronic File	IMG_1483.HEIC
1978	PSM.5000.0003.0612	12/02/2025	Electronic File	IMG_1484.HEIC
1979	PSM.5000.0003.0613	12/02/2025	Electronic File	IMG_1485.HEIC
1980	PSM.5000.0003.0614	12/02/2025	Electronic File	IMG_1595.HEIC

Count	Document ID	Document Date	Document Type	Title
1981	PSM.5000.0003.0615	12/02/2025	Electronic File	IMG_1596.HEIC
1982	PSM.5000.0003.0616	12/02/2025	Electronic File	IMG_1597.MOV
1983	PSM.5000.0003.0617	12/02/2025	Electronic File	IMG_1598.HEIC
1984	PSM.5000.0003.0618	12/02/2025	Electronic File	IMG_1599.HEIC
1985	PSM.5000.0003.0619	12/02/2025	Electronic File	IMG_1600.HEIC
1986	PSM.5000.0003.0620	12/02/2025	Electronic File	IMG_1601.HEIC
1987	PSM.5000.0003.0621	12/02/2025	Electronic File	IMG_1486.HEIC
1988	PSM.5000.0003.0622	12/02/2025	Electronic File	IMG_1487.HEIC
1989	PSM.5000.0003.0623	12/02/2025	Electronic File	IMG_1488.HEIC
1990	PSM.5000.0003.0624	12/02/2025	Electronic File	IMG_1489.HEIC
1991	PSM.5000.0003.0625	12/02/2025	Electronic File	IMG_1490.HEIC
1992	PSM.5000.0003.0626	12/02/2025	Electronic File	IMG_1491.HEIC
1993	PSM.5000.0003.0627	12/02/2025	Electronic File	IMG_1492.HEIC
1994	PSM.5000.0003.0628	12/02/2025	Electronic File	IMG_1602.HEIC
1995	PSM.5000.0003.0629	12/02/2025	Electronic File	IMG_1603.HEIC
1996	PSM.5000.0003.0630	12/02/2025	Electronic File	IMG_1493.HEIC
1997	PSM.5000.0003.0631	12/02/2025	Electronic File	IMG_1494.HEIC
1998	PSM.5000.0003.0632	12/02/2025	Electronic File	IMG_1604.HEIC
1999	PSM.5000.0003.0633	12/02/2025	Electronic File	IMG_1496.HEIC
2000	PSM.5000.0003.0634	12/02/2025	Electronic File	IMG_1497.HEIC
2001	PSM.5000.0003.0635	12/02/2025	Electronic File	IMG_1498.HEIC
2002	PSM.5000.0003.0636	12/02/2025	Electronic File	IMG_1605.HEIC
2003	PSM.5000.0003.0637	12/02/2025	Electronic File	IMG_1606.HEIC
2004	PSM.5000.0003.0638	12/02/2025	Electronic File	IMG_1607.HEIC
2005	PSM.5000.0003.0639	12/02/2025	Electronic File	IMG_1499.HEIC
2006	PSM.5000.0003.0640	12/02/2025	Electronic File	IMG_1500.HEIC
2007	PSM.5000.0003.0641	12/02/2025	Electronic File	IMG_1501.HEIC
2008	PSM.5000.0003.0642	12/02/2025	Electronic File	IMG_1608.HEIC
2009	PSM.5000.0003.0643	12/02/2025	Electronic File	IMG_1609.HEIC
2010	PSM.5000.0003.0644	12/02/2025	Electronic File	IMG_1610.HEIC
2011	PSM.5000.0003.0645	12/02/2025	Electronic File	IMG_1611.HEIC
2012	PSM.5000.0003.0646	12/02/2025	Electronic File	IMG_1511.HEIC
2013	PSM.5000.0003.0647	12/02/2025	Electronic File	IMG_1512.HEIC
2014	PSM.5000.0003.0648	12/02/2025	Electronic File	IMG_1513.HEIC
2015	PSM.5000.0003.0649	12/02/2025	Electronic File	IMG_1514.HEIC
2016	PSM.5000.0003.0650	12/02/2025	Electronic File	IMG_1515.HEIC
2017	PSM.5000.0003.0651	12/02/2025	Electronic File	Pickup 20250211 1500 - Dropoff 20250212 1545.txt
2018	PSM.5000.0003.0652	12/02/2025	Electronic File	GH011776.MP4
2019	PSM.5000.0003.0659	12/02/2025	Electronic File	GH011778.MP4
2020	PSM.5000.0003.0665	13/02/2025	Electronic File	38637208.PDF
2021	PSM.5000.0003.0667	13/02/2025	Electronic File	ASSET 250916670.pdf
2022	PSM.5000.0003.3743	13/02/2025	Electronic File	Address_Data_Point.dbf
2023	PSM.5000.0003.3744	13/02/2025	Electronic File	Address_Data_Point.sbn
2024	PSM.5000.0003.3745	13/02/2025	Electronic File	Address_Data_Point.sbx
2025	PSM.5000.0003.3746	13/02/2025	Electronic File	Address_Data_Point.shp
2026	PSM.5000.0003.3747	13/02/2025	Electronic File	Address_Data_Point.shp.xml
2027	PSM.5000.0003.3748	13/02/2025	Electronic File	Address_Data_Point.shx
2028	PSM.5000.0003.3749	13/02/2025	Electronic File	Heritage_Overlay.dbf
2029	PSM.5000.0003.3750	13/02/2025	Electronic File	Heritage_Overlay.sbn
2030	PSM.5000.0003.3751	13/02/2025	Electronic File	Heritage_Overlay.sbx
2031	PSM.5000.0003.3752	13/02/2025	Electronic File	Heritage_Overlay.shp
2032	PSM.5000.0003.3753	13/02/2025	Electronic File	Heritage_Overlay.shp.xml
2033	PSM.5000.0003.3755	13/02/2025	Electronic File	Heritage_Overlay.shx
2034	PSM.5000.0003.3756	13/02/2025	Electronic File	Landfill_Buffer.dbf
2035	PSM.5000.0003.3757	13/02/2025	Electronic File	Landfill_Buffer.shp.xml

Count	Document ID	Document Date	Document Type	Title
2036	PSM.5000.0003.3758	13/02/2025	Electronic File	Landfill_Site.dbf
2037	PSM.5000.0003.3759	13/02/2025	Electronic File	Landfill_Site.shp.xml
2038	PSM.5000.0003.3761	13/02/2025	Electronic File	Parcel.dbf
2039	PSM.5000.0003.3762	13/02/2025	Electronic File	Parcel.sbn
2040	PSM.5000.0003.3763	13/02/2025	Electronic File	Parcel.sbx
2041	PSM.5000.0003.3764	13/02/2025	Electronic File	Parcel.shp
2042	PSM.5000.0003.3765	13/02/2025	Electronic File	Parcel.shp.xml
2043	PSM.5000.0003.3767	13/02/2025	Electronic File	Parcel.shx
2044	PSM.5000.0003.3768	13/02/2025	Electronic File	Pipes_-_Council7.dbf
2045	PSM.5000.0003.3769	13/02/2025	Electronic File	Pipes_-_Council7.sbn
2046	PSM.5000.0003.3770	13/02/2025	Electronic File	Pipes_-_Council7.sbx
2047	PSM.5000.0003.3771	13/02/2025	Electronic File	Pipes_-_Council7.shp
2048	PSM.5000.0003.3772	13/02/2025	Electronic File	Pipes_-_Council7.shp.xml
2049	PSM.5000.0003.3774	13/02/2025	Electronic File	Pipes_-_Council7.shx
2050	PSM.5000.0003.3775	13/02/2025	Electronic File	Pipes_-_Melbourne_Water.dbf
2051	PSM.5000.0003.3776	13/02/2025	Electronic File	Pipes_-_Melbourne_Water.shp.xml
2052	PSM.5000.0003.3778	13/02/2025	Electronic File	Pipes_-_Unconfirmed.dbf
2053	PSM.5000.0003.3779	13/02/2025	Electronic File	Pipes_-_Unconfirmed.sbn
2054	PSM.5000.0003.3780	13/02/2025	Electronic File	Pipes_-_Unconfirmed.sbx
2055	PSM.5000.0003.3781	13/02/2025	Electronic File	Pipes_-_Unconfirmed.shp
2056	PSM.5000.0003.3782	13/02/2025	Electronic File	Pipes_-_Unconfirmed.shp.xml
2057	PSM.5000.0003.3784	13/02/2025	Electronic File	Pipes_-_Unconfirmed.shx
2058	PSM.5000.0003.3785	13/02/2025	Electronic File	Pipes_-_Vicroads.dbf
2059	PSM.5000.0003.3786	13/02/2025	Electronic File	Pipes_-_Vicroads.sbn
2060	PSM.5000.0003.3787	13/02/2025	Electronic File	Pipes_-_Vicroads.sbx
2061	PSM.5000.0003.3788	13/02/2025	Electronic File	Pipes_-_Vicroads.shp
2062	PSM.5000.0003.3789	13/02/2025	Electronic File	Pipes_-_Vicroads.shp.xml
2063	PSM.5000.0003.3791	13/02/2025	Electronic File	Pipes_-_Vicroads.shx
2064	PSM.5000.0003.3792	13/02/2025	Electronic File	Pits_-_Council7.dbf
2065	PSM.5000.0003.3793	13/02/2025	Electronic File	Pits_-_Council7.sbn
2066	PSM.5000.0003.3794	13/02/2025	Electronic File	Pits_-_Council7.sbx
2067	PSM.5000.0003.3795	13/02/2025	Electronic File	Pits_-_Council7.shp
2068	PSM.5000.0003.3796	13/02/2025	Electronic File	Pits_-_Council7.shp.xml
2069	PSM.5000.0003.3798	13/02/2025	Electronic File	Pits_-_Council7.shx
2070	PSM.5000.0003.3799	13/02/2025	Electronic File	Pits_-_Melbourne_Water.dbf
2071	PSM.5000.0003.3800	13/02/2025	Electronic File	Pits_-_Melbourne_Water.shp.xml
2072	PSM.5000.0003.3802	13/02/2025	Electronic File	Pits_-_Unconfirmed.dbf
2073	PSM.5000.0003.3803	13/02/2025	Electronic File	Pits_-_Unconfirmed.sbn
2074	PSM.5000.0003.3804	13/02/2025	Electronic File	Pits_-_Unconfirmed.sbx
2075	PSM.5000.0003.3805	13/02/2025	Electronic File	Pits_-_Unconfirmed.shp
2076	PSM.5000.0003.3806	13/02/2025	Electronic File	Pits_-_Unconfirmed.shp.xml
2077	PSM.5000.0003.3808	13/02/2025	Electronic File	Pits_-_Unconfirmed.shx
2078	PSM.5000.0003.3809	13/02/2025	Electronic File	Pits_-_VicRoads.dbf
2079	PSM.5000.0003.3810	13/02/2025	Electronic File	Pits_-_VicRoads.sbn
2080	PSM.5000.0003.3811	13/02/2025	Electronic File	Pits_-_VicRoads.sbx
2081	PSM.5000.0003.3812	13/02/2025	Electronic File	Pits_-_VicRoads.shp
2082	PSM.5000.0003.3813	13/02/2025	Electronic File	Pits_-_VicRoads.shp.xml
2083	PSM.5000.0003.3815	13/02/2025	Electronic File	Pits_-_VicRoads.shx
2084	PSM.5000.0003.3816	13/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
2085	PSM.5000.0003.3817	13/02/2025	Electronic File	Pit_Underground_Footprint__Call_03_5950_1040_to_arrange_o
2086	PSM.5000.0003.3819	13/02/2025	Electronic File	Water_Sensitive_Urban_Design.dbf
2087	PSM.5000.0003.3820	13/02/2025	Electronic File	Water_Sensitive_Urban_Design.shp.xml
2088	PSM.5000.0003.3822	13/02/2025	Electronic File	e319n5754_melbourne_2017nov28_mpts-c2_v10cm_ahd-
2089	PSM.5000.0003.3823	13/02/2025	Electronic File	e319n5753_melbourne_2017nov28_mpts-c2_v10cm_ahd-
2090	PSM.5000.0003.3824	13/02/2025	Electronic File	e320n5753_melbourne_2017nov28_mpts-c2_v10cm_ahd-

Count	Document ID	Document Date	Document Type	Title
2091	PSM.5000.0003.3825	13/02/2025	Electronic File	e320n5754_melbourne_2017nov28_mpts-c2_v10cm_ahd-319000_5753000.copc.laz
2092	PSM.5000.0003.3826	13/02/2025	Electronic File	319000_5753000.copc.laz
2093	PSM.5000.0003.3827	13/02/2025	Electronic File	319000_5753500.copc.laz
2094	PSM.5000.0003.3828	13/02/2025	Electronic File	319500_5753000.copc.laz
2095	PSM.5000.0003.3829	13/02/2025	Electronic File	319500_5753500.copc.laz
2096	PSM.5000.0003.3830	14/02/2025	Electronic File	doc.kml
2097	PSM.5000.0003.3831	14/02/2025	Electronic File	e319n5753_melbourne_2017nov28_mpts-c2_v10cm_ahd-319000_5753000.copc.laz
2098	PSM.5000.0003.3832	14/02/2025	Electronic File	e320n5753_melbourne_2017nov28_mpts-c2_v10cm_ahd-319000_5753000.copc.laz
2099	PSM.5000.0003.3833	14/02/2025	Electronic File	e320n5754_melbourne_2017nov28_mpts-c2_v10cm_ahd-319000_5753000.copc.laz
2100	PSM.5000.0003.3834	14/02/2025	Electronic File	319000_5753000.copc.laz
2101	PSM.5000.0003.3835	14/02/2025	Electronic File	319000_5754000.copc.laz
2102	PSM.5000.0003.3836	14/02/2025	Electronic File	320000_5753000.copc.laz
2103	PSM.5000.0003.3837	14/02/2025	Electronic File	320000_5754000.copc.laz
2104	PSM.5000.0003.3838	17/02/2025	Electronic File	IMG_1623.HEIC
2105	PSM.5000.0003.3839	17/02/2025	Electronic File	IMG_1624.HEIC
2106	PSM.5000.0003.3840	17/02/2025	Electronic File	IMG_1625.HEIC
2107	PSM.5000.0003.3841	17/02/2025	Electronic File	IMG_1626.HEIC
2108	PSM.5000.0003.3842	17/02/2025	Electronic File	IMG_1627.HEIC
2109	PSM.5000.0003.3843	17/02/2025	Electronic File	IMG_1628.HEIC
2110	PSM.5000.0003.3844	17/02/2025	Electronic File	IMG_1629.HEIC
2111	PSM.5000.0003.3845	17/02/2025	Electronic File	IMG_1630.HEIC
2112	PSM.5000.0003.3846	17/02/2025	Electronic File	IMG_1631.HEIC
2113	PSM.5000.0003.3847	17/02/2025	Electronic File	IMG_1632.HEIC
2114	PSM.5000.0003.3848	17/02/2025	Electronic File	IMG_1633.HEIC
2115	PSM.5000.0003.3849	17/02/2025	Electronic File	IMG_1634.HEIC
2116	PSM.5000.0003.3850	17/02/2025	Electronic File	IMG_1635.HEIC
2117	PSM.5000.0003.3851	17/02/2025	Electronic File	IMG_1636.MOV
2118	PSM.5000.0003.3852	17/02/2025	Electronic File	IMG_1637.HEIC
2119	PSM.5000.0003.3853	17/02/2025	Electronic File	IMG_1638.HEIC
2120	PSM.5000.0003.3854	17/02/2025	Electronic File	IMG_1639.HEIC
2121	PSM.5000.0003.3855	17/02/2025	Electronic File	IMG_1640.HEIC
2122	PSM.5000.0003.3856	17/02/2025	Electronic File	IMG_1641.HEIC
2123	PSM.5000.0003.3857	17/02/2025	Electronic File	IMG_1642.HEIC
2124	PSM.5000.0003.3858	17/02/2025	Electronic File	IMG_1643.HEIC
2125	PSM.5000.0003.3859	17/02/2025	Electronic File	IMG_1644.HEIC
2126	PSM.5000.0003.3860	17/02/2025	Electronic File	IMG_1645.HEIC
2127	PSM.5000.0003.3861	17/02/2025	Electronic File	IMG_1646.HEIC
2128	PSM.5000.0003.3862	17/02/2025	Electronic File	IMG_1647.HEIC
2129	PSM.5000.0003.3863	17/02/2025	Electronic File	IMG_1648.HEIC
2130	PSM.5000.0003.3864	17/02/2025	Electronic File	IMG_1649.HEIC
2131	PSM.5000.0003.3865	17/02/2025	Electronic File	IMG_1650.HEIC
2132	PSM.5000.0003.3866	17/02/2025	Electronic File	IMG_1651.HEIC
2133	PSM.5000.0003.3867	17/02/2025	Electronic File	IMG_1652.HEIC
2134	PSM.5000.0003.3868	17/02/2025	Electronic File	IMG_1653.HEIC
2135	PSM.5000.0003.3869	17/02/2025	Electronic File	IMG_1654.HEIC
2136	PSM.5000.0003.3870	17/02/2025	Electronic File	IMG_1655.HEIC
2137	PSM.5000.0003.3871	17/02/2025	Electronic File	IMG_1656.HEIC
2138	PSM.5000.0003.3872	17/02/2025	Electronic File	IMG_1657.HEIC
2139	PSM.5000.0003.3873	17/02/2025	Electronic File	IMG_1658.HEIC
2140	PSM.5000.0003.3874	17/02/2025	Electronic File	IMG_1659.HEIC
2141	PSM.5000.0003.3875	17/02/2025	Electronic File	IMG_1660.HEIC
2142	PSM.5000.0003.3876	17/02/2025	Electronic File	IMG_1661.HEIC
2143	PSM.5000.0003.3877	17/02/2025	Electronic File	IMG_1662.HEIC
2144	PSM.5000.0003.3878	17/02/2025	Electronic File	IMG_1664.HEIC
2145	PSM.5000.0003.3879	17/02/2025	Electronic File	IMG_1665.HEIC

Count	Document ID	Document Date	Document Type	Title
2146	PSM.5000.0003.3880	17/02/2025	Electronic File	IMG_1666.HEIC
2147	PSM.5000.0003.3881	17/02/2025	Electronic File	IMG_1667.HEIC
2148	PSM.5000.0003.3882	17/02/2025	Electronic File	IMG_1668.HEIC
2149	PSM.5000.0003.3883	17/02/2025	Electronic File	IMG_1669.HEIC
2150	PSM.5000.0003.3884	17/02/2025	Electronic File	IMG_1670.HEIC
2151	PSM.5000.0003.3885	17/02/2025	Electronic File	IMG_1671.HEIC
2152	PSM.5000.0003.3886	17/02/2025	Electronic File	IMG_1672.HEIC
2153	PSM.5000.0003.3887	17/02/2025	Electronic File	IMG_1673.HEIC
2154	PSM.5000.0003.3888	17/02/2025	Electronic File	IMG_1629.HEIC
2155	PSM.5000.0003.3889	17/02/2025	Electronic File	IMG_1630.HEIC
2156	PSM.5000.0003.3890	17/02/2025	Electronic File	IMG_1631.HEIC
2157	PSM.5000.0003.3891	17/02/2025	Electronic File	IMG_1632.HEIC
2158	PSM.5000.0003.3892	17/02/2025	Electronic File	IMG_1633.HEIC
2159	PSM.5000.0003.3893	17/02/2025	Electronic File	IMG_1634.HEIC
2160	PSM.5000.0003.3894	17/02/2025	Electronic File	IMG_1635.HEIC
2161	PSM.5000.0003.3895	17/02/2025	Electronic File	IMG_1636.HEIC
2162	PSM.5000.0003.3896	17/02/2025	Electronic File	IMG_1637.HEIC
2163	PSM.5000.0003.3897	17/02/2025	Electronic File	IMG_1638.HEIC
2164	PSM.5000.0003.3898	17/02/2025	Electronic File	IMG_1639.HEIC
2165	PSM.5000.0003.3899	17/02/2025	Electronic File	IMG_1674.HEIC
2166	PSM.5000.0003.3900	17/02/2025	Electronic File	IMG_1675.HEIC
2167	PSM.5000.0003.3901	17/02/2025	Electronic File	IMG_1676.HEIC
2168	PSM.5000.0003.3902	17/02/2025	Electronic File	IMG_1677.HEIC
2169	PSM.5000.0003.3903	17/02/2025	Electronic File	IMG_1678.HEIC
2170	PSM.5000.0003.3904	17/02/2025	Electronic File	IMG_1679.HEIC
2171	PSM.5000.0003.3905	17/02/2025	Electronic File	IMG_1680.HEIC
2172	PSM.5000.0003.3906	17/02/2025	Electronic File	IMG_1682.HEIC
2173	PSM.5000.0003.3907	17/02/2025	Electronic File	IMG_1683.HEIC
2174	PSM.5000.0003.3908	17/02/2025	Electronic File	IMG_1684.HEIC
2175	PSM.5000.0003.3909	17/02/2025	Electronic File	IMG_1640.HEIC
2176	PSM.5000.0003.3910	17/02/2025	Electronic File	IMG_1641.HEIC
2177	PSM.5000.0003.3911	17/02/2025	Electronic File	IMG_1642.HEIC
2178	PSM.5000.0003.3912	17/02/2025	Electronic File	IMG_1643.HEIC
2179	PSM.5000.0003.3913	17/02/2025	Electronic File	IMG_1644.HEIC
2180	PSM.5000.0003.3914	17/02/2025	Electronic File	IMG_1645.HEIC
2181	PSM.5000.0003.3915	17/02/2025	Electronic File	IMG_1646.HEIC
2182	PSM.5000.0003.3916	17/02/2025	Electronic File	IMG_1647.HEIC
2183	PSM.5000.0003.3917	17/02/2025	Electronic File	IMG_1648.HEIC
2184	PSM.5000.0003.3918	17/02/2025	Electronic File	IMG_1649.HEIC
2185	PSM.5000.0003.3919	17/02/2025	Electronic File	IMG_1650.MOV
2186	PSM.5000.0003.3920	17/02/2025	Electronic File	IMG_1651.HEIC
2187	PSM.5000.0003.3921	17/02/2025	Electronic File	IMG_1652.HEIC
2188	PSM.5000.0003.3922	17/02/2025	Electronic File	IMG_1653.HEIC
2189	PSM.5000.0003.3923	17/02/2025	Electronic File	IMG_1654.HEIC
2190	PSM.5000.0003.3924	17/02/2025	Electronic File	IMG_1690.HEIC
2191	PSM.5000.0003.3925	17/02/2025	Electronic File	IMG_1691.HEIC
2192	PSM.5000.0003.3926	17/02/2025	Electronic File	IMG_1692.HEIC
2193	PSM.5000.0003.3927	17/02/2025	Electronic File	IMG_1693.HEIC
2194	PSM.5000.0003.3928	17/02/2025	Electronic File	IMG_1694.HEIC
2195	PSM.5000.0003.3929	17/02/2025	Electronic File	IMG_1695.HEIC
2196	PSM.5000.0003.3930	17/02/2025	Electronic File	IMG_1696.HEIC
2197	PSM.5000.0003.3931	17/02/2025	Electronic File	IMG_1697.HEIC
2198	PSM.5000.0003.3932	17/02/2025	Electronic File	IMG_1698.HEIC
2199	PSM.5000.0003.3933	17/02/2025	Electronic File	IMG_1699.HEIC
2200	PSM.5000.0003.3934	17/02/2025	Electronic File	IMG_1700.HEIC

Count	Document ID	Document Date	Document Type	Title
2201	PSM.5000.0003.3935	17/02/2025	Electronic File	IMG_1701.HEIC
2202	PSM.5000.0003.3936	17/02/2025	Electronic File	IMG_1702.HEIC
2203	PSM.5000.0003.3937	17/02/2025	Electronic File	IMG_1703.HEIC
2204	PSM.5000.0003.3938	17/02/2025	Electronic File	IMG_1704.HEIC
2205	PSM.5000.0003.3939	17/02/2025	Electronic File	IMG_1705.HEIC
2206	PSM.5000.0003.3940	17/02/2025	Electronic File	IMG_1706.HEIC
2207	PSM.5000.0003.3941	17/02/2025	Electronic File	IMG_1707.HEIC
2208	PSM.5000.0003.3942	17/02/2025	Electronic File	IMG_1708.HEIC
2209	PSM.5000.0003.3943	17/02/2025	Electronic File	IMG_1709.HEIC
2210	PSM.5000.0003.3944	17/02/2025	Electronic File	IMG_1710.HEIC
2211	PSM.5000.0003.3945	17/02/2025	Electronic File	IMG_1711.HEIC
2212	PSM.5000.0003.3946	17/02/2025	Electronic File	IMG_1712.HEIC
2213	PSM.5000.0003.3947	17/02/2025	Electronic File	IMG_1713.HEIC
2214	PSM.5000.0003.3948	17/02/2025	Electronic File	IMG_1714.HEIC
2215	PSM.5000.0003.3949	17/02/2025	Electronic File	IMG_1715.HEIC
2216	PSM.5000.0003.3950	17/02/2025	Electronic File	IMG_1716.HEIC
2217	PSM.5000.0003.3951	17/02/2025	Electronic File	IMG_1717.HEIC
2218	PSM.5000.0003.3952	17/02/2025	Electronic File	IMG_1719.HEIC
2219	PSM.5000.0003.3953	17/02/2025	Electronic File	IMG_1720.HEIC
2220	PSM.5000.0003.3954	18/02/2025	Electronic File	IMG_1721.HEIC
2221	PSM.5000.0003.3955	18/02/2025	Electronic File	IMG_1722.HEIC
2222	PSM.5000.0003.3956	18/02/2025	Electronic File	IMG_1723.HEIC
2223	PSM.5000.0003.3957	18/02/2025	Electronic File	IMG_1724.HEIC
2224	PSM.5000.0003.3958	18/02/2025	Electronic File	IMG_1725.HEIC
2225	PSM.5000.0003.3959	18/02/2025	Electronic File	IMG_1726.HEIC
2226	PSM.5000.0003.3960	18/02/2025	Electronic File	IMG_1727.HEIC
2227	PSM.5000.0003.3961	18/02/2025	Electronic File	IMG_1728.HEIC
2228	PSM.5000.0003.3962	18/02/2025	Electronic File	IMG_1729.HEIC
2229	PSM.5000.0003.3963	18/02/2025	Electronic File	IMG_1730.HEIC
2230	PSM.5000.0003.3964	18/02/2025	Electronic File	IMG_1731.HEIC
2231	PSM.5000.0003.3965	18/02/2025	Electronic File	IMG_1732.HEIC
2232	PSM.5000.0003.3966	18/02/2025	Electronic File	IMG_1733.HEIC
2233	PSM.5000.0003.3967	18/02/2025	Electronic File	IMG_1734.HEIC
2234	PSM.5000.0003.3968	18/02/2025	Electronic File	IMG_1735.HEIC
2235	PSM.5000.0003.3969	18/02/2025	Electronic File	IMG_1736.HEIC
2236	PSM.5000.0003.3970	18/02/2025	Electronic File	IMG_1737.HEIC
2237	PSM.5000.0003.3971	18/02/2025	Electronic File	IMG_1738.MOV
2238	PSM.5000.0003.3972	18/02/2025	Electronic File	IMG_1739.HEIC
2239	PSM.5000.0003.3973	18/02/2025	Electronic File	IMG_1740.MOV
2240	PSM.5000.0003.3974	18/02/2025	Electronic File	IMG_1741.HEIC
2241	PSM.5000.0003.3975	18/02/2025	Electronic File	IMG_1743.HEIC
2242	PSM.5000.0003.3976	18/02/2025	Electronic File	IMG_1744.HEIC
2243	PSM.5000.0003.3977	18/02/2025	Electronic File	IMG_1750.HEIC
2244	PSM.5000.0003.3978	18/02/2025	Electronic File	IMG_1751.HEIC
2245	PSM.5000.0003.3979	18/02/2025	Electronic File	IMG_1752.HEIC
2246	PSM.5000.0003.3980	18/02/2025	Electronic File	IMG_1753.HEIC
2247	PSM.5000.0003.3981	18/02/2025	Electronic File	IMG_1754.HEIC
2248	PSM.5000.0003.3982	18/02/2025	Electronic File	IMG_1755.HEIC
2249	PSM.5000.0003.3983	18/02/2025	Electronic File	IMG_1756.HEIC
2250	PSM.5000.0003.3984	18/02/2025	Electronic File	IMG_1757.HEIC
2251	PSM.5000.0003.3985	18/02/2025	Electronic File	IMG_1758.HEIC
2252	PSM.5000.0003.3986	18/02/2025	Electronic File	IMG_1759.HEIC
2253	PSM.5000.0003.3987	18/02/2025	Electronic File	IMG_1760.HEIC
2254	PSM.5000.0003.3988	18/02/2025	Electronic File	IMG_1761.HEIC
2255	PSM.5000.0003.3989	18/02/2025	Electronic File	IMG_1762.HEIC

Count	Document ID	Document Date	Document Type	Title
2256	PSM.5000.0003.3990	18/02/2025	Electronic File	IMG_1763.HEIC
2257	PSM.5000.0003.3991	18/02/2025	Electronic File	IMG_1764.HEIC
2258	PSM.5000.0003.3992	18/02/2025	Electronic File	IMG_1765.HEIC
2259	PSM.5000.0003.3993	18/02/2025	Electronic File	IMG_1766.HEIC
2260	PSM.5000.0003.3994	18/02/2025	Electronic File	IMG_1767.HEIC
2261	PSM.5000.0003.3995	18/02/2025	Electronic File	IMG_1768.HEIC
2262	PSM.5000.0003.3996	18/02/2025	Electronic File	IMG_1769.HEIC
2263	PSM.5000.0003.3997	18/02/2025	Electronic File	IMG_1770.HEIC
2264	PSM.5000.0003.3998	18/02/2025	Electronic File	IMG_1771.HEIC
2265	PSM.5000.0003.3999	18/02/2025	Electronic File	IMG_1772.HEIC
2266	PSM.5000.0003.4000	18/02/2025	Electronic File	IMG_1773.HEIC
2267	PSM.5000.0003.4001	18/02/2025	Electronic File	IMG_1774.HEIC
2268	PSM.5000.0003.4002	18/02/2025	Electronic File	IMG_1775.HEIC
2269	PSM.5000.0003.4003	18/02/2025	Electronic File	IMG_1776.HEIC
2270	PSM.5000.0003.4004	18/02/2025	Electronic File	IMG_1777.HEIC
2271	PSM.5000.0003.4005	18/02/2025	Electronic File	IMG_1778.HEIC
2272	PSM.5000.0003.4006	18/02/2025	Electronic File	IMG_1779.HEIC
2273	PSM.5000.0003.4007	18/02/2025	Electronic File	IMG_1780.HEIC
2274	PSM.5000.0003.4008	18/02/2025	Electronic File	IMG_1781.HEIC
2275	PSM.5000.0003.4009	18/02/2025	Electronic File	IMG_1782.HEIC
2276	PSM.5000.0003.4010	18/02/2025	Electronic File	IMG_1783.HEIC
2277	PSM.5000.0003.4011	18/02/2025	Electronic File	IMG_1785.HEIC
2278	PSM.5000.0003.4012	18/02/2025	Electronic File	IMG_1786.HEIC
2279	PSM.5000.0003.4013	18/02/2025	Electronic File	IMG_1787.HEIC
2280	PSM.5000.0003.4014	18/02/2025	Electronic File	IMG_1788.HEIC
2281	PSM.5000.0003.4015	18/02/2025	Electronic File	IMG_1789.HEIC
2282	PSM.5000.0003.4016	19/02/2025	Electronic File	IMG_1793.HEIC
2283	PSM.5000.0003.4017	19/02/2025	Electronic File	IMG_1794.HEIC
2284	PSM.5000.0003.4018	19/02/2025	Electronic File	IMG_1795.HEIC
2285	PSM.5000.0003.4019	19/02/2025	Electronic File	IMG_1796.HEIC
2286	PSM.5000.0003.4020	19/02/2025	Electronic File	IMG_1797.HEIC
2287	PSM.5000.0003.4021	19/02/2025	Electronic File	IMG_1798.HEIC
2288	PSM.5000.0003.4022	19/02/2025	Electronic File	IMG_1799.HEIC
2289	PSM.5000.0003.4023	19/02/2025	Electronic File	IMG_1800.HEIC
2290	PSM.5000.0003.4024	19/02/2025	Electronic File	IMG_1801.HEIC
2291	PSM.5000.0003.4025	19/02/2025	Electronic File	IMG_1802.HEIC
2292	PSM.5000.0003.4026	19/02/2025	Electronic File	IMG_1803.HEIC
2293	PSM.5000.0003.4027	19/02/2025	Electronic File	IMG_1804.HEIC
2294	PSM.5000.0003.4028	19/02/2025	Electronic File	IMG_1805.HEIC
2295	PSM.5000.0003.4029	19/02/2025	Electronic File	IMG_1806.HEIC
2296	PSM.5000.0003.4030	19/02/2025	Electronic File	IMG_1807.HEIC
2297	PSM.5000.0003.4031	19/02/2025	Electronic File	IMG_1808.HEIC
2298	PSM.5000.0003.4032	19/02/2025	Electronic File	IMG_1809.HEIC
2299	PSM.5000.0003.4033	19/02/2025	Electronic File	IMG_1810.HEIC
2300	PSM.5000.0003.4034	19/02/2025	Electronic File	IMG_1811.HEIC
2301	PSM.5000.0003.4035	19/02/2025	Electronic File	IMG_1812.HEIC
2302	PSM.5000.0003.4036	19/02/2025	Electronic File	240205_25010_McCrae_LargerArea_LiDAR-groundonly_7855.laz
2303	PSM.5000.0003.4037	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_Clippped_Contours50cm.dxf
2304	PSM.5000.0003.4038	19/02/2025	Electronic File	240205_25010_McCrae_Larger Area_LiDAR Vertical Accuracy
2305	PSM.5000.0003.4039	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_Clippped_DTM25cm.tif
2306	PSM.5000.0003.4043	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_Contours50cm.dxf
2307	PSM.5000.0003.4044	19/02/2025	Electronic File	IMG_1813.HEIC
2308	PSM.5000.0003.4045	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_DTM25cm.tif
2309	PSM.5000.0003.4049	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_LiDAR_7855.laz
2310	PSM.5000.0003.4050	19/02/2025	Electronic File	IMG_1814.HEIC

Count	Document ID	Document Date	Document Type	Title
2311	PSM.5000.0003.4051	19/02/2025	Electronic File	IMG_1815.HEIC
2312	PSM.5000.0003.4052	19/02/2025	Electronic File	IMG_1816.HEIC
2313	PSM.5000.0003.4053	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_TIN-simplified.dxf
2314	PSM.5000.0003.4054	19/02/2025	Electronic File	240116_25010_McCrae Landslip_LiDAR_7855.laz
2315	PSM.5000.0003.4055	19/02/2025	Electronic File	240116_25010_McCrae Landslip_TIN.dxf
2316	PSM.5000.0003.4056	19/02/2025	Electronic File	240116_25010_McCrae Landslip_LiDAR Vertical Accuracy
2317	PSM.5000.0003.4057	19/02/2025	Electronic File	240116_25010_McCrae Landslip_Photogrammetry Quality
2318	PSM.5000.0003.4065	19/02/2025	Electronic File	250116_25010_McCrae Landslip - RADAR-LargerArea_DSM25cm-DXF.dxf
2319	PSM.5000.0003.4066	19/02/2025	Electronic File	250116_25010_McCrae Landslip - RADAR_DSM25cm-DXF.dxf
2320	PSM.5000.0003.4067	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Contours50cm.dxf
2321	PSM.5000.0003.4068	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Ortho1cm.ecw
2322	PSM.5000.0003.4069	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Ortho1cm_Low.ecw
2323	PSM.5000.0003.4070	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Ortho2cm.ecw
2324	PSM.5000.0003.4071	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Watershed.dxf
2325	PSM.5000.0003.4072	19/02/2025	Electronic File	IMG_1817.HEIC
2326	PSM.5000.0003.4073	19/02/2025	Electronic File	IMG_1818.HEIC
2327	PSM.5000.0003.4074	19/02/2025	Electronic File	IMG_1819.HEIC
2328	PSM.5000.0003.4075	19/02/2025	Electronic File	IMG_1821.HEIC
2329	PSM.5000.0003.4076	19/02/2025	Electronic File	IMG_1822.HEIC
2330	PSM.5000.0003.4077	19/02/2025	Electronic File	IMG_1823.HEIC
2331	PSM.5000.0003.4078	19/02/2025	Electronic File	IMG_1828.HEIC
2332	PSM.5000.0003.4079	19/02/2025	Electronic File	IMG_1829.HEIC
2333	PSM.5000.0003.4080	19/02/2025	Electronic File	IMG_1830.HEIC
2334	PSM.5000.0003.4081	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Survey_Sheets.pdf
2335	PSM.5000.0003.4085	19/02/2025	Electronic File	240116_25010_McCrae Landslip_Render_01.jpg
2336	PSM.5000.0003.4086	19/02/2025	Electronic File	240116_25010_McCrae Landslip_Render_02.jpg
2337	PSM.5000.0003.4087	19/02/2025	Electronic File	240116_25010_McCrae Landslip_Render_03.jpg
2338	PSM.5000.0003.4088	19/02/2025	Electronic File	240116_25010_McCrae Landslip_Render_04.jpg
2339	PSM.5000.0003.4089	19/02/2025	Electronic File	240116_25010_McCrae Landslip_Render_05.jpg
2340	PSM.5000.0003.4090	19/02/2025	Electronic File	250205_25010_McCrae_LargerArea_DTM Render.jpg
2341	PSM.5000.0003.4091	19/02/2025	Electronic File	DJI_20250116141949_0167_V.JPG
2342	PSM.5000.0003.4092	19/02/2025	Electronic File	DJI_20250116142040_0177_V.JPG
2343	PSM.5000.0003.4093	19/02/2025	Electronic File	DJI_20250116142110_0192_V.JPG
2344	PSM.5000.0003.4094	19/02/2025	Electronic File	DJI_20250116145154_0001_V.JPG
2345	PSM.5000.0003.4095	19/02/2025	Electronic File	DJI_20250116145200_0002_V.JPG
2346	PSM.5000.0003.4096	19/02/2025	Electronic File	DJI_20250116145207_0003_V.JPG
2347	PSM.5000.0003.4097	19/02/2025	Electronic File	DJI_20250116145214_0004_V.JPG
2348	PSM.5000.0003.4098	19/02/2025	Electronic File	DJI_20250116145221_0005_V.JPG
2349	PSM.5000.0003.4099	19/02/2025	Electronic File	DJI_20250116145229_0006_V.JPG
2350	PSM.5000.0003.4100	19/02/2025	Electronic File	DJI_20250116145242_0007_V.JPG
2351	PSM.5000.0003.4101	19/02/2025	Electronic File	DJI_20250116145248_0008_V.JPG
2352	PSM.5000.0003.4102	19/02/2025	Electronic File	DJI_20250116145259_0009_V.JPG
2353	PSM.5000.0003.4103	19/02/2025	Electronic File	DJI_20250116145306_0010_V.JPG
2354	PSM.5000.0003.4104	19/02/2025	Electronic File	DJI_20250116145311_0011_V.JPG
2355	PSM.5000.0003.4105	19/02/2025	Electronic File	DJI_20250116145327_0012_V.JPG
2356	PSM.5000.0003.4106	19/02/2025	Electronic File	DJI_20250116145338_0013_V.JPG
2357	PSM.5000.0003.4107	19/02/2025	Electronic File	DJI_20250116145342_0014_V.JPG
2358	PSM.5000.0003.4108	19/02/2025	Electronic File	DJI_20250116145414_0015_V.JPG
2359	PSM.5000.0003.4109	19/02/2025	Electronic File	DJI_20250116145422_0016_V.JPG
2360	PSM.5000.0003.4110	19/02/2025	Electronic File	DJI_20250116145431_0017_V.JPG
2361	PSM.5000.0003.4111	19/02/2025	Electronic File	DJI_20250116145448_0018_V.JPG
2362	PSM.5000.0003.4112	19/02/2025	Electronic File	DJI_20250116150333_0022_V.JPG
2363	PSM.5000.0003.4113	19/02/2025	Electronic File	DJI_20250116150342_0023_V.JPG
2364	PSM.5000.0003.4114	19/02/2025	Electronic File	DJI_20250116150951_0027_V.JPG
2365	PSM.5000.0003.4115	19/02/2025	Electronic File	DJI_20250116150956_0028_V.JPG

Count	Document ID	Document Date	Document Type	Title
2366	PSM.5000.0003.4116	19/02/2025	Electronic File	DJI_20250116151004_0029_V.JPG
2367	PSM.5000.0003.4117	19/02/2025	Electronic File	DJI_20250116145514_0019_V.MP4
2368	PSM.5000.0003.4124	19/02/2025	Electronic File	DJI_20250116145514_0019_V.SRT
2369	PSM.5000.0003.4812	19/02/2025	Electronic File	IMG_1831.HEIC
2370	PSM.5000.0003.4813	19/02/2025	Electronic File	IMG_1832.HEIC
2371	PSM.5000.0003.4814	19/02/2025	Electronic File	IMG_1833.HEIC
2372	PSM.5000.0003.4815	19/02/2025	Electronic File	IMG_1834.HEIC
2373	PSM.5000.0003.4816	19/02/2025	Electronic File	IMG_1835.HEIC
2374	PSM.5000.0003.4817	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Monitoring_System_Location.pdf
2375	PSM.5000.0003.4819	19/02/2025	Electronic File	250219_25010_Kurloo Locations.csv
2376	PSM.5000.0003.4820	19/02/2025	Electronic File	250219_25010_Kurloo_GNSS_Locations.kml
2377	PSM.5000.0003.4821	19/02/2025	Electronic File	250213_25010_McCrae Survey Control Local MGA.CSV
2378	PSM.5000.0003.4822	19/02/2025	Electronic File	250213_25010_McCrae Survey Control Local MGA.kml
2379	PSM.5000.0003.4823	19/02/2025	Electronic File	250213_25010_McCrae_Prisms_Locations.csv
2380	PSM.5000.0003.4824	19/02/2025	Electronic File	250219_25010_Prism_Locations.kml
2381	PSM.5000.0003.4825	19/02/2025	Electronic File	250219_25010_WiSen Tilt Sensor Locations.csv
2382	PSM.5000.0003.4826	19/02/2025	Electronic File	250219_25010_WiSen Tilt Sensor Locations.jpg
2383	PSM.5000.0003.4827	19/02/2025	Electronic File	250219_25010_WiSen Tilt Sensor Locations.kml
2384	PSM.5000.0003.4828	19/02/2025	Electronic File	IMG_1836.HEIC
2385	PSM.5000.0003.4829	19/02/2025	Electronic File	IMG_1837.HEIC
2386	PSM.5000.0003.4830	19/02/2025	Electronic File	240218_25010_McCrae Landslip_Larger Area LiDAR Survey Report.pdf
2387	PSM.5000.0003.4836	19/02/2025	Electronic File	McCrae feature survey.pdf
2388	PSM.5000.0003.4837	19/02/2025	Electronic File	IMG_1838.HEIC
2389	PSM.5000.0003.4838	19/02/2025	Electronic File	IMG_1839.HEIC
2390	PSM.5000.0003.4839	19/02/2025	Electronic File	IMG_1840.HEIC
2391	PSM.5000.0003.4840	19/02/2025	Electronic File	IMG_1841.HEIC
2392	PSM.5000.0003.4841	19/02/2025	Electronic File	IMG_1842.HEIC
2393	PSM.5000.0003.4842	19/02/2025	Electronic File	IMG_1843.HEIC
2394	PSM.5000.0003.4843	19/02/2025	Electronic File	IMG_1844.HEIC
2395	PSM.5000.0003.4844	19/02/2025	Electronic File	IMG_1845.HEIC
2396	PSM.5000.0003.4845	19/02/2025	Electronic File	IMG_1846.HEIC
2397	PSM.5000.0003.4846	19/02/2025	Electronic File	IMG_1847.HEIC
2398	PSM.5000.0003.4847	19/02/2025	Electronic File	IMG_1848.HEIC
2399	PSM.5000.0003.4848	19/02/2025	Electronic File	IMG_1849.HEIC
2400	PSM.5000.0003.4849	19/02/2025	Electronic File	IMG_1850.HEIC
2401	PSM.5000.0003.4850	19/02/2025	Electronic File	IMG_1851.HEIC
2402	PSM.5000.0003.4851	19/02/2025	Electronic File	IMG_1852.HEIC
2403	PSM.5000.0003.4852	19/02/2025	Electronic File	IMG_1853.HEIC
2404	PSM.5000.0003.4853	19/02/2025	Electronic File	IMG_1855.HEIC
2405	PSM.5000.0003.4854	19/02/2025	Electronic File	IMG_1856.HEIC
2406	PSM.5000.0003.4855	19/02/2025	Electronic File	IMG_1857.HEIC
2407	PSM.5000.0003.4856	19/02/2025	Electronic File	IMG_1858.HEIC
2408	PSM.5000.0003.4857	19/02/2025	Electronic File	IMG_1859.HEIC
2409	PSM.5000.0003.4858	19/02/2025	Electronic File	IMG_1860.HEIC
2410	PSM.5000.0003.4859	19/02/2025	Electronic File	IMG_1862.HEIC
2411	PSM.5000.0003.4860	19/02/2025	Electronic File	IMG_1863.HEIC
2412	PSM.5000.0003.4861	19/02/2025	Electronic File	IMG_1864.HEIC
2413	PSM.5000.0003.4862	19/02/2025	Electronic File	IMG_1865.HEIC
2414	PSM.5000.0003.4863	19/02/2025	Electronic File	319000_5753000.las
2415	PSM.5000.0003.4864	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Monitoring_System.dwg
2416	PSM.5000.0003.4865	19/02/2025	Electronic File	250116_25010_McCrae Landslip_Monitoring_System.txt
2417	PSM.5000.0003.4869	19/02/2025	Electronic File	IMG_2672.HEIC
2418	PSM.5000.0003.4870	19/02/2025	Electronic File	IMG_2660.HEIC
2419	PSM.5000.0003.4871	19/02/2025	Electronic File	IMG_2661.HEIC
2420	PSM.5000.0003.4872	19/02/2025	Electronic File	IMG_2662.HEIC

Count	Document ID	Document Date	Document Type	Title
2421	PSM.5000.0003.4873	19/02/2025	Electronic File	IMG_2663.HEIC
2422	PSM.5000.0003.4874	19/02/2025	Electronic File	IMG_2664.HEIC
2423	PSM.5000.0003.4875	19/02/2025	Electronic File	IMG_2666.HEIC
2424	PSM.5000.0003.4876	19/02/2025	Electronic File	IMG_2667.HEIC
2425	PSM.5000.0003.4877	19/02/2025	Electronic File	IMG_2668.HEIC
2426	PSM.5000.0003.4878	19/02/2025	Electronic File	IMG_2670.HEIC
2427	PSM.5000.0003.4879	19/02/2025	Electronic File	IMG_2673.HEIC
2428	PSM.5000.0003.4880	19/02/2025	Electronic File	IMG_2674.HEIC
2429	PSM.5000.0003.4881	19/02/2025	Electronic File	IMG_2683.HEIC
2430	PSM.5000.0003.4882	19/02/2025	Electronic File	IMG_2684.HEIC
2431	PSM.5000.0003.4883	19/02/2025	Electronic File	IMG_2685.HEIC
2432	PSM.5000.0003.4884	19/02/2025	Electronic File	IMG_2686.HEIC
2433	PSM.5000.0003.4885	19/02/2025	Electronic File	IMG_2687.HEIC
2434	PSM.5000.0003.4886	19/02/2025	Electronic File	IMG_2688.HEIC
2435	PSM.5000.0003.4887	20/02/2025	Electronic File	DJI_20250116150138_0021_V.MP4
2436	PSM.5000.0003.4893	20/02/2025	Electronic File	DJI_20250116150401_0024_V.MP4
2437	PSM.5000.0003.4897	20/02/2025	Electronic File	DJI_20250116150546_0025_V.MP4
2438	PSM.5000.0003.4905	20/02/2025	Electronic File	DJI_20250116150800_0026_V.MP4
2439	PSM.5000.0003.4911	20/02/2025	Electronic File	DJI_20250116151020_0030_V.MP4
2440	PSM.5000.0003.4915	20/02/2025	Electronic File	IMG_1867.HEIC
2441	PSM.5000.0003.4916	20/02/2025	Electronic File	IMG_1868.HEIC
2442	PSM.5000.0003.4917	20/02/2025	Electronic File	IMG_1869.HEIC
2443	PSM.5000.0003.4918	20/02/2025	Electronic File	IMG_1870.HEIC
2444	PSM.5000.0003.4919	20/02/2025	Electronic File	IMG_1871.HEIC
2445	PSM.5000.0003.4920	20/02/2025	Electronic File	IMG_1872.HEIC
2446	PSM.5000.0003.4921	20/02/2025	Electronic File	IMG_1873.HEIC
2447	PSM.5000.0003.4922	20/02/2025	Electronic File	IMG_1874.HEIC
2448	PSM.5000.0003.4923	20/02/2025	Electronic File	IMG_1876.HEIC
2449	PSM.5000.0003.4924	20/02/2025	Electronic File	DJI_20250116145735_0020_V.MP4
2450	PSM.5000.0003.4933	20/02/2025	Electronic File	DJI_20250116145735_0020_V.SRT
2451	PSM.5000.0003.6375	20/02/2025	Electronic File	DJI_20250116150138_0021_V.SRT
2452	PSM.5000.0003.7003	20/02/2025	Electronic File	DJI_20250116150401_0024_V.SRT
2453	PSM.5000.0003.7390	20/02/2025	Electronic File	DJI_20250116150546_0025_V.SRT
2454	PSM.5000.0003.8205	20/02/2025	Electronic File	DJI_20250116150800_0026_V.SRT
2455	PSM.5000.0003.8769	20/02/2025	Electronic File	DJI_20250116151020_0030_V.SRT
2456	PSM.5000.0003.8866	20/02/2025	Electronic File	38593257.PDF
2457	PSM.5000.0003.8868	20/02/2025	Electronic File	DBYD cover letter (A9941786) 250655557.pdf
2458	PSM.5000.0003.8869	20/02/2025	Electronic File	Response Body.html
2459	PSM.5000.0003.8870	20/02/2025	Electronic File	Tree Protection Brochure 250655557.pdf
2460	PSM.5000.0003.8871	20/02/2025	Electronic File	250655558 - Optus Plan.pdf
2461	PSM.5000.0003.8872	20/02/2025	Electronic File	250655558 - Optus Response Letter.pdf
2462	PSM.5000.0003.8884	20/02/2025	Electronic File	250655561.pdf
2463	PSM.5000.0003.8896	20/02/2025	Electronic File	Response Body.html
2464	PSM.5000.0003.8897	20/02/2025	Electronic File	250655560_20250207_025446789366_1.pdf
2465	PSM.5000.0003.8901	20/02/2025	Electronic File	250655560_20250207_025446789366_pwc_1.pdf
2466	PSM.5000.0003.8905	20/02/2025	Electronic File	Disclaimer_250655560_20250207_025446789366.pdf
2467	PSM.5000.0003.8909	20/02/2025	Electronic File	AssetInfoOutput_48572204_05B14775-910A-4F2C-BF4D-250655563_1.pdf
2468	PSM.5000.0003.8914	20/02/2025	Electronic File	Mail Body.html
2469	PSM.5000.0003.8916	20/02/2025	Electronic File	250655559.pdf
2470	PSM.5000.0003.8922	20/02/2025	Electronic File	Response Body.html
2471	PSM.5000.0003.8923	20/02/2025	Electronic File	250655563 - United Energy Response letter.pdf
2472	PSM.5000.0003.8926	20/02/2025	Electronic File	250655563 - United Energy Response Plan.pdf
2473	PSM.5000.0003.8929	20/02/2025	Electronic File	Mail Body.html
2474	PSM.5000.0003.8930	20/02/2025	Electronic File	UE5-06-10210.TIF
2475	PSM.5000.0003.8931	20/02/2025	Electronic File	UE5-06-13580.TIF

Count	Document ID	Document Date	Document Type	Title
2476	PSM.5000.0003.8932	20/02/2025	Electronic File	UE5-06-13878.TIF
2477	PSM.5000.0003.8933	20/02/2025	Electronic File	UE5-06-14634.TIF
2478	PSM.5000.0003.8934	20/02/2025	Electronic File	UE5-06-3755.TIF
2479	PSM.5000.0003.8935	20/02/2025	Electronic File	UE5-06-5994.TIF
2480	PSM.5000.0003.8936	20/02/2025	Electronic File	UE5-06-6915.TIF
2481	PSM.5000.0003.8937	20/02/2025	Electronic File	UE5-06-7402.TIF
2482	PSM.5000.0003.8938	20/02/2025	Electronic File	UE5-07-28672.pdf
2483	PSM.5000.0003.8939	20/02/2025	Electronic File	250655564.pdf
2484	PSM.5000.0003.8941	20/02/2025	Electronic File	Mail Body.html
2485	PSM.5000.0003.8942	20/02/2025	Electronic File	UE5-07-35197.pdf
2486	PSM.5000.0003.8943	20/02/2025	Electronic File	UE5-07-36078.pdf
2487	PSM.5000.0003.8944	20/02/2025	Electronic File	UE5-07-49536.pdf
2488	PSM.5000.0003.8945	20/02/2025	Electronic File	UE5-07-50069.pdf
2489	PSM.5000.0003.8946	20/02/2025	Electronic File	UE5-11-2198.TIF
2490	PSM.5000.0003.8947	20/02/2025	Electronic File	UE5-17-485492.pdf
2491	PSM.5000.0003.8948	20/02/2025	Electronic File	UE5-19-138325.pdf
2492	PSM.5000.0003.8949	20/02/2025	Electronic File	UE5-20-1068.TIF
2493	PSM.5000.0003.8950	20/02/2025	Electronic File	UE5-20-2733.PDF
2494	PSM.5000.0003.8951	20/02/2025	Electronic File	UE5-20-906.TIF
2495	PSM.5000.0003.8952	20/02/2025	Electronic File	UE5-23-425197.pdf
2496	PSM.5000.0003.8953	20/02/2025	Electronic File	UE5-24-579901.pdf
2497	PSM.5000.0003.8954	20/02/2025	Electronic File	UE5-PRV-10553.pdf
2498	PSM.5000.0003.8955	20/02/2025	Electronic File	IMG_1877.HEIC
2499	PSM.5000.0003.8956	20/02/2025	Electronic File	IMG_1878.HEIC
2500	PSM.5000.0003.8957	20/02/2025	Electronic File	IMG_1879.HEIC
2501	PSM.5000.0003.8958	20/02/2025	Electronic File	IMG_1880.HEIC
2502	PSM.5000.0003.8959	20/02/2025	Electronic File	IMG_1882.HEIC
2503	PSM.5000.0003.8960	20/02/2025	Electronic File	IMG_1883.HEIC
2504	PSM.5000.0003.8961	20/02/2025	Electronic File	IMG_1884.HEIC
2505	PSM.5000.0003.8962	20/02/2025	Electronic File	IMG_1885.HEIC
2506	PSM.5000.0003.8963	20/02/2025	Electronic File	IMG_1887.HEIC
2507	PSM.5000.0003.8964	20/02/2025	Electronic File	IMG_1888.HEIC
2508	PSM.5000.0003.8965	20/02/2025	Electronic File	IMG_1889.HEIC
2509	PSM.5000.0003.8966	20/02/2025	Electronic File	IMG_1890.HEIC
2510	PSM.5000.0003.8967	20/02/2025	Electronic File	IMG_1891.HEIC
2511	PSM.5000.0003.8968	20/02/2025	Electronic File	IMG_1892.HEIC
2512	PSM.5000.0003.8969	20/02/2025	Electronic File	IMG_1893.HEIC
2513	PSM.5000.0003.8970	20/02/2025	Electronic File	IMG_1894.HEIC
2514	PSM.5000.0003.8971	20/02/2025	Electronic File	IMG_1895.HEIC
2515	PSM.5000.0003.8972	20/02/2025	Electronic File	IMG_1896.HEIC
2516	PSM.5000.0003.8973	20/02/2025	Electronic File	IMG_1897.HEIC
2517	PSM.5000.0003.8974	20/02/2025	Electronic File	IMG_1898.HEIC
2518	PSM.5000.0003.8975	20/02/2025	Electronic File	IMG_1900.HEIC
2519	PSM.5000.0003.8976	20/02/2025	Electronic File	IMG_1901.HEIC
2520	PSM.5000.0003.8977	20/02/2025	Electronic File	IMG_1902.HEIC
2521	PSM.5000.0003.8978	20/02/2025	Electronic File	IMG_1903.HEIC
2522	PSM.5000.0003.8979	20/02/2025	Electronic File	IMG_1904.HEIC
2523	PSM.5000.0003.8980	20/02/2025	Electronic File	IMG_1905.HEIC
2524	PSM.5000.0003.8981	20/02/2025	Electronic File	IMG_1906.HEIC
2525	PSM.5000.0003.8982	20/02/2025	Electronic File	IMG_1907.HEIC
2526	PSM.5000.0003.8983	20/02/2025	Electronic File	IMG_1908.HEIC
2527	PSM.5000.0003.8984	20/02/2025	Electronic File	IMG_1909.HEIC
2528	PSM.5000.0003.8985	20/02/2025	Electronic File	IMG_1910.HEIC
2529	PSM.5000.0003.8986	20/02/2025	Electronic File	IMG_1911.HEIC
2530	PSM.5000.0003.8987	20/02/2025	Electronic File	IMG_1912.HEIC

Count	Document ID	Document Date	Document Type	Title
2531	PSM.5000.0003.8988	20/02/2025	Electronic File	IMG_1913.HEIC
2532	PSM.5000.0003.8989	20/02/2025	Electronic File	IMG_1914.HEIC
2533	PSM.5000.0003.8990	20/02/2025	Electronic File	IMG_1915.HEIC
2534	PSM.5000.0003.8991	20/02/2025	Electronic File	IMG_1916.HEIC
2535	PSM.5000.0003.8992	21/02/2025	Electronic File	IMG_2692.HEIC
2536	PSM.5000.0003.8993	21/02/2025	Electronic File	IMG_2699.HEIC
2537	PSM.5000.0003.8994	21/02/2025	Electronic File	IMG_2700.HEIC
2538	PSM.5000.0003.8995	21/02/2025	Electronic File	IMG_2708.HEIC
2539	PSM.5000.0003.8996	21/02/2025	Electronic File	IMG_2711.HEIC
2540	PSM.5000.0003.8997	21/02/2025	Electronic File	IMG_2719.HEIC
2541	PSM.5000.0003.8998	21/02/2025	Electronic File	IMG_2753.HEIC
2542	PSM.5000.0003.8999	21/02/2025	Electronic File	IMG_2754.HEIC
2543	PSM.5000.0003.9000	21/02/2025	Electronic File	IMG_2762.JPG
2544	PSM.5000.0003.9001	21/02/2025	Electronic File	IMG_2766.HEIC
2545	PSM.5000.0003.9002	21/02/2025	Electronic File	IMG_2769.HEIC
2546	PSM.5000.0003.9003	21/02/2025	Electronic File	IMG_2772.HEIC
2547	PSM.5000.0003.9004	21/02/2025	Electronic File	IMG_2778.HEIC
2548	PSM.5000.0003.9005	21/02/2025	Electronic File	IMG_2784.HEIC
2549	PSM.5000.0003.9006	21/02/2025	Electronic File	IMG_2789.HEIC
2550	PSM.5000.0003.9007	21/02/2025	Electronic File	IMG_2796.HEIC
2551	PSM.5000.0003.9008	21/02/2025	Electronic File	IMG_2799.HEIC
2552	PSM.5000.0003.9009	21/02/2025	Electronic File	IMG_2800.HEIC
2553	PSM.5000.0003.9010	21/02/2025	Electronic File	IMG_2722.HEIC
2554	PSM.5000.0003.9011	21/02/2025	Electronic File	IMG_2723.HEIC
2555	PSM.5000.0003.9012	21/02/2025	Electronic File	IMG_2727.HEIC
2556	PSM.5000.0003.9013	21/02/2025	Electronic File	IMG_2729.HEIC
2557	PSM.5000.0003.9014	21/02/2025	Electronic File	IMG_2730.HEIC
2558	PSM.5000.0003.9015	21/02/2025	Electronic File	IMG_2735.HEIC
2559	PSM.5000.0003.9016	21/02/2025	Electronic File	IMG_2738.HEIC
2560	PSM.5000.0003.9017	21/02/2025	Electronic File	IMG_2741.HEIC
2561	PSM.5000.0003.9018	21/02/2025	Electronic File	IMG_2743.HEIC
2562	PSM.5000.0003.9019	21/02/2025	Electronic File	IMG_2744.HEIC
2563	PSM.5000.0003.9020	21/02/2025	Electronic File	IMG_2745.HEIC
2564	PSM.5000.0003.9021	21/02/2025	Electronic File	IMG_2746.HEIC
2565	PSM.5000.0003.9022	21/02/2025	Electronic File	IMG_2747.HEIC
2566	PSM.5000.0003.9023	21/02/2025	Electronic File	IMG_2748.HEIC
2567	PSM.5000.0003.9024	21/02/2025	Electronic File	IMG_2750.HEIC
2568	PSM.5000.0003.9025	21/02/2025	Electronic File	IMG_2751.HEIC
2569	PSM.5000.0003.9026	21/02/2025	Electronic File	IMG_2752.HEIC
2570	PSM.5000.0003.9027	21/02/2025	Electronic File	IMG_2758.HEIC
2571	PSM.5000.0003.9028	21/02/2025	Electronic File	IMG_2763.HEIC
2572	PSM.5000.0003.9029	21/02/2025	Electronic File	IMG_2768.HEIC
2573	PSM.5000.0003.9030	21/02/2025	Electronic File	IMG_2776.HEIC
2574	PSM.5000.0003.9031	21/02/2025	Electronic File	IMG_2782.HEIC
2575	PSM.5000.0003.9032	21/02/2025	Electronic File	IMG_2791.HEIC
2576	PSM.5000.0003.9033	21/02/2025	Electronic File	IMG_2794.HEIC
2577	PSM.5000.0003.9034	21/02/2025	Electronic File	IMG_2795.HEIC
2578	PSM.5000.0003.9035	21/02/2025	Electronic File	IMG_2803.HEIC
2579	PSM.5000.0003.9036	21/02/2025	Electronic File	IMG_2805.HEIC
2580	PSM.5000.0003.9037	21/02/2025	Electronic File	IMG_2721.HEIC
2581	PSM.5000.0003.9038	21/02/2025	Electronic File	IMG_2725.HEIC
2582	PSM.5000.0003.9039	21/02/2025	Electronic File	IMG_2726.HEIC
2583	PSM.5000.0003.9040	21/02/2025	Electronic File	IMG_2734.HEIC
2584	PSM.5000.0003.9041	21/02/2025	Electronic File	IMG_2749.HEIC
2585	PSM.5000.0003.9042	21/02/2025	Electronic File	IMG_1925.HEIC

Count	Document ID	Document Date	Document Type	Title
2586	PSM.5000.0003.9043	21/02/2025	Electronic File	IMG_1926.HEIC
2587	PSM.5000.0003.9044	21/02/2025	Electronic File	IMG_1927.HEIC
2588	PSM.5000.0003.9045	21/02/2025	Electronic File	IMG_1928.HEIC
2589	PSM.5000.0003.9046	21/02/2025	Electronic File	IMG_1929.HEIC
2590	PSM.5000.0003.9047	21/02/2025	Electronic File	IMG_1930.HEIC
2591	PSM.5000.0003.9048	21/02/2025	Electronic File	IMG_1931.HEIC
2592	PSM.5000.0003.9049	21/02/2025	Electronic File	IMG_1932.HEIC
2593	PSM.5000.0003.9050	21/02/2025	Electronic File	IMG_1933.HEIC
2594	PSM.5000.0003.9051	21/02/2025	Electronic File	IMG_1665.HEIC
2595	PSM.5000.0003.9052	21/02/2025	Electronic File	IMG_1666.HEIC
2596	PSM.5000.0003.9053	21/02/2025	Electronic File	IMG_1667.MOV
2597	PSM.5000.0003.9054	21/02/2025	Electronic File	IMG_1934.HEIC
2598	PSM.5000.0003.9055	21/02/2025	Electronic File	IMG_1935.HEIC
2599	PSM.5000.0003.9056	21/02/2025	Electronic File	IMG_1936.HEIC
2600	PSM.5000.0003.9057	21/02/2025	Electronic File	IMG_1668.HEIC
2601	PSM.5000.0003.9058	21/02/2025	Electronic File	IMG_1669.HEIC
2602	PSM.5000.0003.9059	21/02/2025	Electronic File	IMG_1670.MOV
2603	PSM.5000.0003.9060	21/02/2025	Electronic File	IMG_1671.HEIC
2604	PSM.5000.0003.9061	21/02/2025	Electronic File	IMG_1672.HEIC
2605	PSM.5000.0003.9062	21/02/2025	Electronic File	IMG_1673.HEIC
2606	PSM.5000.0003.9063	21/02/2025	Electronic File	IMG_1674.HEIC
2607	PSM.5000.0003.9064	21/02/2025	Electronic File	IMG_1675.HEIC
2608	PSM.5000.0003.9065	21/02/2025	Electronic File	IMG_1676.HEIC
2609	PSM.5000.0003.9066	21/02/2025	Electronic File	IMG_1677.HEIC
2610	PSM.5000.0003.9067	21/02/2025	Electronic File	IMG_1678.HEIC
2611	PSM.5000.0003.9068	21/02/2025	Electronic File	IMG_1679.HEIC
2612	PSM.5000.0003.9069	21/02/2025	Electronic File	IMG_1680.MOV
2613	PSM.5000.0003.9070	21/02/2025	Electronic File	IMG_1681.MOV
2614	PSM.5000.0003.9071	21/02/2025	Electronic File	IMG_1682.HEIC
2615	PSM.5000.0003.9072	21/02/2025	Electronic File	IMG_1683.HEIC
2616	PSM.5000.0003.9073	21/02/2025	Electronic File	IMG_1684.HEIC
2617	PSM.5000.0003.9074	21/02/2025	Electronic File	IMG_1685.HEIC
2618	PSM.5000.0003.9075	21/02/2025	Electronic File	IMG_1686.HEIC
2619	PSM.5000.0003.9076	21/02/2025	Electronic File	IMG_1687.HEIC
2620	PSM.5000.0003.9077	21/02/2025	Electronic File	IMG_1688.HEIC
2621	PSM.5000.0003.9078	21/02/2025	Electronic File	IMG_1689.MOV
2622	PSM.5000.0003.9079	21/02/2025	Electronic File	IMG_1690.HEIC
2623	PSM.5000.0003.9080	21/02/2025	Electronic File	IMG_1691.HEIC
2624	PSM.5000.0003.9081	21/02/2025	Electronic File	IMG_1692.HEIC
2625	PSM.5000.0003.9082	21/02/2025	Electronic File	IMG_1693.HEIC
2626	PSM.5000.0003.9083	21/02/2025	Electronic File	IMG_1694.MOV
2627	PSM.5000.0003.9084	21/02/2025	Electronic File	IMG_1695.HEIC
2628	PSM.5000.0003.9085	21/02/2025	Electronic File	IMG_1696.MOV
2629	PSM.5000.0003.9086	21/02/2025	Electronic File	IMG_1697.HEIC
2630	PSM.5000.0003.9087	21/02/2025	Electronic File	IMG_1698.HEIC
2631	PSM.5000.0003.9088	21/02/2025	Electronic File	IMG_1699.HEIC
2632	PSM.5000.0003.9089	21/02/2025	Electronic File	IMG_1700.HEIC
2633	PSM.5000.0003.9090	21/02/2025	Electronic File	IMG_1701.HEIC
2634	PSM.5000.0003.9091	21/02/2025	Electronic File	IMG_1702.HEIC
2635	PSM.5000.0003.9092	21/02/2025	Electronic File	IMG_1703.HEIC
2636	PSM.5000.0003.9093	21/02/2025	Electronic File	IMG_1704.HEIC
2637	PSM.5000.0003.9094	21/02/2025	Electronic File	IMG_1705.HEIC
2638	PSM.5000.0003.9095	21/02/2025	Electronic File	IMG_1706.HEIC
2639	PSM.5000.0003.9096	21/02/2025	Electronic File	IMG_1707.HEIC
2640	PSM.5000.0003.9097	21/02/2025	Electronic File	IMG_1708.HEIC

Count	Document ID	Document Date	Document Type	Title
2641	PSM.5000.0003.9098	21/02/2025	Electronic File	IMG_1709.HEIC
2642	PSM.5000.0003.9099	21/02/2025	Electronic File	IMG_1710.HEIC
2643	PSM.5000.0003.9100	21/02/2025	Electronic File	IMG_1711.HEIC
2644	PSM.5000.0003.9101	21/02/2025	Electronic File	IMG_1712.HEIC
2645	PSM.5000.0003.9102	21/02/2025	Electronic File	IMG_1713.HEIC
2646	PSM.5000.0003.9103	21/02/2025	Electronic File	IMG_1714.HEIC
2647	PSM.5000.0003.9104	21/02/2025	Electronic File	IMG_1715.HEIC
2648	PSM.5000.0003.9105	21/02/2025	Electronic File	IMG_1716.HEIC
2649	PSM.5000.0003.9106	21/02/2025	Electronic File	IMG_1717.HEIC
2650	PSM.5000.0003.9107	21/02/2025	Electronic File	IMG_1718.HEIC
2651	PSM.5000.0003.9108	21/02/2025	Electronic File	IMG_1719.HEIC
2652	PSM.5000.0003.9109	21/02/2025	Electronic File	IMG_1937.HEIC
2653	PSM.5000.0003.9110	21/02/2025	Electronic File	IMG_1938.HEIC
2654	PSM.5000.0003.9111	21/02/2025	Electronic File	IMG_1939.HEIC
2655	PSM.5000.0003.9112	21/02/2025	Electronic File	IMG_1940.HEIC
2656	PSM.5000.0003.9113	21/02/2025	Electronic File	IMG_1941.HEIC
2657	PSM.5000.0003.9114	21/02/2025	Electronic File	IMG_1943.HEIC
2658	PSM.5000.0003.9115	21/02/2025	Electronic File	IMG_1944.HEIC
2659	PSM.5000.0003.9116	21/02/2025	Electronic File	IMG_1945.HEIC
2660	PSM.5000.0003.9117	21/02/2025	Electronic File	IMG_1946.HEIC
2661	PSM.5000.0003.9118	21/02/2025	Electronic File	IMG_1947.HEIC
2662	PSM.5000.0003.9119	21/02/2025	Electronic File	IMG_1948.HEIC
2663	PSM.5000.0003.9120	21/02/2025	Electronic File	IMG_1949.HEIC
2664	PSM.5000.0003.9121	21/02/2025	Electronic File	IMG_1950.HEIC
2665	PSM.5000.0003.9122	21/02/2025	Electronic File	IMG_1951.HEIC
2666	PSM.5000.0003.9123	21/02/2025	Electronic File	IMG_1952.HEIC
2667	PSM.5000.0003.9124	21/02/2025	Electronic File	IMG_1953.HEIC
2668	PSM.5000.0003.9125	21/02/2025	Electronic File	IMG_1720.HEIC
2669	PSM.5000.0003.9126	21/02/2025	Electronic File	IMG_1721.HEIC
2670	PSM.5000.0003.9127	21/02/2025	Electronic File	IMG_1722.HEIC
2671	PSM.5000.0003.9128	21/02/2025	Electronic File	IMG_1723.HEIC
2672	PSM.5000.0003.9129	21/02/2025	Electronic File	IMG_1724.HEIC
2673	PSM.5000.0003.9130	21/02/2025	Electronic File	IMG_1725.HEIC
2674	PSM.5000.0003.9131	21/02/2025	Electronic File	IMG_1955.HEIC
2675	PSM.5000.0003.9132	21/02/2025	Electronic File	IMG_1726.HEIC
2676	PSM.5000.0003.9133	21/02/2025	Electronic File	IMG_1956.HEIC
2677	PSM.5000.0003.9134	21/02/2025	Electronic File	IMG_1957.HEIC
2678	PSM.5000.0003.9135	21/02/2025	Electronic File	IMG_1958.HEIC
2679	PSM.5000.0003.9136	21/02/2025	Electronic File	IMG_1961.HEIC
2680	PSM.5000.0003.9137	23/02/2025	Electronic File	IMG_2842.HEIC
2681	PSM.5000.0003.9138	23/02/2025	Electronic File	IMG_2872.HEIC
2682	PSM.5000.0003.9139	23/02/2025	Electronic File	IMG_2873.HEIC
2683	PSM.5000.0003.9140	23/02/2025	Electronic File	IMG_2876.HEIC
2684	PSM.5000.0003.9141	23/02/2025	Electronic File	IMG_2877.HEIC
2685	PSM.5000.0003.9142	23/02/2025	Electronic File	IMG_2878.HEIC
2686	PSM.5000.0003.9143	23/02/2025	Electronic File	IMG_2884.HEIC
2687	PSM.5000.0003.9144	23/02/2025	Electronic File	IMG_2885.HEIC
2688	PSM.5000.0003.9145	23/02/2025	Electronic File	IMG_2886.HEIC
2689	PSM.5000.0003.9146	23/02/2025	Electronic File	IMG_2887.HEIC
2690	PSM.5000.0003.9147	23/02/2025	Electronic File	IMG_2905.HEIC
2691	PSM.5000.0003.9148	23/02/2025	Electronic File	IMG_2907.HEIC
2692	PSM.5000.0003.9149	23/02/2025	Electronic File	IMG_2908.HEIC
2693	PSM.5000.0003.9150	23/02/2025	Electronic File	IMG_2909.HEIC
2694	PSM.5000.0003.9151	23/02/2025	Electronic File	IMG_2915.HEIC
2695	PSM.5000.0003.9152	23/02/2025	Electronic File	IMG_2917.HEIC

Count	Document ID	Document Date	Document Type	Title
2696	PSM.5000.0003.9153	23/02/2025	Electronic File	IMG_2918.HEIC
2697	PSM.5000.0003.9154	23/02/2025	Electronic File	IMG_2921.HEIC
2698	PSM.5000.0003.9155	23/02/2025	Electronic File	IMG_2922.HEIC
2699	PSM.5000.0003.9156	23/02/2025	Electronic File	IMG_2824.HEIC
2700	PSM.5000.0003.9157	23/02/2025	Electronic File	IMG_2827.HEIC
2701	PSM.5000.0003.9158	23/02/2025	Electronic File	IMG_2829.HEIC
2702	PSM.5000.0003.9159	23/02/2025	Electronic File	IMG_2830.HEIC
2703	PSM.5000.0003.9160	23/02/2025	Electronic File	IMG_2839.HEIC
2704	PSM.5000.0003.9161	23/02/2025	Electronic File	IMG_2840.HEIC
2705	PSM.5000.0003.9162	23/02/2025	Electronic File	IMG_2844.HEIC
2706	PSM.5000.0003.9163	23/02/2025	Electronic File	IMG_2846.HEIC
2707	PSM.5000.0003.9164	23/02/2025	Electronic File	IMG_2849.HEIC
2708	PSM.5000.0003.9165	23/02/2025	Electronic File	IMG_2879.HEIC
2709	PSM.5000.0003.9166	23/02/2025	Electronic File	IMG_2882.HEIC
2710	PSM.5000.0003.9167	23/02/2025	Electronic File	IMG_2883.HEIC
2711	PSM.5000.0003.9168	23/02/2025	Electronic File	IMG_2888.HEIC
2712	PSM.5000.0003.9169	23/02/2025	Electronic File	IMG_2906.HEIC
2713	PSM.5000.0003.9170	23/02/2025	Electronic File	IMG_2910.HEIC
2714	PSM.5000.0003.9171	23/02/2025	Electronic File	IMG_2911.HEIC
2715	PSM.5000.0003.9172	23/02/2025	Electronic File	IMG_2912.HEIC
2716	PSM.5000.0003.9173	23/02/2025	Electronic File	IMG_2913.HEIC
2717	PSM.5000.0003.9174	23/02/2025	Electronic File	IMG_2916.HEIC
2718	PSM.5000.0003.9175	23/02/2025	Electronic File	IMG_2923.HEIC
2719	PSM.5000.0003.9176	23/02/2025	Electronic File	IMG_2825.HEIC
2720	PSM.5000.0003.9177	23/02/2025	Electronic File	IMG_2826.HEIC
2721	PSM.5000.0003.9178	23/02/2025	Electronic File	IMG_2831.HEIC
2722	PSM.5000.0003.9179	23/02/2025	Electronic File	IMG_2832.HEIC
2723	PSM.5000.0003.9180	23/02/2025	Electronic File	IMG_2834.HEIC
2724	PSM.5000.0003.9181	23/02/2025	Electronic File	IMG_2838.HEIC
2725	PSM.5000.0003.9182	23/02/2025	Electronic File	IMG_2919.HEIC
2726	PSM.5000.0003.9183	23/02/2025	Electronic File	116768 - 10-12 View Point Road~MCCRAE VIC 3938 Scanned File: (A1363303).pdf
2727	PSM.5000.0003.9211	23/02/2025	Electronic File	148726 - 3 Penny Lane~MCCRAE VIC 3938 ____ Scanned File: (A1363303).pdf
2728	PSM.5000.0003.9477	23/02/2025	Electronic File	116765 - 6 View Point Road~MCCRAE VIC 3938 ____ Scanned File: (A1363303).pdf
2729	PSM.5000.0003.9547	23/02/2025	Electronic File	C02_0328 - PLANNING CERTIFICATE AND APPLICATION File: (A102153).pdf
2730	PSM.5000.0003.9550	23/02/2025	Electronic File	C1302_04 - AMENDED APPROVED DOCUMENTS (A877950).PDF
2731	PSM.5000.0003.9559	23/02/2025	Electronic File	C1302_04 BUILDING PERMIT (A877949).PDF
2732	PSM.5000.0003.9562	23/02/2025	Electronic File	C1302_04 OCCUPANCY PERMIT (A189694).PDF
2733	PSM.5000.0003.9568	23/02/2025	Electronic File	FW_ Objection to Planning Application P08_1686 (A186152).TXT
2734	PSM.5000.0003.9570	23/02/2025	Electronic File	P020465 PLANNING PERMIT ENDORSED PLANS COMPLETE TO File: (A102153).pdf
2735	PSM.5000.0003.9573	23/02/2025	Electronic File	P021033 FURTHER INFORMATION (A877944).PDF
2736	PSM.5000.0003.9575	23/02/2025	Electronic File	P021833 AMENDED PLANS (A1072156).PDF
2737	PSM.5000.0003.9580	23/02/2025	Electronic File	P021833 AMENDED PLANS (A877955).PDF
2738	PSM.5000.0003.9582	23/02/2025	Electronic File	P021833 AMENDED SITE PLAN (A186155).PDF
2739	PSM.5000.0003.9586	23/02/2025	Electronic File	P021833 APPLICATION (A186164).PDF
2740	PSM.5000.0003.9598	23/02/2025	Electronic File	P021833 APPLICATION FOR REVIEW (A186154).TIF
2741	PSM.5000.0003.9599	23/02/2025	Electronic File	P021833 APPLICATION FOR REVIEW (A186157).PDF
2742	PSM.5000.0003.9604	23/02/2025	Electronic File	P021833 APPLICATION FOR REVIEW (A877951).PDF
2743	PSM.5000.0003.9608	23/02/2025	Electronic File	P021833 CONCERNS FOR TREE (A186156).TIF
2744	PSM.5000.0003.9609	23/02/2025	Electronic File	P021833 COPY OF APPLICATION TO VCAT (A877952).PDF
2745	PSM.5000.0003.9611	23/02/2025	Electronic File	P021833 DRAWINGS (A186161).PDF
2746	PSM.5000.0003.9614	23/02/2025	Electronic File	P021833 FURTHER INFORMATION (A1072160).PDF
2747	PSM.5000.0003.9617	23/02/2025	Electronic File	P021833 FURTHER INFORMATION (A115617).TIF
2748	PSM.5000.0003.9618	23/02/2025	Electronic File	P021833 FURTHER INFORMATION (A186158).PDF
2749	PSM.5000.0003.9631	23/02/2025	Electronic File	P021833 FURTHER INFORMATION (A877953).PDF
2750	PSM.5000.0003.9635	23/02/2025	Electronic File	P021833 FURTHER INFORMATION (A877954).PDF

Count	Document ID	Document Date	Document Type	Title
2751	PSM.5000.0003.9640	23/02/2025	Electronic File	P021833 NOTICE OF DIRECTIONS HEARING 05 FEB 2003 AT 2.15 (A1072163).TIF
2752	PSM.5000.0003.9641	23/02/2025	Electronic File	P021833 NOTICE OF HEARING 05 JUNE 2003 AT 2.15 (A1072163).TIF
2753	PSM.5000.0003.9642	23/02/2025	Electronic File	P021833 OBJECTION (A1072169).PDF
2754	PSM.5000.0003.9644	23/02/2025	Electronic File	P021833 OBJECTION (A328521).PDF
2755	PSM.5000.0003.9647	23/02/2025	Electronic File	P021833 OBJECTION (A547375).TIF
2756	PSM.5000.0003.9648	23/02/2025	Electronic File	P021833 OBJECTION (A547380).PDF
2757	PSM.5000.0003.9650	23/02/2025	Electronic File	P021833 OBJECTION (A877940).TIF
2758	PSM.5000.0003.9651	23/02/2025	Electronic File	P021833 P3390_2002 STATEMENT OF GROUNDS (A186160).PDF
2759	PSM.5000.0003.9654	23/02/2025	Electronic File	P021833 RESPONSE TO OBJECTIONS (A1072164).PDF
2760	PSM.5000.0003.9657	23/02/2025	Electronic File	P021833 VCAT 3390_2002 (A186150).PDF
2761	PSM.5000.0003.9659	23/02/2025	Electronic File	P021833 VCAT 3390_2002 (A727296).PDF
2762	PSM.5000.0003.9661	23/02/2025	Electronic File	P021833 VCAT REF P3390_2002 REFERRAL TO MEDIATION (A1072163).PDF
2763	PSM.5000.0003.9665	23/02/2025	Electronic File	P021853 OBJECTION (A547377).TIF
2764	PSM.5000.0003.9666	23/02/2025	Electronic File	P022398 APPLICATION FOR REVIEW (A115618).PDF
2765	PSM.5000.0003.9672	23/02/2025	Electronic File	P022398 APPLICATION FOR REVIEW (A186168).PDF
2766	PSM.5000.0003.9679	23/02/2025	Electronic File	P02_1833 INTERNAL EMAIL (A186151).PDF
2767	PSM.5000.0003.9681	23/02/2025	Electronic File	P02_1833 PLANNING COMPLIANCE LANDSCAPE PLAN (A186163).PDF
2768	PSM.5000.0003.9684	23/02/2025	Electronic File	P08_1686 - RE PLANNING APPLICATION (A877945).doc
2769	PSM.5000.0003.9685	23/02/2025	Electronic File	P08_1686 - RE PLANNING PERMIT AMENDMENT (A186165).doc
2770	PSM.5000.0003.9687	23/02/2025	Electronic File	P08_1686 APPLICATION FOR PLANNING PERMIT (A727294).PDF
2771	PSM.5000.0003.9692	23/02/2025	Electronic File	P08_1686 CONCERNS RE TREES (A877948).PDF
2772	PSM.5000.0003.9699	23/02/2025	Electronic File	P08_1686 FURTHER INFORMATION (A186166).TIF
2773	PSM.5000.0003.9700	23/02/2025	Electronic File	P08_1686 NOTICE OF REFUSAL TO GRANT PERMIT - DELEGATE (A800203).PDF
2774	PSM.5000.0003.9710	23/02/2025	Electronic File	P08_1686 OBJECTION (A186149).PDF
2775	PSM.5000.0003.9712	23/02/2025	Electronic File	P08_1686 OBJECTION (A186162).TIF
2776	PSM.5000.0003.9713	23/02/2025	Electronic File	P08_1686 OBJECTION (A328523).TIF
2777	PSM.5000.0003.9714	23/02/2025	Electronic File	P08_1686 OBJECTION (A547378).TIF
2778	PSM.5000.0003.9715	23/02/2025	Electronic File	P08_1686 OBJECTION (A877942).TIF
2779	PSM.5000.0003.9716	23/02/2025	Electronic File	P08_1686 OBJECTION (A877947).TIF
2780	PSM.5000.0003.9717	23/02/2025	Electronic File	P1833.01 MINOR AMENDMENT (A1072152).PDF
2781	PSM.5000.0003.9723	23/02/2025	Electronic File	PERMIT FOR WORKS WITHIN ROAD RESERVE (A186159).TIF
2782	PSM.5000.0003.9724	23/02/2025	Electronic File	PERMIT FOR WORKS WITHIN ROAD RESERVE (A189690).TIF
2783	PSM.5000.0003.9725	23/02/2025	Electronic File	POINT OF DRAINAGE DISCHARGE (A877941).doc
2784	PSM.5000.0003.9726	23/02/2025	Electronic File	114627 - 607 Point Nepean Road~MCCRAE VIC 3938 (A1353540).pdf
2785	PSM.5000.0003.9845	23/02/2025	Electronic File	148725 - 607-609 Point Nepean Road~MCCRAE VIC 3938 (A1355523).pdf
2786	PSM.5000.0004.0064	24/02/2025	Electronic File	IMG_2943.HEIC
2787	PSM.5000.0004.0065	24/02/2025	Electronic File	IMG_2950.HEIC
2788	PSM.5000.0004.0066	24/02/2025	Electronic File	IMG_2956.HEIC
2789	PSM.5000.0004.0067	24/02/2025	Electronic File	IMG_2961.HEIC
2790	PSM.5000.0004.0068	24/02/2025	Electronic File	IMG_2963.HEIC
2791	PSM.5000.0004.0069	24/02/2025	Electronic File	IMG_2965.HEIC
2792	PSM.5000.0004.0070	24/02/2025	Electronic File	IMG_2966.HEIC
2793	PSM.5000.0004.0071	24/02/2025	Electronic File	IMG_2967.HEIC
2794	PSM.5000.0004.0072	24/02/2025	Electronic File	IMG_2969.HEIC
2795	PSM.5000.0004.0073	24/02/2025	Electronic File	IMG_2973.HEIC
2796	PSM.5000.0004.0074	24/02/2025	Electronic File	IMG_2940.HEIC
2797	PSM.5000.0004.0075	24/02/2025	Electronic File	IMG_2945.HEIC
2798	PSM.5000.0004.0076	24/02/2025	Electronic File	IMG_2946.HEIC
2799	PSM.5000.0004.0077	24/02/2025	Electronic File	IMG_2949.HEIC
2800	PSM.5000.0004.0078	24/02/2025	Electronic File	IMG_2951.HEIC
2801	PSM.5000.0004.0079	24/02/2025	Electronic File	IMG_2958.HEIC
2802	PSM.5000.0004.0080	24/02/2025	Electronic File	IMG_2959.HEIC
2803	PSM.5000.0004.0081	24/02/2025	Electronic File	IMG_2962.HEIC
2804	PSM.5000.0004.0082	24/02/2025	Electronic File	IMG_2964.HEIC
2805	PSM.5000.0004.0083	24/02/2025	Electronic File	IMG_2986.HEIC

Count	Document ID	Document Date	Document Type	Title
2806	PSM.5000.0004.0084	24/02/2025	Electronic File	IMG_2941.HEIC
2807	PSM.5000.0004.0085	24/02/2025	Electronic File	IMG_2944.HEIC
2808	PSM.5000.0004.0086	24/02/2025	Electronic File	IMG_2947.HEIC
2809	PSM.5000.0004.0087	24/02/2025	Electronic File	IMG_2948.HEIC
2810	PSM.5000.0004.0088	24/02/2025	Electronic File	IMG_2952.HEIC
2811	PSM.5000.0004.0089	24/02/2025	Electronic File	IMG_2953.HEIC
2812	PSM.5000.0004.0090	24/02/2025	Electronic File	IMG_2955.HEIC
2813	PSM.5000.0004.0091	24/02/2025	Electronic File	IMG_2957.HEIC
2814	PSM.5000.0004.0092	24/02/2025	Electronic File	IMG_2960.HEIC
2815	PSM.5000.0004.0093	24/02/2025	Electronic File	IMG_2968.HEIC
2816	PSM.5000.0004.0094	24/02/2025	Electronic File	IMG_2970.HEIC
2817	PSM.5000.0004.0095	24/02/2025	Electronic File	IMG_2971.HEIC
2818	PSM.5000.0004.0096	25/02/2025	Electronic File	IMG_3035.HEIC
2819	PSM.5000.0004.0097	25/02/2025	Electronic File	IMG_3064.HEIC
2820	PSM.5000.0004.0098	25/02/2025	Electronic File	IMG_3065.HEIC
2821	PSM.5000.0004.0099	25/02/2025	Electronic File	IMG_3066.HEIC
2822	PSM.5000.0004.0100	25/02/2025	Electronic File	IMG_3067.HEIC
2823	PSM.5000.0004.0101	25/02/2025	Electronic File	IMG_3068.HEIC
2824	PSM.5000.0004.0102	25/02/2025	Electronic File	IMG_3069.HEIC
2825	PSM.5000.0004.0103	25/02/2025	Electronic File	IMG_3070.HEIC
2826	PSM.5000.0004.0104	25/02/2025	Electronic File	IMG_3071.HEIC
2827	PSM.5000.0004.0105	25/02/2025	Electronic File	IMG_3072.HEIC
2828	PSM.5000.0004.0106	25/02/2025	Electronic File	IMG_3073.HEIC
2829	PSM.5000.0004.0107	25/02/2025	Electronic File	IMG_3075.HEIC
2830	PSM.5000.0004.0108	25/02/2025	Electronic File	IMG_3076.HEIC
2831	PSM.5000.0004.0109	25/02/2025	Electronic File	IMG_3077.HEIC
2832	PSM.5000.0004.0110	25/02/2025	Electronic File	IMG_3080.HEIC
2833	PSM.5000.0004.0111	25/02/2025	Electronic File	IMG_3081.HEIC
2834	PSM.5000.0004.0112	25/02/2025	Electronic File	IMG_3082.HEIC
2835	PSM.5000.0004.0113	25/02/2025	Electronic File	IMG_3083.HEIC
2836	PSM.5000.0004.0114	25/02/2025	Electronic File	IMG_3084.HEIC
2837	PSM.5000.0004.0115	25/02/2025	Electronic File	IMG_3045.HEIC
2838	PSM.5000.0004.0116	25/02/2025	Electronic File	IMG_3047.HEIC
2839	PSM.5000.0004.0117	25/02/2025	Electronic File	IMG_3048.HEIC
2840	PSM.5000.0004.0118	25/02/2025	Electronic File	IMG_3049.HEIC
2841	PSM.5000.0004.0119	25/02/2025	Electronic File	IMG_3052.HEIC
2842	PSM.5000.0004.0120	25/02/2025	Electronic File	IMG_3053.HEIC
2843	PSM.5000.0004.0121	25/02/2025	Electronic File	IMG_3054.HEIC
2844	PSM.5000.0004.0122	25/02/2025	Electronic File	IMG_3055.HEIC
2845	PSM.5000.0004.0123	25/02/2025	Electronic File	IMG_3056.HEIC
2846	PSM.5000.0004.0124	25/02/2025	Electronic File	IMG_3057.HEIC
2847	PSM.5000.0004.0125	25/02/2025	Electronic File	IMG_3059.HEIC
2848	PSM.5000.0004.0126	25/02/2025	Electronic File	IMG_3060.HEIC
2849	PSM.5000.0004.0127	25/02/2025	Electronic File	IMG_3061.HEIC
2850	PSM.5000.0004.0128	25/02/2025	Electronic File	IMG_3062.HEIC
2851	PSM.5000.0004.0129	25/02/2025	Electronic File	IMG_3063.HEIC
2852	PSM.5000.0004.0130	25/02/2025	Electronic File	IMG_3078.HEIC
2853	PSM.5000.0004.0131	25/02/2025	Electronic File	IMG_3085.HEIC
2854	PSM.5000.0004.0132	25/02/2025	Electronic File	IMG_3002.HEIC
2855	PSM.5000.0004.0133	25/02/2025	Electronic File	IMG_3018.HEIC
2856	PSM.5000.0004.0134	25/02/2025	Electronic File	IMG_3019.HEIC
2857	PSM.5000.0004.0135	25/02/2025	Electronic File	IMG_3020.HEIC
2858	PSM.5000.0004.0136	25/02/2025	Electronic File	IMG_3024.HEIC
2859	PSM.5000.0004.0137	25/02/2025	Electronic File	IMG_3025.HEIC
2860	PSM.5000.0004.0138	25/02/2025	Electronic File	IMG_3026.HEIC

Count	Document ID	Document Date	Document Type	Title
2861	PSM.5000.0004.0139	25/02/2025	Electronic File	IMG_3031.HEIC
2862	PSM.5000.0004.0140	25/02/2025	Electronic File	IMG_3032.HEIC
2863	PSM.5000.0004.0141	25/02/2025	Electronic File	IMG_3033.HEIC
2864	PSM.5000.0004.0142	25/02/2025	Electronic File	IMG_3034.HEIC
2865	PSM.5000.0004.0143	25/02/2025	Electronic File	IMG_3036.HEIC
2866	PSM.5000.0004.0144	25/02/2025	Electronic File	IMG_3037.HEIC
2867	PSM.5000.0004.0145	25/02/2025	Electronic File	IMG_3038.HEIC
2868	PSM.5000.0004.0146	25/02/2025	Electronic File	IMG_3040.HEIC
2869	PSM.5000.0004.0147	25/02/2025	Electronic File	IMG_3041.HEIC
2870	PSM.5000.0004.0148	25/02/2025	Electronic File	IMG_3043.HEIC
2871	PSM.5000.0004.0149	25/02/2025	Electronic File	IMG_3050.HEIC
2872	PSM.5000.0004.0150	25/02/2025	Electronic File	IMG_3051.HEIC
2873	PSM.5000.0004.0151	25/02/2025	Electronic File	IMG_3058.HEIC
2874	PSM.5000.0004.0152	25/02/2025	Electronic File	IMG_3074.HEIC
2875	PSM.5000.0004.0153	25/02/2025	Electronic File	IMG_3003.HEIC
2876	PSM.5000.0004.0154	25/02/2025	Electronic File	IMG_3004.HEIC
2877	PSM.5000.0004.0155	25/02/2025	Electronic File	IMG_3006.HEIC
2878	PSM.5000.0004.0156	25/02/2025	Electronic File	IMG_3008.HEIC
2879	PSM.5000.0004.0157	25/02/2025	Electronic File	IMG_3013.HEIC
2880	PSM.5000.0004.0158	25/02/2025	Electronic File	IMG_3016.HEIC
2881	PSM.5000.0004.0159	25/02/2025	Electronic File	IMG_3021.HEIC
2882	PSM.5000.0004.0160	25/02/2025	Electronic File	IMG_3022.HEIC
2883	PSM.5000.0004.0161	25/02/2025	Electronic File	IMG_3023.HEIC
2884	PSM.5000.0004.0162	25/02/2025	Electronic File	IMG_3027.HEIC
2885	PSM.5000.0004.0163	25/02/2025	Electronic File	IMG_3028.HEIC
2886	PSM.5000.0004.0164	25/02/2025	Electronic File	IMG_3029.HEIC
2887	PSM.5000.0004.0165	25/02/2025	Electronic File	IMG_3030.HEIC
2888	PSM.5000.0004.0166	25/02/2025	Electronic File	IMG_3042.HEIC
2889	PSM.5000.0004.0167	25/02/2025	Electronic File	IMG_3046.HEIC
2890	PSM.5000.0004.0168	25/02/2025	Electronic File	IMG_2989.HEIC
2891	PSM.5000.0004.0169	25/02/2025	Electronic File	IMG_2990.HEIC
2892	PSM.5000.0004.0170	25/02/2025	Electronic File	IMG_2991.HEIC
2893	PSM.5000.0004.0171	25/02/2025	Electronic File	IMG_2992.HEIC
2894	PSM.5000.0004.0172	25/02/2025	Electronic File	IMG_2993.HEIC
2895	PSM.5000.0004.0173	25/02/2025	Electronic File	IMG_2994.HEIC
2896	PSM.5000.0004.0174	25/02/2025	Electronic File	IMG_2995.HEIC
2897	PSM.5000.0004.0175	25/02/2025	Electronic File	IMG_2996.HEIC
2898	PSM.5000.0004.0176	25/02/2025	Electronic File	IMG_2997.HEIC
2899	PSM.5000.0004.0177	25/02/2025	Electronic File	IMG_2998.HEIC
2900	PSM.5000.0004.0178	25/02/2025	Electronic File	IMG_2999.HEIC
2901	PSM.5000.0004.0179	25/02/2025	Electronic File	IMG_3001.HEIC
2902	PSM.5000.0004.0180	25/02/2025	Electronic File	IMG_3005.HEIC
2903	PSM.5000.0004.0181	25/02/2025	Electronic File	IMG_3007.HEIC
2904	PSM.5000.0004.0182	25/02/2025	Electronic File	IMG_3010.HEIC
2905	PSM.5000.0004.0183	25/02/2025	Electronic File	IMG_3011.HEIC
2906	PSM.5000.0004.0184	25/02/2025	Electronic File	IMG_3012.HEIC
2907	PSM.5000.0004.0185	25/02/2025	Electronic File	IMG_3017.HEIC
2908	PSM.5000.0004.0186	25/02/2025	Electronic File	IMG_3044.HEIC
2909	PSM.5000.0004.0187	25/02/2025	Electronic File	IMG_3009.HEIC
2910	PSM.5000.0004.0188	26/02/2025	Electronic File	IMG_3157.HEIC
2911	PSM.5000.0004.0189	26/02/2025	Electronic File	IMG_3158.HEIC
2912	PSM.5000.0004.0190	26/02/2025	Electronic File	IMG_3159.HEIC
2913	PSM.5000.0004.0191	26/02/2025	Electronic File	IMG_3162.HEIC
2914	PSM.5000.0004.0192	26/02/2025	Electronic File	IMG_3165.HEIC
2915	PSM.5000.0004.0193	26/02/2025	Electronic File	IMG_3172.HEIC

Count	Document ID	Document Date	Document Type	Title
2916	PSM.5000.0004.0194	26/02/2025	Electronic File	IMG_3145.HEIC
2917	PSM.5000.0004.0195	26/02/2025	Electronic File	IMG_3151.HEIC
2918	PSM.5000.0004.0196	26/02/2025	Electronic File	IMG_3152.HEIC
2919	PSM.5000.0004.0197	26/02/2025	Electronic File	IMG_3153.HEIC
2920	PSM.5000.0004.0198	26/02/2025	Electronic File	IMG_3154.HEIC
2921	PSM.5000.0004.0199	26/02/2025	Electronic File	IMG_3155.HEIC
2922	PSM.5000.0004.0200	26/02/2025	Electronic File	IMG_3163.HEIC
2923	PSM.5000.0004.0201	26/02/2025	Electronic File	IMG_3164.HEIC
2924	PSM.5000.0004.0202	26/02/2025	Electronic File	IMG_3166.HEIC
2925	PSM.5000.0004.0203	26/02/2025	Electronic File	IMG_3173.HEIC
2926	PSM.5000.0004.0204	26/02/2025	Electronic File	IMG_3175.HEIC
2927	PSM.5000.0004.0205	26/02/2025	Electronic File	IMG_3176.HEIC
2928	PSM.5000.0004.0206	26/02/2025	Electronic File	IMG_3178.HEIC
2929	PSM.5000.0004.0207	26/02/2025	Electronic File	IMG_3179.HEIC
2930	PSM.5000.0004.0208	26/02/2025	Electronic File	IMG_3180.HEIC
2931	PSM.5000.0004.0209	26/02/2025	Electronic File	IMG_3123.HEIC
2932	PSM.5000.0004.0210	26/02/2025	Electronic File	IMG_3127.HEIC
2933	PSM.5000.0004.0211	26/02/2025	Electronic File	IMG_3129.HEIC
2934	PSM.5000.0004.0212	26/02/2025	Electronic File	IMG_3138.HEIC
2935	PSM.5000.0004.0213	26/02/2025	Electronic File	IMG_3139.HEIC
2936	PSM.5000.0004.0214	26/02/2025	Electronic File	IMG_3141.HEIC
2937	PSM.5000.0004.0215	26/02/2025	Electronic File	IMG_3144.HEIC
2938	PSM.5000.0004.0216	26/02/2025	Electronic File	IMG_3146.HEIC
2939	PSM.5000.0004.0217	26/02/2025	Electronic File	IMG_3148.HEIC
2940	PSM.5000.0004.0218	26/02/2025	Electronic File	IMG_3149.HEIC
2941	PSM.5000.0004.0219	26/02/2025	Electronic File	IMG_3150.HEIC
2942	PSM.5000.0004.0220	26/02/2025	Electronic File	IMG_3156.HEIC
2943	PSM.5000.0004.0221	26/02/2025	Electronic File	IMG_3169.HEIC
2944	PSM.5000.0004.0222	26/02/2025	Electronic File	IMG_3170.HEIC
2945	PSM.5000.0004.0223	26/02/2025	Electronic File	IMG_3171.HEIC
2946	PSM.5000.0004.0224	26/02/2025	Electronic File	IMG_3177.HEIC
2947	PSM.5000.0004.0225	26/02/2025	Electronic File	IMG_3111.HEIC
2948	PSM.5000.0004.0226	26/02/2025	Electronic File	IMG_3114.HEIC
2949	PSM.5000.0004.0227	26/02/2025	Electronic File	IMG_3118.HEIC
2950	PSM.5000.0004.0228	26/02/2025	Electronic File	IMG_3121.HEIC
2951	PSM.5000.0004.0229	26/02/2025	Electronic File	IMG_3128.HEIC
2952	PSM.5000.0004.0230	26/02/2025	Electronic File	IMG_3131.HEIC
2953	PSM.5000.0004.0231	26/02/2025	Electronic File	IMG_3135.HEIC
2954	PSM.5000.0004.0232	26/02/2025	Electronic File	IMG_3136.HEIC
2955	PSM.5000.0004.0233	26/02/2025	Electronic File	IMG_3137.HEIC
2956	PSM.5000.0004.0234	26/02/2025	Electronic File	IMG_3142.HEIC
2957	PSM.5000.0004.0235	26/02/2025	Electronic File	IMG_3143.HEIC
2958	PSM.5000.0004.0236	26/02/2025	Electronic File	IMG_3147.HEIC
2959	PSM.5000.0004.0237	26/02/2025	Electronic File	IMG_3103.HEIC
2960	PSM.5000.0004.0238	26/02/2025	Electronic File	IMG_3104.HEIC
2961	PSM.5000.0004.0239	26/02/2025	Electronic File	IMG_3110.HEIC
2962	PSM.5000.0004.0240	26/02/2025	Electronic File	IMG_3112.HEIC
2963	PSM.5000.0004.0241	26/02/2025	Electronic File	IMG_3113.HEIC
2964	PSM.5000.0004.0242	26/02/2025	Electronic File	IMG_3115.HEIC
2965	PSM.5000.0004.0243	26/02/2025	Electronic File	IMG_3116.HEIC
2966	PSM.5000.0004.0244	26/02/2025	Electronic File	IMG_3117.HEIC
2967	PSM.5000.0004.0245	26/02/2025	Electronic File	IMG_3120.HEIC
2968	PSM.5000.0004.0246	26/02/2025	Electronic File	IMG_3124.HEIC
2969	PSM.5000.0004.0247	26/02/2025	Electronic File	IMG_3125.HEIC
2970	PSM.5000.0004.0248	26/02/2025	Electronic File	IMG_3126.HEIC

Count	Document ID	Document Date	Document Type	Title
2971	PSM.5000.0004.0249	26/02/2025	Electronic File	IMG_3132.HEIC
2972	PSM.5000.0004.0250	26/02/2025	Electronic File	IMG_3134.HEIC
2973	PSM.5000.0004.0251	26/02/2025	Electronic File	IMG_3089.HEIC
2974	PSM.5000.0004.0252	26/02/2025	Electronic File	IMG_3094.HEIC
2975	PSM.5000.0004.0253	26/02/2025	Electronic File	IMG_3096.HEIC
2976	PSM.5000.0004.0254	26/02/2025	Electronic File	IMG_3097.HEIC
2977	PSM.5000.0004.0255	26/02/2025	Electronic File	IMG_3098.HEIC
2978	PSM.5000.0004.0256	26/02/2025	Electronic File	IMG_3100.HEIC
2979	PSM.5000.0004.0257	26/02/2025	Electronic File	IMG_3101.HEIC
2980	PSM.5000.0004.0258	26/02/2025	Electronic File	IMG_3106.HEIC
2981	PSM.5000.0004.0259	26/02/2025	Electronic File	IMG_3108.HEIC
2982	PSM.5000.0004.0260	26/02/2025	Electronic File	IMG_3109.HEIC
2983	PSM.5000.0004.0261	26/02/2025	Electronic File	IMG_3119.HEIC
2984	PSM.5000.0004.0262	26/02/2025	Electronic File	IMG_3122.HEIC
2985	PSM.5000.0004.0263	26/02/2025	Electronic File	IMG_3140.HEIC
2986	PSM.5000.0004.0264	26/02/2025	Electronic File	IMG_3086.HEIC
2987	PSM.5000.0004.0265	26/02/2025	Electronic File	IMG_3087.HEIC
2988	PSM.5000.0004.0266	26/02/2025	Electronic File	IMG_3088.HEIC
2989	PSM.5000.0004.0267	26/02/2025	Electronic File	IMG_3090.HEIC
2990	PSM.5000.0004.0268	26/02/2025	Electronic File	IMG_3092.HEIC
2991	PSM.5000.0004.0269	26/02/2025	Electronic File	IMG_3093.HEIC
2992	PSM.5000.0004.0270	26/02/2025	Electronic File	IMG_3095.HEIC
2993	PSM.5000.0004.0271	26/02/2025	Electronic File	IMG_3099.HEIC
2994	PSM.5000.0004.0272	26/02/2025	Electronic File	IMG_3102.HEIC
2995	PSM.5000.0004.0273	26/02/2025	Electronic File	IMG_3105.HEIC
2996	PSM.5000.0004.0274	26/02/2025	Electronic File	IMG_3107.HEIC
2997	PSM.5000.0004.0275	26/02/2025	Electronic File	IMG_3130.HEIC
2998	PSM.5000.0004.0276	26/02/2025	Electronic File	IMG_3133.HEIC
2999	PSM.5000.0004.0277	26/02/2025	Electronic File	IMG_3174.HEIC
3000	PSM.5000.0004.0278	27/02/2025	Electronic File	IMG_1742.HEIC
3001	PSM.5000.0004.0279	27/02/2025	Electronic File	IMG_1743.HEIC
3002	PSM.5000.0004.0280	27/02/2025	Electronic File	IMG_1744.HEIC
3003	PSM.5000.0004.0281	27/02/2025	Electronic File	IMG_1745.MOV
3004	PSM.5000.0004.0282	27/02/2025	Electronic File	IMG_1746.HEIC
3005	PSM.5000.0004.0283	27/02/2025	Electronic File	IMG_1747.HEIC
3006	PSM.5000.0004.0284	27/02/2025	Electronic File	IMG_1748.HEIC
3007	PSM.5000.0004.0285	27/02/2025	Electronic File	IMG_1749.HEIC
3008	PSM.5000.0004.0286	27/02/2025	Electronic File	IMG_1750.HEIC
3009	PSM.5000.0004.0287	27/02/2025	Electronic File	IMG_1751.HEIC
3010	PSM.5000.0004.0288	27/02/2025	Electronic File	IMG_1752.HEIC
3011	PSM.5000.0004.0289	27/02/2025	Electronic File	IMG_1753.HEIC
3012	PSM.5000.0004.0290	27/02/2025	Electronic File	IMG_1754.HEIC
3013	PSM.5000.0004.0291	27/02/2025	Electronic File	IMG_1755.HEIC
3014	PSM.5000.0004.0292	27/02/2025	Electronic File	IMG_1756.HEIC
3015	PSM.5000.0004.0293	27/02/2025	Electronic File	IMG_1757.HEIC
3016	PSM.5000.0004.0294	27/02/2025	Electronic File	IMG_1759.HEIC
3017	PSM.5000.0004.0295	27/02/2025	Electronic File	IMG_1760.HEIC
3018	PSM.5000.0004.0296	27/02/2025	Electronic File	IMG_3247.HEIC
3019	PSM.5000.0004.0297	27/02/2025	Electronic File	IMG_3248.HEIC
3020	PSM.5000.0004.0298	27/02/2025	Electronic File	IMG_3250.HEIC
3021	PSM.5000.0004.0299	27/02/2025	Electronic File	IMG_3251.HEIC
3022	PSM.5000.0004.0300	27/02/2025	Electronic File	IMG_3252.HEIC
3023	PSM.5000.0004.0301	27/02/2025	Electronic File	IMG_3253.HEIC
3024	PSM.5000.0004.0302	27/02/2025	Electronic File	IMG_3254.HEIC
3025	PSM.5000.0004.0303	27/02/2025	Electronic File	IMG_3255.HEIC

Count	Document ID	Document Date	Document Type	Title
3026	PSM.5000.0004.0304	27/02/2025	Electronic File	IMG_3256.HEIC
3027	PSM.5000.0004.0305	27/02/2025	Electronic File	IMG_3259.HEIC
3028	PSM.5000.0004.0306	27/02/2025	Electronic File	IMG_3260.HEIC
3029	PSM.5000.0004.0307	27/02/2025	Electronic File	IMG_3262.HEIC
3030	PSM.5000.0004.0308	27/02/2025	Electronic File	IMG_3263.HEIC
3031	PSM.5000.0004.0309	27/02/2025	Electronic File	IMG_3272.HEIC
3032	PSM.5000.0004.0310	27/02/2025	Electronic File	IMG_3222.HEIC
3033	PSM.5000.0004.0311	27/02/2025	Electronic File	IMG_3223.HEIC
3034	PSM.5000.0004.0312	27/02/2025	Electronic File	IMG_3227.HEIC
3035	PSM.5000.0004.0313	27/02/2025	Electronic File	IMG_3228.HEIC
3036	PSM.5000.0004.0314	27/02/2025	Electronic File	IMG_3229.HEIC
3037	PSM.5000.0004.0315	27/02/2025	Electronic File	IMG_3236.HEIC
3038	PSM.5000.0004.0316	27/02/2025	Electronic File	IMG_3237.HEIC
3039	PSM.5000.0004.0317	27/02/2025	Electronic File	IMG_3238.HEIC
3040	PSM.5000.0004.0318	27/02/2025	Electronic File	IMG_3242.HEIC
3041	PSM.5000.0004.0319	27/02/2025	Electronic File	IMG_3244.HEIC
3042	PSM.5000.0004.0320	27/02/2025	Electronic File	IMG_3245.HEIC
3043	PSM.5000.0004.0321	27/02/2025	Electronic File	IMG_3246.HEIC
3044	PSM.5000.0004.0322	27/02/2025	Electronic File	IMG_3249.HEIC
3045	PSM.5000.0004.0323	27/02/2025	Electronic File	IMG_3257.HEIC
3046	PSM.5000.0004.0324	27/02/2025	Electronic File	IMG_3258.HEIC
3047	PSM.5000.0004.0325	27/02/2025	Electronic File	IMG_3261.HEIC
3048	PSM.5000.0004.0326	27/02/2025	Electronic File	IMG_3266.HEIC
3049	PSM.5000.0004.0327	27/02/2025	Electronic File	IMG_3267.HEIC
3050	PSM.5000.0004.0328	27/02/2025	Electronic File	IMG_3268.HEIC
3051	PSM.5000.0004.0329	27/02/2025	Electronic File	IMG_3269.HEIC
3052	PSM.5000.0004.0330	27/02/2025	Electronic File	IMG_3270.HEIC
3053	PSM.5000.0004.0331	27/02/2025	Electronic File	IMG_3271.HEIC
3054	PSM.5000.0004.0332	27/02/2025	Electronic File	IMG_3273.HEIC
3055	PSM.5000.0004.0333	27/02/2025	Electronic File	IMG_3274.HEIC
3056	PSM.5000.0004.0334	27/02/2025	Electronic File	IMG_3275.HEIC
3057	PSM.5000.0004.0335	27/02/2025	Electronic File	IMG_3197.HEIC
3058	PSM.5000.0004.0336	27/02/2025	Electronic File	IMG_3208.HEIC
3059	PSM.5000.0004.0337	27/02/2025	Electronic File	IMG_3210.HEIC
3060	PSM.5000.0004.0338	27/02/2025	Electronic File	IMG_3212.HEIC
3061	PSM.5000.0004.0339	27/02/2025	Electronic File	IMG_3213.HEIC
3062	PSM.5000.0004.0340	27/02/2025	Electronic File	IMG_3216.HEIC
3063	PSM.5000.0004.0341	27/02/2025	Electronic File	IMG_3217.HEIC
3064	PSM.5000.0004.0342	27/02/2025	Electronic File	IMG_3218.HEIC
3065	PSM.5000.0004.0343	27/02/2025	Electronic File	IMG_3219.HEIC
3066	PSM.5000.0004.0344	27/02/2025	Electronic File	IMG_3220.HEIC
3067	PSM.5000.0004.0345	27/02/2025	Electronic File	IMG_3221.HEIC
3068	PSM.5000.0004.0346	27/02/2025	Electronic File	IMG_3224.HEIC
3069	PSM.5000.0004.0347	27/02/2025	Electronic File	IMG_3225.HEIC
3070	PSM.5000.0004.0348	27/02/2025	Electronic File	IMG_3226.HEIC
3071	PSM.5000.0004.0349	27/02/2025	Electronic File	IMG_3230.HEIC
3072	PSM.5000.0004.0350	27/02/2025	Electronic File	IMG_3231.HEIC
3073	PSM.5000.0004.0351	27/02/2025	Electronic File	IMG_3232.HEIC
3074	PSM.5000.0004.0352	27/02/2025	Electronic File	IMG_3233.HEIC
3075	PSM.5000.0004.0353	27/02/2025	Electronic File	IMG_3234.HEIC
3076	PSM.5000.0004.0354	27/02/2025	Electronic File	IMG_3235.HEIC
3077	PSM.5000.0004.0355	27/02/2025	Electronic File	IMG_3239.HEIC
3078	PSM.5000.0004.0356	27/02/2025	Electronic File	IMG_3240.HEIC
3079	PSM.5000.0004.0357	27/02/2025	Electronic File	IMG_3241.HEIC
3080	PSM.5000.0004.0358	27/02/2025	Electronic File	IMG_3243.HEIC

Count	Document ID	Document Date	Document Type	Title
3081	PSM.5000.0004.0359	27/02/2025	Electronic File	IMG_3276.HEIC
3082	PSM.5000.0004.0360	27/02/2025	Electronic File	IMG_3184.HEIC
3083	PSM.5000.0004.0361	27/02/2025	Electronic File	IMG_3185.HEIC
3084	PSM.5000.0004.0362	27/02/2025	Electronic File	IMG_3186.HEIC
3085	PSM.5000.0004.0363	27/02/2025	Electronic File	IMG_3187.HEIC
3086	PSM.5000.0004.0364	27/02/2025	Electronic File	IMG_3188.HEIC
3087	PSM.5000.0004.0365	27/02/2025	Electronic File	IMG_3189.HEIC
3088	PSM.5000.0004.0366	27/02/2025	Electronic File	IMG_3190.HEIC
3089	PSM.5000.0004.0367	27/02/2025	Electronic File	IMG_3191.HEIC
3090	PSM.5000.0004.0368	27/02/2025	Electronic File	IMG_3192.HEIC
3091	PSM.5000.0004.0369	27/02/2025	Electronic File	IMG_3193.HEIC
3092	PSM.5000.0004.0370	27/02/2025	Electronic File	IMG_3194.HEIC
3093	PSM.5000.0004.0371	27/02/2025	Electronic File	IMG_3195.HEIC
3094	PSM.5000.0004.0372	27/02/2025	Electronic File	IMG_3196.HEIC
3095	PSM.5000.0004.0373	27/02/2025	Electronic File	IMG_3206.HEIC
3096	PSM.5000.0004.0374	27/02/2025	Electronic File	IMG_3207.HEIC
3097	PSM.5000.0004.0375	27/02/2025	Electronic File	IMG_3209.HEIC
3098	PSM.5000.0004.0376	27/02/2025	Electronic File	IMG_3211.HEIC
3099	PSM.5000.0004.0377	27/02/2025	Electronic File	IMG_3214.HEIC
3100	PSM.5000.0004.0378	27/02/2025	Electronic File	IMG_3215.HEIC
3101	PSM.5000.0004.0379	28/02/2025	Electronic File	IMG_1761.HEIC
3102	PSM.5000.0004.0380	28/02/2025	Electronic File	IMG_1762.PNG
3103	PSM.5000.0004.0381	28/02/2025	Electronic File	IMG_1763.HEIC
3104	PSM.5000.0004.0382	28/02/2025	Electronic File	IMG_1764.HEIC
3105	PSM.5000.0004.0383	28/02/2025	Electronic File	IMG_1765.HEIC
3106	PSM.5000.0004.0384	28/02/2025	Electronic File	IMG_1766.HEIC
3107	PSM.5000.0004.0385	28/02/2025	Electronic File	IMG_1767.HEIC
3108	PSM.5000.0004.0386	28/02/2025	Electronic File	IMG_1768.HEIC
3109	PSM.5000.0004.0387	28/02/2025	Electronic File	IMG_1769.HEIC
3110	PSM.5000.0004.0388	28/02/2025	Electronic File	IMG_1770.HEIC
3111	PSM.5000.0004.0389	28/02/2025	Electronic File	IMG_1771.HEIC
3112	PSM.5000.0004.0390	28/02/2025	Electronic File	IMG_1772.HEIC
3113	PSM.5000.0004.0391	28/02/2025	Electronic File	IMG_1773.HEIC
3114	PSM.5000.0004.0392	28/02/2025	Electronic File	IMG_1774.HEIC
3115	PSM.5000.0004.0393	28/02/2025	Electronic File	IMG_1775.HEIC
3116	PSM.5000.0004.0394	28/02/2025	Electronic File	IMG_1776.HEIC
3117	PSM.5000.0004.0395	28/02/2025	Electronic File	IMG_1777.HEIC
3118	PSM.5000.0004.0396	28/02/2025	Electronic File	IMG_1778.HEIC
3119	PSM.5000.0004.0397	28/02/2025	Electronic File	IMG_1779.HEIC
3120	PSM.5000.0004.0398	28/02/2025	Electronic File	IMG_1780.HEIC
3121	PSM.5000.0004.0399	28/02/2025	Electronic File	IMG_1781.HEIC
3122	PSM.5000.0004.0400	28/02/2025	Electronic File	IMG_1782.HEIC
3123	PSM.5000.0004.0401	28/02/2025	Electronic File	IMG_1783.HEIC
3124	PSM.5000.0004.0402	28/02/2025	Electronic File	IMG_1784.HEIC
3125	PSM.5000.0004.0403	28/02/2025	Electronic File	IMG_1785.HEIC
3126	PSM.5000.0004.0404	28/02/2025	Electronic File	IMG_1786.HEIC
3127	PSM.5000.0004.0405	28/02/2025	Electronic File	IMG_1787.HEIC
3128	PSM.5000.0004.0406	28/02/2025	Electronic File	IMG_1788.HEIC
3129	PSM.5000.0004.0407	28/02/2025	Electronic File	IMG_1789.HEIC
3130	PSM.5000.0004.0408	28/02/2025	Electronic File	K205_CPT-01B_D.xls
3131	PSM.5000.0004.0409	28/02/2025	Electronic File	K205_CPT-04A_D.xls
3132	PSM.5000.0004.0410	28/02/2025	Electronic File	K205_CPT-05_D01.xls
3133	PSM.5000.0004.0411	28/02/2025	Electronic File	L019_CPT-03_D01.xls
3134	PSM.5000.0004.0412	28/02/2025	Electronic File	K205_CPT-01.PDF
3135	PSM.5000.0004.0413	28/02/2025	Electronic File	K205_CPT-01.xls

Count	Document ID	Document Date	Document Type	Title
3136	PSM.5000.0004.0414	28/02/2025	Electronic File	K205_CPT-01.GEF
3137	PSM.5000.0004.0424	28/02/2025	Electronic File	K205_CPT-01B.PDF
3138	PSM.5000.0004.0427	28/02/2025	Electronic File	K205_CPT-01B.xls
3139	PSM.5000.0004.0428	28/02/2025	Electronic File	K205_CPT-01B.GEF
3140	PSM.5000.0004.0471	28/02/2025	Electronic File	K205_CPT-01B_D01.GEF
3141	PSM.5000.0004.0482	28/02/2025	Electronic File	K205_CPT-01B_D02.GEF
3142	PSM.5000.0004.0492	28/02/2025	Electronic File	IMG_1790.HEIC
3143	PSM.5000.0004.0493	28/02/2025	Electronic File	IMG_1791.HEIC
3144	PSM.5000.0004.0494	28/02/2025	Electronic File	K205_CPT-04A.PDF
3145	PSM.5000.0004.0497	28/02/2025	Electronic File	K205_CPT-04A.xls
3146	PSM.5000.0004.0498	28/02/2025	Electronic File	K205_CPT-04A.GEF
3147	PSM.5000.0004.0537	28/02/2025	Electronic File	K205_CPT-04A_D01.GEF
3148	PSM.5000.0004.0547	28/02/2025	Electronic File	K205_CPT-04A_D02.GEF
3149	PSM.5000.0004.0557	28/02/2025	Electronic File	IMG_1792.HEIC
3150	PSM.5000.0004.0558	28/02/2025	Electronic File	K205_CPT-04.PDF
3151	PSM.5000.0004.0559	28/02/2025	Electronic File	K205_CPT-04.xls
3152	PSM.5000.0004.0560	28/02/2025	Electronic File	K205_CPT-04.GEF
3153	PSM.5000.0004.0567	28/02/2025	Electronic File	L019_CPT-01A.PDF
3154	PSM.5000.0004.0568	28/02/2025	Electronic File	L019_CPT-01A.xls
3155	PSM.5000.0004.0569	28/02/2025	Electronic File	L019_CPT-01A.GEF
3156	PSM.5000.0004.0580	28/02/2025	Electronic File	L019_CPT-03.PDF
3157	PSM.5000.0004.0582	28/02/2025	Electronic File	L019_CPT-03.xls
3158	PSM.5000.0004.0583	28/02/2025	Electronic File	L019_CPT-03.GEF
3159	PSM.5000.0004.0593	28/02/2025	Electronic File	L019_CPT-03_D01.GEF
3160	PSM.5000.0004.0604	28/02/2025	Electronic File	IMG_1793.HEIC
3161	PSM.5000.0004.0605	28/02/2025	Electronic File	IMG_1794.HEIC
3162	PSM.5000.0004.0606	28/02/2025	Electronic File	IMG_1795.HEIC
3163	PSM.5000.0004.0607	28/02/2025	Electronic File	IMG_1796.HEIC
3164	PSM.5000.0004.0608	28/02/2025	Electronic File	IMG_1797.HEIC
3165	PSM.5000.0004.0609	28/02/2025	Electronic File	IMG_1798.HEIC
3166	PSM.5000.0004.0610	28/02/2025	Electronic File	K205_CPT-05.PDF
3167	PSM.5000.0004.0612	28/02/2025	Electronic File	K205_CPT-05.xls
3168	PSM.5000.0004.0613	28/02/2025	Electronic File	K205_CPT-05.GEF
3169	PSM.5000.0004.0622	28/02/2025	Electronic File	K205_CPT-05_D01.GEF
3170	PSM.5000.0004.0633	28/02/2025	Electronic File	20250228110953.pdf
3171	PSM.5000.0004.0636	28/02/2025	Electronic File	IMG_1799.HEIC
3172	PSM.5000.0004.0637	28/02/2025	Electronic File	IMG_1800.HEIC
3173	PSM.5000.0004.0638	28/02/2025	Electronic File	IMG_1801.HEIC
3174	PSM.5000.0004.0639	28/02/2025	Electronic File	IMG_1802.HEIC
3175	PSM.5000.0004.0640	28/02/2025	Electronic File	IMG_1803.HEIC
3176	PSM.5000.0004.0641	28/02/2025	Electronic File	IMG_1804.HEIC
3177	PSM.5000.0004.0642	28/02/2025	Electronic File	IMG_1805.HEIC
3178	PSM.5000.0004.0643	28/02/2025	Electronic File	IMG_1806.HEIC
3179	PSM.5000.0004.0644	28/02/2025	Electronic File	TH000419.JPG
3180	PSM.5000.0004.0645	28/02/2025	Electronic File	TH000420.JPG
3181	PSM.5000.0004.0646	28/02/2025	Electronic File	TH000421.JPG
3182	PSM.5000.0004.0647	28/02/2025	Electronic File	TH000422.JPG
3183	PSM.5000.0004.0648	28/02/2025	Electronic File	TH000423.JPG
3184	PSM.5000.0004.0649	28/02/2025	Electronic File	TH000424.JPG
3185	PSM.5000.0004.0650	28/02/2025	Electronic File	TH000425.JPG
3186	PSM.5000.0004.0651	28/02/2025	Electronic File	IMG_1814.HEIC
3187	PSM.5000.0004.0652	28/02/2025	Electronic File	IMG_1815.HEIC
3188	PSM.5000.0004.0653	28/02/2025	Electronic File	IMG_1816.HEIC
3189	PSM.5000.0004.0654	28/02/2025	Electronic File	IMG_1817.HEIC
3190	PSM.5000.0004.0655	28/02/2025	Electronic File	IMG_1818.HEIC

Count	Document ID	Document Date	Document Type	Title
3191	PSM.5000.0004.0656	28/02/2025	Electronic File	IMG_1819.HEIC
3192	PSM.5000.0004.0657	28/02/2025	Electronic File	IMG_1820.HEIC
3193	PSM.5000.0004.0658	28/02/2025	Electronic File	IMG_1821.HEIC
3194	PSM.5000.0004.0659	28/02/2025	Electronic File	TH000426.JPG
3195	PSM.5000.0004.0660	28/02/2025	Electronic File	TH000427.JPG
3196	PSM.5000.0004.0661	28/02/2025	Electronic File	IMG_1824.HEIC
3197	PSM.5000.0004.0662	28/02/2025	Electronic File	IMG_1825.HEIC
3198	PSM.5000.0004.0663	28/02/2025	Electronic File	IMG_1826.HEIC
3199	PSM.5000.0004.0664	28/02/2025	Electronic File	IMG_1827.HEIC
3200	PSM.5000.0004.0665	28/02/2025	Electronic File	IMG_1828.HEIC
3201	PSM.5000.0004.0666	28/02/2025	Electronic File	IMG_1829.HEIC
3202	PSM.5000.0004.0667	28/02/2025	Electronic File	IMG_1830.HEIC
3203	PSM.5000.0004.0668	28/02/2025	Electronic File	IMG_1831.PNG
3204	PSM.5000.0004.0669	28/02/2025	Electronic File	IMG_1832.PNG
3205	PSM.5000.0004.0670	3/03/2025	Electronic File	IMG_1852.HEIC
3206	PSM.5000.0004.0671	3/03/2025	Electronic File	IMG_1853.HEIC
3207	PSM.5000.0004.0672	3/03/2025	Electronic File	IMG_1854.HEIC
3208	PSM.5000.0004.0673	3/03/2025	Electronic File	IMG_1855.HEIC
3209	PSM.5000.0004.0674	3/03/2025	Electronic File	IMG_1856.HEIC
3210	PSM.5000.0004.0675	3/03/2025	Electronic File	IMG_1857.HEIC
3211	PSM.5000.0004.0676	3/03/2025	Electronic File	IMG_1858.HEIC
3212	PSM.5000.0004.0677	3/03/2025	Electronic File	IMG_1859.HEIC
3213	PSM.5000.0004.0678	3/03/2025	Electronic File	IMG_1860.HEIC
3214	PSM.5000.0004.0679	3/03/2025	Electronic File	IMG_3277.HEIC
3215	PSM.5000.0004.0680	3/03/2025	Electronic File	IMG_3279.HEIC
3216	PSM.5000.0004.0681	3/03/2025	Electronic File	IMG_3280.HEIC
3217	PSM.5000.0004.0682	3/03/2025	Electronic File	IMG_3282.HEIC
3218	PSM.5000.0004.0683	3/03/2025	Electronic File	IMG_3283.HEIC
3219	PSM.5000.0004.0684	3/03/2025	Electronic File	IMG_3284.HEIC
3220	PSM.5000.0004.0685	3/03/2025	Electronic File	IMG_3295.HEIC
3221	PSM.5000.0004.0686	3/03/2025	Electronic File	IMG_3298.HEIC
3222	PSM.5000.0004.0687	3/03/2025	Electronic File	IMG_3299.HEIC
3223	PSM.5000.0004.0688	3/03/2025	Electronic File	IMG_3301.HEIC
3224	PSM.5000.0004.0689	3/03/2025	Electronic File	IMG_3302.HEIC
3225	PSM.5000.0004.0690	3/03/2025	Electronic File	IMG_3303.HEIC
3226	PSM.5000.0004.0691	3/03/2025	Electronic File	IMG_3304.HEIC
3227	PSM.5000.0004.0692	3/03/2025	Electronic File	IMG_3305.HEIC
3228	PSM.5000.0004.0693	3/03/2025	Electronic File	IMG_3278.HEIC
3229	PSM.5000.0004.0694	3/03/2025	Electronic File	IMG_3281.HEIC
3230	PSM.5000.0004.0695	3/03/2025	Electronic File	IMG_3285.HEIC
3231	PSM.5000.0004.0696	3/03/2025	Electronic File	IMG_3286.HEIC
3232	PSM.5000.0004.0697	3/03/2025	Electronic File	IMG_3287.HEIC
3233	PSM.5000.0004.0698	3/03/2025	Electronic File	IMG_3288.HEIC
3234	PSM.5000.0004.0699	3/03/2025	Electronic File	IMG_3289.HEIC
3235	PSM.5000.0004.0700	3/03/2025	Electronic File	IMG_3290.HEIC
3236	PSM.5000.0004.0701	3/03/2025	Electronic File	IMG_3291.HEIC
3237	PSM.5000.0004.0702	3/03/2025	Electronic File	IMG_3292.HEIC
3238	PSM.5000.0004.0703	3/03/2025	Electronic File	IMG_3293.HEIC
3239	PSM.5000.0004.0704	3/03/2025	Electronic File	IMG_3294.HEIC
3240	PSM.5000.0004.0705	3/03/2025	Electronic File	IMG_3296.HEIC
3241	PSM.5000.0004.0706	3/03/2025	Electronic File	IMG_3297.HEIC
3242	PSM.5000.0004.0707	3/03/2025	Electronic File	IMG_3347.HEIC
3243	PSM.5000.0004.0708	3/03/2025	Electronic File	IMG_3361.HEIC
3244	PSM.5000.0004.0709	3/03/2025	Electronic File	IMG_3343.HEIC
3245	PSM.5000.0004.0710	3/03/2025	Electronic File	IMG_3345.HEIC

Count	Document ID	Document Date	Document Type	Title
3246	PSM.5000.0004.0711	3/03/2025	Electronic File	IMG_3348.HEIC
3247	PSM.5000.0004.0712	3/03/2025	Electronic File	IMG_3349.HEIC
3248	PSM.5000.0004.0713	3/03/2025	Electronic File	IMG_3350.HEIC
3249	PSM.5000.0004.0714	3/03/2025	Electronic File	IMG_3351.HEIC
3250	PSM.5000.0004.0715	3/03/2025	Electronic File	IMG_3352.HEIC
3251	PSM.5000.0004.0716	3/03/2025	Electronic File	IMG_3353.HEIC
3252	PSM.5000.0004.0717	3/03/2025	Electronic File	IMG_3354.HEIC
3253	PSM.5000.0004.0718	3/03/2025	Electronic File	IMG_3355.HEIC
3254	PSM.5000.0004.0719	3/03/2025	Electronic File	IMG_3359.HEIC
3255	PSM.5000.0004.0720	3/03/2025	Electronic File	IMG_3360.HEIC
3256	PSM.5000.0004.0721	3/03/2025	Electronic File	IMG_3362.HEIC
3257	PSM.5000.0004.0722	3/03/2025	Electronic File	IMG_3364.HEIC
3258	PSM.5000.0004.0723	3/03/2025	Electronic File	IMG_3366.HEIC
3259	PSM.5000.0004.0724	3/03/2025	Electronic File	IMG_3330.HEIC
3260	PSM.5000.0004.0725	3/03/2025	Electronic File	IMG_3331.HEIC
3261	PSM.5000.0004.0726	3/03/2025	Electronic File	IMG_3332.HEIC
3262	PSM.5000.0004.0727	3/03/2025	Electronic File	IMG_3333.HEIC
3263	PSM.5000.0004.0728	3/03/2025	Electronic File	IMG_3334.HEIC
3264	PSM.5000.0004.0729	3/03/2025	Electronic File	IMG_3335.HEIC
3265	PSM.5000.0004.0730	3/03/2025	Electronic File	IMG_3336.HEIC
3266	PSM.5000.0004.0731	3/03/2025	Electronic File	IMG_3337.HEIC
3267	PSM.5000.0004.0732	3/03/2025	Electronic File	IMG_3338.HEIC
3268	PSM.5000.0004.0733	3/03/2025	Electronic File	IMG_3339.HEIC
3269	PSM.5000.0004.0734	3/03/2025	Electronic File	IMG_3340.HEIC
3270	PSM.5000.0004.0735	3/03/2025	Electronic File	IMG_3341.HEIC
3271	PSM.5000.0004.0736	3/03/2025	Electronic File	IMG_3342.HEIC
3272	PSM.5000.0004.0737	3/03/2025	Electronic File	IMG_3344.HEIC
3273	PSM.5000.0004.0738	3/03/2025	Electronic File	IMG_3346.HEIC
3274	PSM.5000.0004.0739	3/03/2025	Electronic File	IMG_3356.HEIC
3275	PSM.5000.0004.0740	3/03/2025	Electronic File	IMG_3357.HEIC
3276	PSM.5000.0004.0741	3/03/2025	Electronic File	IMG_3358.HEIC
3277	PSM.5000.0004.0742	3/03/2025	Electronic File	IMG_3363.HEIC
3278	PSM.5000.0004.0743	3/03/2025	Electronic File	IMG_3365.HEIC
3279	PSM.5000.0004.0744	3/03/2025	Electronic File	IMG_3312.HEIC
3280	PSM.5000.0004.0745	3/03/2025	Electronic File	IMG_3313.HEIC
3281	PSM.5000.0004.0746	3/03/2025	Electronic File	IMG_3314.HEIC
3282	PSM.5000.0004.0747	3/03/2025	Electronic File	IMG_3315.HEIC
3283	PSM.5000.0004.0748	3/03/2025	Electronic File	IMG_3316.HEIC
3284	PSM.5000.0004.0749	3/03/2025	Electronic File	IMG_3317.HEIC
3285	PSM.5000.0004.0750	3/03/2025	Electronic File	IMG_3318.HEIC
3286	PSM.5000.0004.0751	3/03/2025	Electronic File	IMG_3319.HEIC
3287	PSM.5000.0004.0752	3/03/2025	Electronic File	IMG_3320.HEIC
3288	PSM.5000.0004.0753	3/03/2025	Electronic File	IMG_3321.HEIC
3289	PSM.5000.0004.0754	3/03/2025	Electronic File	IMG_3322.HEIC
3290	PSM.5000.0004.0755	3/03/2025	Electronic File	IMG_3323.HEIC
3291	PSM.5000.0004.0756	3/03/2025	Electronic File	IMG_3324.HEIC
3292	PSM.5000.0004.0757	3/03/2025	Electronic File	IMG_3325.HEIC
3293	PSM.5000.0004.0758	3/03/2025	Electronic File	IMG_3326.HEIC
3294	PSM.5000.0004.0759	3/03/2025	Electronic File	IMG_3327.HEIC
3295	PSM.5000.0004.0760	3/03/2025	Electronic File	IMG_3328.HEIC
3296	PSM.5000.0004.0761	3/03/2025	Electronic File	IMG_3329.HEIC
3297	PSM.5000.0004.0762	3/03/2025	Electronic File	IMG_1862.HEIC
3298	PSM.5000.0004.0763	3/03/2025	Electronic File	IMG_1863.HEIC
3299	PSM.5000.0004.0764	3/03/2025	Electronic File	IMG_1864.MOV
3300	PSM.5000.0004.0765	3/03/2025	Electronic File	IMG_1865.HEIC

Count	Document ID	Document Date	Document Type	Title
3301	PSM.5000.0004.0766	3/03/2025	Electronic File	IMG_1866.HEIC
3302	PSM.5000.0004.0767	3/03/2025	Electronic File	IMG_1867.HEIC
3303	PSM.5000.0004.0768	3/03/2025	Electronic File	IMG_1868.HEIC
3304	PSM.5000.0004.0769	3/03/2025	Electronic File	IMG_1869.HEIC
3305	PSM.5000.0004.0770	3/03/2025	Electronic File	IMG_1870.HEIC
3306	PSM.5000.0004.0771	3/03/2025	Electronic File	IMG_1871.HEIC
3307	PSM.5000.0004.0772	3/03/2025	Electronic File	IMG_1872.HEIC
3308	PSM.5000.0004.0773	3/03/2025	Electronic File	IMG_1873.HEIC
3309	PSM.5000.0004.0774	3/03/2025	Electronic File	IMG_1874.HEIC
3310	PSM.5000.0004.0775	3/03/2025	Electronic File	IMG_1875.HEIC
3311	PSM.5000.0004.0776	3/03/2025	Electronic File	IMG_1876.HEIC
3312	PSM.5000.0004.0777	3/03/2025	Electronic File	IMG_1877.HEIC
3313	PSM.5000.0004.0778	3/03/2025	Electronic File	IMG_1878.HEIC
3314	PSM.5000.0004.0779	3/03/2025	Electronic File	IMG_1879.HEIC
3315	PSM.5000.0004.0780	3/03/2025	Electronic File	IMG_1880.HEIC
3316	PSM.5000.0004.0781	3/03/2025	Electronic File	IMG_1881.HEIC
3317	PSM.5000.0004.0782	3/03/2025	Electronic File	IMG_1882.HEIC
3318	PSM.5000.0004.0783	3/03/2025	Electronic File	IMG_1883.HEIC
3319	PSM.5000.0004.0784	3/03/2025	Electronic File	IMG_1884.HEIC
3320	PSM.5000.0004.0785	3/03/2025	Electronic File	IMG_1885.HEIC
3321	PSM.5000.0004.0786	4/03/2025	Electronic File	McCrae_Pipes.cpg
3322	PSM.5000.0004.0787	4/03/2025	Electronic File	McCrae_Pipes.prj
3323	PSM.5000.0004.0788	4/03/2025	Electronic File	McCrae_Pipes.dbf
3324	PSM.5000.0004.0789	4/03/2025	Electronic File	McCrae_Pipes.shp
3325	PSM.5000.0004.0790	4/03/2025	Electronic File	McCrae_Pipes.shx
3326	PSM.5000.0004.0791	4/03/2025	Electronic File	McCrae_Pits.dbf
3327	PSM.5000.0004.0792	4/03/2025	Electronic File	McCrae_Pits.shp
3328	PSM.5000.0004.0793	4/03/2025	Electronic File	McCrae_Pits.shx
3329	PSM.5000.0004.0794	5/03/2025	Electronic File	20250304_071321.jpg
3330	PSM.5000.0004.0795	5/03/2025	Electronic File	20250304_070748.jpg
3331	PSM.5000.0004.0796	5/03/2025	Electronic File	20250304_070812.jpg
3332	PSM.5000.0004.0797	5/03/2025	Electronic File	20250304_071109.jpg
3333	PSM.5000.0004.0798	5/03/2025	Electronic File	20250304_071112.jpg
3334	PSM.5000.0004.0799	5/03/2025	Electronic File	20250304_071229.jpg
3335	PSM.5000.0004.0800	5/03/2025	Electronic File	20250304_071308.jpg
3336	PSM.5000.0004.0801	5/03/2025	Electronic File	20250304_072145.jpg
3337	PSM.5000.0004.0802	5/03/2025	Electronic File	20250304_081231.jpg
3338	PSM.5000.0004.0803	5/03/2025	Electronic File	20250304_070441.jpg
3339	PSM.5000.0004.0804	5/03/2025	Electronic File	20250304_070516.jpg
3340	PSM.5000.0004.0805	5/03/2025	Electronic File	20250304_070517.jpg
3341	PSM.5000.0004.0806	5/03/2025	Electronic File	20250304_070519.jpg
3342	PSM.5000.0004.0807	5/03/2025	Electronic File	20250304_070744.jpg
3343	PSM.5000.0004.0808	5/03/2025	Electronic File	20250304_070745.jpg
3344	PSM.5000.0004.0809	5/03/2025	Electronic File	20250304_070814.jpg
3345	PSM.5000.0004.0810	5/03/2025	Electronic File	20250304_071059.jpg
3346	PSM.5000.0004.0811	5/03/2025	Electronic File	20250304_071101.jpg
3347	PSM.5000.0004.0812	5/03/2025	Electronic File	20250303_141623.jpg
3348	PSM.5000.0004.0813	5/03/2025	Electronic File	20250304_070308.jpg
3349	PSM.5000.0004.0814	5/03/2025	Electronic File	20250304_070311.jpg
3350	PSM.5000.0004.0815	5/03/2025	Electronic File	20250304_070312.jpg
3351	PSM.5000.0004.0816	5/03/2025	Electronic File	20250304_070434.jpg
3352	PSM.5000.0004.0817	5/03/2025	Electronic File	20250304_070437.jpg
3353	PSM.5000.0004.0818	5/03/2025	Electronic File	20250304_070438.jpg
3354	PSM.5000.0004.0819	5/03/2025	Electronic File	20250304_070444.jpg
3355	PSM.5000.0004.0820	5/03/2025	Electronic File	20250304_070524.jpg

Count	Document ID	Document Date	Document Type	Title
3356	PSM.5000.0004.0821	5/03/2025	Electronic File	20250303_094031.jpg
3357	PSM.5000.0004.0822	5/03/2025	Electronic File	20250303_094851.jpg
3358	PSM.5000.0004.0823	5/03/2025	Electronic File	20250303_101501.jpg
3359	PSM.5000.0004.0824	5/03/2025	Electronic File	20250303_101509.jpg
3360	PSM.5000.0004.0825	5/03/2025	Electronic File	20250303_103805.jpg
3361	PSM.5000.0004.0826	5/03/2025	Electronic File	20250303_115534.jpg
3362	PSM.5000.0004.0827	5/03/2025	Electronic File	20250303_141621.jpg
3363	PSM.5000.0004.0828	5/03/2025	Electronic File	20250303_141644.jpg
3364	PSM.5000.0004.0829	5/03/2025	Electronic File	20250303_142034.jpg
3365	PSM.5000.0004.0830	5/03/2025	Electronic File	20250228_142231.jpg
3366	PSM.5000.0004.0831	5/03/2025	Electronic File	20250228_142242.jpg
3367	PSM.5000.0004.0832	5/03/2025	Electronic File	20250228_142248.jpg
3368	PSM.5000.0004.0833	5/03/2025	Electronic File	20250303_083641.jpg
3369	PSM.5000.0004.0834	5/03/2025	Electronic File	20250303_083643.jpg
3370	PSM.5000.0004.0835	5/03/2025	Electronic File	20250303_083652.jpg
3371	PSM.5000.0004.0836	5/03/2025	Electronic File	20250303_091917.jpg
3372	PSM.5000.0004.0837	5/03/2025	Electronic File	20250303_103758.jpg
3373	PSM.5000.0004.0838	5/03/2025	Electronic File	20250303_141624.jpg
3374	PSM.5000.0004.0839	5/03/2025	Electronic File	20250303_141648.jpg
3375	PSM.5000.0004.0840	5/03/2025	Electronic File	20250228_131301.jpg
3376	PSM.5000.0004.0841	5/03/2025	Electronic File	20250228_131305.jpg
3377	PSM.5000.0004.0842	5/03/2025	Electronic File	20250228_135258.jpg
3378	PSM.5000.0004.0843	5/03/2025	Electronic File	20250228_140053.jpg
3379	PSM.5000.0004.0844	5/03/2025	Electronic File	20250228_143825.jpg
3380	PSM.5000.0004.0845	5/03/2025	Electronic File	20250228_143843.jpg
3381	PSM.5000.0004.0846	5/03/2025	Electronic File	20250303_084317.jpg
3382	PSM.5000.0004.0847	5/03/2025	Electronic File	20250303_091915.jpg
3383	PSM.5000.0004.0848	5/03/2025	Electronic File	20250303_141647.jpg
3384	PSM.5000.0004.0849	5/03/2025	Electronic File	20250228_105857.jpg
3385	PSM.5000.0004.0850	5/03/2025	Electronic File	20250228_110109.jpg
3386	PSM.5000.0004.0851	5/03/2025	Electronic File	20250228_111007.jpg
3387	PSM.5000.0004.0852	5/03/2025	Electronic File	20250228_111009.jpg
3388	PSM.5000.0004.0853	5/03/2025	Electronic File	20250228_125839.jpg
3389	PSM.5000.0004.0854	5/03/2025	Electronic File	20250228_135248.jpg
3390	PSM.5000.0004.0855	5/03/2025	Electronic File	20250228_142106.jpg
3391	PSM.5000.0004.0856	5/03/2025	Electronic File	20250228_142107.jpg
3392	PSM.5000.0004.0857	5/03/2025	Electronic File	20250228_142109.jpg
3393	PSM.5000.0004.0858	5/03/2025	Electronic File	20250228_143841.jpg
3394	PSM.5000.0004.0859	5/03/2025	Electronic File	20250228_105855.jpg
3395	PSM.5000.0004.0860	5/03/2025	Electronic File	20250228_110104.jpg
3396	PSM.5000.0004.0861	5/03/2025	Electronic File	20250228_110318.jpg
3397	PSM.5000.0004.0862	5/03/2025	Electronic File	20250228_110331.jpg
3398	PSM.5000.0004.0863	5/03/2025	Electronic File	20250228_111017.jpg
3399	PSM.5000.0004.0864	5/03/2025	Electronic File	20250228_122550.jpg
3400	PSM.5000.0004.0865	5/03/2025	Electronic File	20250228_125523.jpg
3401	PSM.5000.0004.0866	5/03/2025	Electronic File	20250228_125722.jpg
3402	PSM.5000.0004.0867	5/03/2025	Electronic File	20250228_130441.jpg
3403	PSM.5000.0004.0868	5/03/2025	Electronic File	20250228_140041.jpg
3404	PSM.5000.0004.0869	5/03/2025	Electronic File	20250228_093936.jpg
3405	PSM.5000.0004.0870	5/03/2025	Electronic File	20250228_093938.jpg
3406	PSM.5000.0004.0871	5/03/2025	Electronic File	20250228_093939.jpg
3407	PSM.5000.0004.0872	5/03/2025	Electronic File	20250228_093955.jpg
3408	PSM.5000.0004.0873	5/03/2025	Electronic File	20250228_093959.jpg
3409	PSM.5000.0004.0874	5/03/2025	Electronic File	20250228_104418.jpg
3410	PSM.5000.0004.0875	5/03/2025	Electronic File	20250228_105905.jpg

Count	Document ID	Document Date	Document Type	Title
3411	PSM.5000.0004.0876	5/03/2025	Electronic File	20250228_110058.jpg
3412	PSM.5000.0004.0877	5/03/2025	Electronic File	20250228_111025.jpg
3413	PSM.5000.0004.0878	5/03/2025	Electronic File	20250228_135250.jpg
3414	PSM.5000.0004.0879	5/03/2025	Electronic File	20250228_080210.jpg
3415	PSM.5000.0004.0880	5/03/2025	Electronic File	20250228_080211.jpg
3416	PSM.5000.0004.0881	5/03/2025	Electronic File	20250228_093925.jpg
3417	PSM.5000.0004.0882	5/03/2025	Electronic File	20250228_093948.jpg
3418	PSM.5000.0004.0883	5/03/2025	Electronic File	20250228_093949.jpg
3419	PSM.5000.0004.0884	5/03/2025	Electronic File	20250228_093957.jpg
3420	PSM.5000.0004.0885	5/03/2025	Electronic File	20250228_094007.jpg
3421	PSM.5000.0004.0886	5/03/2025	Electronic File	20250228_115127.jpg
3422	PSM.5000.0004.0887	5/03/2025	Electronic File	20250228_125656.jpg
3423	PSM.5000.0004.0888	5/03/2025	Electronic File	20250227_123406.jpg
3424	PSM.5000.0004.0889	5/03/2025	Electronic File	20250227_124201.jpg
3425	PSM.5000.0004.0890	5/03/2025	Electronic File	20250227_124635.jpg
3426	PSM.5000.0004.0891	5/03/2025	Electronic File	20250228_125702.jpg
3427	PSM.5000.0004.0892	5/03/2025	Electronic File	20250228_130358.jpg
3428	PSM.5000.0004.0893	5/03/2025	Electronic File	20250228_130445.jpg
3429	PSM.5000.0004.0894	5/03/2025	Electronic File	20250228_131022.jpg
3430	PSM.5000.0004.0895	5/03/2025	Electronic File	20250228_143838.jpg
3431	PSM.5000.0004.0896	5/03/2025	Electronic File	20250227_123139.jpg
3432	PSM.5000.0004.0897	5/03/2025	Electronic File	20250227_123308.jpg
3433	PSM.5000.0004.0898	5/03/2025	Electronic File	20250227_124443.jpg
3434	PSM.5000.0004.0899	5/03/2025	Electronic File	20250227_124446.jpg
3435	PSM.5000.0004.0900	5/03/2025	Electronic File	20250227_124617.jpg
3436	PSM.5000.0004.0901	5/03/2025	Electronic File	20250228_130355.jpg
3437	PSM.5000.0004.0902	5/03/2025	Electronic File	20250228_130400.jpg
3438	PSM.5000.0004.0903	5/03/2025	Electronic File	20250228_130457.jpg
3439	PSM.5000.0004.0904	5/03/2025	Electronic File	20250227_122841.jpg
3440	PSM.5000.0004.0905	5/03/2025	Electronic File	20250227_122912.jpg
3441	PSM.5000.0004.0906	5/03/2025	Electronic File	20250227_122918.jpg
3442	PSM.5000.0004.0907	5/03/2025	Electronic File	20250227_123209.jpg
3443	PSM.5000.0004.0908	5/03/2025	Electronic File	20250227_123310.jpg
3444	PSM.5000.0004.0909	5/03/2025	Electronic File	20250227_123359.jpg
3445	PSM.5000.0004.0910	5/03/2025	Electronic File	20250227_123408.jpg
3446	PSM.5000.0004.0911	5/03/2025	Electronic File	20250228_093931.jpg
3447	PSM.5000.0004.0912	5/03/2025	Electronic File	20250228_104412.jpg
3448	PSM.5000.0004.0913	5/03/2025	Electronic File	20250227_122614.jpg
3449	PSM.5000.0004.0914	5/03/2025	Electronic File	20250227_122751.jpg
3450	PSM.5000.0004.0915	5/03/2025	Electronic File	20250227_122837.jpg
3451	PSM.5000.0004.0916	5/03/2025	Electronic File	20250227_122917.jpg
3452	PSM.5000.0004.0917	5/03/2025	Electronic File	20250227_123319.jpg
3453	PSM.5000.0004.0918	5/03/2025	Electronic File	20250228_080208.jpg
3454	PSM.5000.0004.0919	5/03/2025	Electronic File	20250228_080928.jpg
3455	PSM.5000.0004.0920	5/03/2025	Electronic File	20250228_093930.jpg
3456	PSM.5000.0004.0921	5/03/2025	Electronic File	20250227_122046.jpg
3457	PSM.5000.0004.0922	5/03/2025	Electronic File	20250227_122050.jpg
3458	PSM.5000.0004.0923	5/03/2025	Electronic File	20250227_122241.jpg
3459	PSM.5000.0004.0924	5/03/2025	Electronic File	20250227_122251.jpg
3460	PSM.5000.0004.0925	5/03/2025	Electronic File	20250227_122839.jpg
3461	PSM.5000.0004.0926	5/03/2025	Electronic File	20250227_124638.jpg
3462	PSM.5000.0004.0927	5/03/2025	Electronic File	20250227_124639.jpg
3463	PSM.5000.0004.0928	5/03/2025	Electronic File	20250228_080212.jpg
3464	PSM.5000.0004.0929	5/03/2025	Electronic File	20250227_121852.jpg
3465	PSM.5000.0004.0930	5/03/2025	Electronic File	20250227_121934.jpg

Count	Document ID	Document Date	Document Type	Title
3466	PSM.5000.0004.0931	5/03/2025	Electronic File	20250227_121935.jpg
3467	PSM.5000.0004.0932	5/03/2025	Electronic File	20250227_121946.jpg
3468	PSM.5000.0004.0933	5/03/2025	Electronic File	20250227_121948.jpg
3469	PSM.5000.0004.0934	5/03/2025	Electronic File	20250227_122048.jpg
3470	PSM.5000.0004.0935	5/03/2025	Electronic File	20250227_122252.jpg
3471	PSM.5000.0004.0936	5/03/2025	Electronic File	20250227_124444.jpg
3472	PSM.5000.0004.0937	5/03/2025	Electronic File	20250227_124636.jpg
3473	PSM.5000.0004.0938	5/03/2025	Electronic File	20250227_115650.jpg
3474	PSM.5000.0004.0939	5/03/2025	Electronic File	20250227_121850.jpg
3475	PSM.5000.0004.0940	5/03/2025	Electronic File	20250227_121854.jpg
3476	PSM.5000.0004.0941	5/03/2025	Electronic File	20250227_121937.jpg
3477	PSM.5000.0004.0942	5/03/2025	Electronic File	20250227_122044.jpg
3478	PSM.5000.0004.0943	5/03/2025	Electronic File	20250227_122116.jpg
3479	PSM.5000.0004.0944	5/03/2025	Electronic File	20250227_124157.jpg
3480	PSM.5000.0004.0945	5/03/2025	Electronic File	20250227_124850.jpg
3481	PSM.5000.0004.0946	5/03/2025	Electronic File	20250227_124852.jpg
3482	PSM.5000.0004.0947	5/03/2025	Electronic File	20250227_112747.jpg
3483	PSM.5000.0004.0948	5/03/2025	Electronic File	20250227_115502.jpg
3484	PSM.5000.0004.0949	5/03/2025	Electronic File	20250227_115504.jpg
3485	PSM.5000.0004.0950	5/03/2025	Electronic File	20250227_115643.jpg
3486	PSM.5000.0004.0951	5/03/2025	Electronic File	20250227_115821.jpg
3487	PSM.5000.0004.0952	5/03/2025	Electronic File	20250227_121857.jpg
3488	PSM.5000.0004.0953	5/03/2025	Electronic File	20250227_121917.jpg
3489	PSM.5000.0004.0954	5/03/2025	Electronic File	20250227_123157.jpg
3490	PSM.5000.0004.0955	5/03/2025	Electronic File	20250227_124618.jpg
3491	PSM.5000.0004.0956	5/03/2025	Electronic File	20250227_113053.jpg
3492	PSM.5000.0004.0957	5/03/2025	Electronic File	20250227_115028.jpg
3493	PSM.5000.0004.0958	5/03/2025	Electronic File	20250227_115337.jpg
3494	PSM.5000.0004.0959	5/03/2025	Electronic File	20250227_115409.jpg
3495	PSM.5000.0004.0960	5/03/2025	Electronic File	20250227_123325.jpg
3496	PSM.5000.0004.0961	5/03/2025	Electronic File	20250227_123405.jpg
3497	PSM.5000.0004.0962	5/03/2025	Electronic File	20250227_124829.jpg
3498	PSM.5000.0004.0963	5/03/2025	Electronic File	20250227_111018.jpg
3499	PSM.5000.0004.0964	5/03/2025	Electronic File	20250227_112525.jpg
3500	PSM.5000.0004.0965	5/03/2025	Electronic File	20250227_115023.jpg
3501	PSM.5000.0004.0966	5/03/2025	Electronic File	20250227_115025.jpg
3502	PSM.5000.0004.0967	5/03/2025	Electronic File	20250227_115030.jpg
3503	PSM.5000.0004.0968	5/03/2025	Electronic File	20250227_115407.jpg
3504	PSM.5000.0004.0969	5/03/2025	Electronic File	20250227_115530.jpg
3505	PSM.5000.0004.0970	5/03/2025	Electronic File	20250227_123523.jpg
3506	PSM.5000.0004.0971	5/03/2025	Electronic File	20250227_110859.jpg
3507	PSM.5000.0004.0972	5/03/2025	Electronic File	20250227_110914.jpg
3508	PSM.5000.0004.0973	5/03/2025	Electronic File	20250227_110915.jpg
3509	PSM.5000.0004.0974	5/03/2025	Electronic File	20250227_110918.jpg
3510	PSM.5000.0004.0975	5/03/2025	Electronic File	20250227_123138.jpg
3511	PSM.5000.0004.0976	5/03/2025	Electronic File	20250227_123225.jpg
3512	PSM.5000.0004.0977	5/03/2025	Electronic File	20250227_123247.jpg
3513	PSM.5000.0004.0978	5/03/2025	Electronic File	20250227_124158.jpg
3514	PSM.5000.0004.0979	5/03/2025	Electronic File	20250227_124620.jpg
3515	PSM.5000.0004.0980	5/03/2025	Electronic File	20250227_100106.jpg
3516	PSM.5000.0004.0981	5/03/2025	Electronic File	20250227_110821.jpg
3517	PSM.5000.0004.0982	5/03/2025	Electronic File	20250227_110911.jpg
3518	PSM.5000.0004.0983	5/03/2025	Electronic File	20250227_122245.jpg
3519	PSM.5000.0004.0984	5/03/2025	Electronic File	20250227_122727.jpg
3520	PSM.5000.0004.0985	5/03/2025	Electronic File	20250227_122857.jpg

Count	Document ID	Document Date	Document Type	Title
3521	PSM.5000.0004.0986	5/03/2025	Electronic File	20250227_122915.jpg
3522	PSM.5000.0004.0987	5/03/2025	Electronic File	20250227_123044.jpg
3523	PSM.5000.0004.0988	5/03/2025	Electronic File	20250227_095824.jpg
3524	PSM.5000.0004.0989	5/03/2025	Electronic File	20250227_095938.jpg
3525	PSM.5000.0004.0990	5/03/2025	Electronic File	20250227_100000.jpg
3526	PSM.5000.0004.0991	5/03/2025	Electronic File	20250227_110835.jpg
3527	PSM.5000.0004.0992	5/03/2025	Electronic File	20250227_110839.jpg
3528	PSM.5000.0004.0993	5/03/2025	Electronic File	20250227_122238.jpg
3529	PSM.5000.0004.0994	5/03/2025	Electronic File	20250227_122620.jpg
3530	PSM.5000.0004.0995	5/03/2025	Electronic File	20250227_122629.jpg
3531	PSM.5000.0004.0996	5/03/2025	Electronic File	20250227_122723.jpg
3532	PSM.5000.0004.0997	5/03/2025	Electronic File	20250227_095459.jpg
3533	PSM.5000.0004.0998	5/03/2025	Electronic File	20250227_095619.jpg
3534	PSM.5000.0004.0999	5/03/2025	Electronic File	20250227_095621.jpg
3535	PSM.5000.0004.1000	5/03/2025	Electronic File	20250227_095834.jpg
3536	PSM.5000.0004.1001	5/03/2025	Electronic File	20250227_095837.jpg
3537	PSM.5000.0004.1002	5/03/2025	Electronic File	20250227_095945.jpg
3538	PSM.5000.0004.1003	5/03/2025	Electronic File	20250227_122043.jpg
3539	PSM.5000.0004.1004	5/03/2025	Electronic File	20250227_122627.jpg
3540	PSM.5000.0004.1005	5/03/2025	Electronic File	20250227_122631.jpg
3541	PSM.5000.0004.1006	5/03/2025	Electronic File	20250227_095142.jpg
3542	PSM.5000.0004.1007	5/03/2025	Electronic File	20250227_095201.jpg
3543	PSM.5000.0004.1008	5/03/2025	Electronic File	20250227_095316.jpg
3544	PSM.5000.0004.1009	5/03/2025	Electronic File	20250227_095359.jpg
3545	PSM.5000.0004.1010	5/03/2025	Electronic File	20250227_095840.jpg
3546	PSM.5000.0004.1011	5/03/2025	Electronic File	20250227_122113.jpg
3547	PSM.5000.0004.1012	5/03/2025	Electronic File	20250227_122115.jpg
3548	PSM.5000.0004.1013	5/03/2025	Electronic File	20250227_122239.jpg
3549	PSM.5000.0004.1014	5/03/2025	Electronic File	20250227_122626.jpg
3550	PSM.5000.0004.1015	5/03/2025	Electronic File	20250227_094657.jpg
3551	PSM.5000.0004.1016	5/03/2025	Electronic File	20250227_094952.jpg
3552	PSM.5000.0004.1017	5/03/2025	Electronic File	20250227_095210.jpg
3553	PSM.5000.0004.1018	5/03/2025	Electronic File	20250227_095211.jpg
3554	PSM.5000.0004.1019	5/03/2025	Electronic File	20250227_095237.jpg
3555	PSM.5000.0004.1020	5/03/2025	Electronic File	20250227_095456.jpg
3556	PSM.5000.0004.1021	5/03/2025	Electronic File	20250227_095725.jpg
3557	PSM.5000.0004.1022	5/03/2025	Electronic File	20250227_115825.jpg
3558	PSM.5000.0004.1023	5/03/2025	Electronic File	20250227_121919.jpg
3559	PSM.5000.0004.1024	5/03/2025	Electronic File	20250227_094508.jpg
3560	PSM.5000.0004.1025	5/03/2025	Electronic File	20250227_094632.jpg
3561	PSM.5000.0004.1026	5/03/2025	Electronic File	20250227_095143.jpg
3562	PSM.5000.0004.1027	5/03/2025	Electronic File	20250227_095309.jpg
3563	PSM.5000.0004.1028	5/03/2025	Electronic File	20250227_115529.jpg
3564	PSM.5000.0004.1029	5/03/2025	Electronic File	20250227_115641.jpg
3565	PSM.5000.0004.1030	5/03/2025	Electronic File	20250227_115827.jpg
3566	PSM.5000.0004.1031	5/03/2025	Electronic File	20250227_122243.jpg
3567	PSM.5000.0004.1032	5/03/2025	Electronic File	20250226_175736.jpg
3568	PSM.5000.0004.1033	5/03/2025	Electronic File	20250227_084724.jpg
3569	PSM.5000.0004.1034	5/03/2025	Electronic File	20250227_094013.jpg
3570	PSM.5000.0004.1035	5/03/2025	Electronic File	20250227_094120.jpg
3571	PSM.5000.0004.1036	5/03/2025	Electronic File	20250227_094447.jpg
3572	PSM.5000.0004.1037	5/03/2025	Electronic File	20250227_095146.jpg
3573	PSM.5000.0004.1038	5/03/2025	Electronic File	20250227_111047.jpg
3574	PSM.5000.0004.1039	5/03/2025	Electronic File	20250227_115020.jpg
3575	PSM.5000.0004.1040	5/03/2025	Electronic File	20250227_115354.jpg

Count	Document ID	Document Date	Document Type	Title
3576	PSM.5000.0004.1041	5/03/2025	Electronic File	20250226_151151.jpg
3577	PSM.5000.0004.1042	5/03/2025	Electronic File	20250226_174419.jpg
3578	PSM.5000.0004.1043	5/03/2025	Electronic File	20250227_074551.jpg
3579	PSM.5000.0004.1044	5/03/2025	Electronic File	20250227_084726.jpg
3580	PSM.5000.0004.1045	5/03/2025	Electronic File	20250227_084730.jpg
3581	PSM.5000.0004.1046	5/03/2025	Electronic File	20250227_094133.jpg
3582	PSM.5000.0004.1047	5/03/2025	Electronic File	20250227_094137.jpg
3583	PSM.5000.0004.1048	5/03/2025	Electronic File	20250227_094349.jpg
3584	PSM.5000.0004.1049	5/03/2025	Electronic File	20250227_094457.jpg
3585	PSM.5000.0004.1050	5/03/2025	Electronic File	20250227_112743.jpg
3586	PSM.5000.0004.1051	5/03/2025	Electronic File	20250226_131349.jpg
3587	PSM.5000.0004.1052	5/03/2025	Electronic File	20250226_171534.jpg
3588	PSM.5000.0004.1053	5/03/2025	Electronic File	20250227_084736.jpg
3589	PSM.5000.0004.1054	5/03/2025	Electronic File	20250227_093523.jpg
3590	PSM.5000.0004.1055	5/03/2025	Electronic File	20250227_094008.jpg
3591	PSM.5000.0004.1056	5/03/2025	Electronic File	20250227_094629.jpg
3592	PSM.5000.0004.1057	5/03/2025	Electronic File	20250227_111010.jpg
3593	PSM.5000.0004.1058	5/03/2025	Electronic File	20250227_111020.jpg
3594	PSM.5000.0004.1059	5/03/2025	Electronic File	20250227_115405.jpg
3595	PSM.5000.0004.1060	5/03/2025	Electronic File	20250226_071358.jpg
3596	PSM.5000.0004.1061	5/03/2025	Electronic File	20250226_114351.jpg
3597	PSM.5000.0004.1062	5/03/2025	Electronic File	20250226_134537.jpg
3598	PSM.5000.0004.1063	5/03/2025	Electronic File	20250226_162041.jpg
3599	PSM.5000.0004.1064	5/03/2025	Electronic File	20250227_084733.jpg
3600	PSM.5000.0004.1065	5/03/2025	Electronic File	20250227_094352.jpg
3601	PSM.5000.0004.1066	5/03/2025	Electronic File	20250227_100040.jpg
3602	PSM.5000.0004.1067	5/03/2025	Electronic File	20250227_115340.jpg
3603	PSM.5000.0004.1068	5/03/2025	Electronic File	20250226_071207.jpg
3604	PSM.5000.0004.1069	5/03/2025	Electronic File	20250226_071224.jpg
3605	PSM.5000.0004.1070	5/03/2025	Electronic File	20250226_092732.jpg
3606	PSM.5000.0004.1071	5/03/2025	Electronic File	20250227_110816.jpg
3607	PSM.5000.0004.1072	5/03/2025	Electronic File	20250227_110942.jpg
3608	PSM.5000.0004.1073	5/03/2025	Electronic File	20250227_110946.jpg
3609	PSM.5000.0004.1074	5/03/2025	Electronic File	20250227_110951.jpg
3610	PSM.5000.0004.1075	5/03/2025	Electronic File	20250226_071342.jpg
3611	PSM.5000.0004.1076	5/03/2025	Electronic File	20250226_071345.jpg
3612	PSM.5000.0004.1077	5/03/2025	Electronic File	20250226_083557.jpg
3613	PSM.5000.0004.1078	5/03/2025	Electronic File	20250226_092727.jpg
3614	PSM.5000.0004.1079	5/03/2025	Electronic File	20250226_115450.jpg
3615	PSM.5000.0004.1080	5/03/2025	Electronic File	20250226_131352.jpg
3616	PSM.5000.0004.1081	5/03/2025	Electronic File	20250227_084720.jpg
3617	PSM.5000.0004.1082	5/03/2025	Electronic File	20250227_100036.jpg
3618	PSM.5000.0004.1083	5/03/2025	Electronic File	20250227_110845.jpg
3619	PSM.5000.0004.1084	5/03/2025	Electronic File	20250226_071332.jpg
3620	PSM.5000.0004.1085	5/03/2025	Electronic File	20250226_071338.jpg
3621	PSM.5000.0004.1086	5/03/2025	Electronic File	20250226_110416.jpg
3622	PSM.5000.0004.1087	5/03/2025	Electronic File	20250226_110420.jpg
3623	PSM.5000.0004.1088	5/03/2025	Electronic File	20250226_115454.jpg
3624	PSM.5000.0004.1089	5/03/2025	Electronic File	20250226_165428.jpg
3625	PSM.5000.0004.1090	5/03/2025	Electronic File	20250224_170338.jpg
3626	PSM.5000.0004.1091	5/03/2025	Electronic File	20250225_073111.jpg
3627	PSM.5000.0004.1092	5/03/2025	Electronic File	20250225_081335.jpg
3628	PSM.5000.0004.1093	5/03/2025	Electronic File	20250226_071340.jpg
3629	PSM.5000.0004.1094	5/03/2025	Electronic File	20250227_100017.jpg
3630	PSM.5000.0004.1095	5/03/2025	Electronic File	20250227_110819.jpg

Count	Document ID	Document Date	Document Type	Title
3631	PSM.5000.0004.1096	5/03/2025	Electronic File	20250227_110857.jpg
3632	PSM.5000.0004.1097	5/03/2025	Electronic File	20250224_072503.jpg
3633	PSM.5000.0004.1098	5/03/2025	Electronic File	20250224_072513.jpg
3634	PSM.5000.0004.1099	5/03/2025	Electronic File	20250224_121650.jpg
3635	PSM.5000.0004.1100	5/03/2025	Electronic File	20250225_073053.jpg
3636	PSM.5000.0004.1101	5/03/2025	Electronic File	20250225_073109.jpg
3637	PSM.5000.0004.1102	5/03/2025	Electronic File	20250226_071211.jpg
3638	PSM.5000.0004.1103	5/03/2025	Electronic File	20250227_095616.jpg
3639	PSM.5000.0004.1104	5/03/2025	Electronic File	20250227_095822.jpg
3640	PSM.5000.0004.1105	5/03/2025	Electronic File	20250227_095940.jpg
3641	PSM.5000.0004.1106	5/03/2025	Electronic File	20250224_080613.jpg
3642	PSM.5000.0004.1107	5/03/2025	Electronic File	20250224_121739.jpg
3643	PSM.5000.0004.1108	5/03/2025	Electronic File	20250224_143337.jpg
3644	PSM.5000.0004.1109	5/03/2025	Electronic File	20250224_170332.jpg
3645	PSM.5000.0004.1110	5/03/2025	Electronic File	20250224_171841.jpg
3646	PSM.5000.0004.1111	5/03/2025	Electronic File	20250224_171844.jpg
3647	PSM.5000.0004.1112	5/03/2025	Electronic File	20250225_132647.jpg
3648	PSM.5000.0004.1113	5/03/2025	Electronic File	20250227_095539.jpg
3649	PSM.5000.0004.1114	5/03/2025	Electronic File	20250227_095720.jpg
3650	PSM.5000.0004.1115	5/03/2025	Electronic File	20250221_131208.jpg
3651	PSM.5000.0004.1116	5/03/2025	Electronic File	20250221_131215.jpg
3652	PSM.5000.0004.1117	5/03/2025	Electronic File	20250224_080555.jpg
3653	PSM.5000.0004.1118	5/03/2025	Electronic File	20250224_080611.jpg
3654	PSM.5000.0004.1119	5/03/2025	Electronic File	20250224_092917.jpg
3655	PSM.5000.0004.1120	5/03/2025	Electronic File	20250224_092927.jpg
3656	PSM.5000.0004.1121	5/03/2025	Electronic File	20250224_100854.jpg
3657	PSM.5000.0004.1122	5/03/2025	Electronic File	20250227_095402.jpg
3658	PSM.5000.0004.1123	5/03/2025	Electronic File	20250227_095536.jpg
3659	PSM.5000.0004.1124	5/03/2025	Electronic File	20250221_101305.jpg
3660	PSM.5000.0004.1125	5/03/2025	Electronic File	20250221_131210.jpg
3661	PSM.5000.0004.1126	5/03/2025	Electronic File	20250221_141623.jpg
3662	PSM.5000.0004.1127	5/03/2025	Electronic File	20250224_080353.jpg
3663	PSM.5000.0004.1128	5/03/2025	Electronic File	20250224_080552.jpg
3664	PSM.5000.0004.1129	5/03/2025	Electronic File	20250224_080640.jpg
3665	PSM.5000.0004.1130	5/03/2025	Electronic File	20250227_095404.jpg
3666	PSM.5000.0004.1131	5/03/2025	Electronic File	20250221_085909.jpg
3667	PSM.5000.0004.1132	5/03/2025	Electronic File	20250221_090201.jpg
3668	PSM.5000.0004.1133	5/03/2025	Electronic File	20250221_131203.jpg
3669	PSM.5000.0004.1134	5/03/2025	Electronic File	20250227_094950.jpg
3670	PSM.5000.0004.1135	5/03/2025	Electronic File	20250227_095000.jpg
3671	PSM.5000.0004.1136	5/03/2025	Electronic File	20250227_095357.jpg
3672	PSM.5000.0004.1137	5/03/2025	Electronic File	20250227_095749.jpg
3673	PSM.5000.0004.1138	5/03/2025	Electronic File	20250221_085940.jpg
3674	PSM.5000.0004.1139	5/03/2025	Electronic File	20250227_094011.jpg
3675	PSM.5000.0004.1140	5/03/2025	Electronic File	20250227_094140.jpg
3676	PSM.5000.0004.1141	5/03/2025	Electronic File	20250227_094445.jpg
3677	PSM.5000.0004.1142	5/03/2025	Electronic File	20250227_094507.jpg
3678	PSM.5000.0004.1143	5/03/2025	Electronic File	20250227_094611.jpg
3679	PSM.5000.0004.1144	5/03/2025	Electronic File	20250227_094954.jpg
3680	PSM.5000.0004.1145	5/03/2025	Electronic File	20250226_115257.jpg
3681	PSM.5000.0004.1146	5/03/2025	Electronic File	20250226_134523.jpg
3682	PSM.5000.0004.1147	5/03/2025	Electronic File	20250226_134527.jpg
3683	PSM.5000.0004.1148	5/03/2025	Electronic File	20250226_134528.jpg
3684	PSM.5000.0004.1149	5/03/2025	Electronic File	20250226_134529.jpg
3685	PSM.5000.0004.1150	5/03/2025	Electronic File	20250227_094204.jpg

Count	Document ID	Document Date	Document Type	Title
3686	PSM.5000.0004.1151	5/03/2025	Electronic File	20250227_094417.jpg
3687	PSM.5000.0004.1152	5/03/2025	Electronic File	20250227_095246.jpg
3688	PSM.5000.0004.1153	5/03/2025	Electronic File	20250225_164531.jpg
3689	PSM.5000.0004.1154	5/03/2025	Electronic File	20250225_164615.jpg
3690	PSM.5000.0004.1155	5/03/2025	Electronic File	20250225_165832.jpg
3691	PSM.5000.0004.1156	5/03/2025	Electronic File	20250225_165840.jpg
3692	PSM.5000.0004.1157	5/03/2025	Electronic File	20250225_165842.jpg
3693	PSM.5000.0004.1158	5/03/2025	Electronic File	20250226_114358.jpg
3694	PSM.5000.0004.1159	5/03/2025	Electronic File	20250226_115323.jpg
3695	PSM.5000.0004.1160	5/03/2025	Electronic File	20250226_115452.jpg
3696	PSM.5000.0004.1161	5/03/2025	Electronic File	20250221_085918.jpg
3697	PSM.5000.0004.1162	5/03/2025	Electronic File	20250221_085921.jpg
3698	PSM.5000.0004.1163	5/03/2025	Electronic File	20250221_101241.jpg
3699	PSM.5000.0004.1164	5/03/2025	Electronic File	20250224_102830.jpg
3700	PSM.5000.0004.1165	5/03/2025	Electronic File	20250225_073055.jpg
3701	PSM.5000.0004.1166	5/03/2025	Electronic File	20250225_133505.jpg
3702	PSM.5000.0004.1167	5/03/2025	Electronic File	20250225_133540.jpg
3703	PSM.5000.0004.1168	5/03/2025	Electronic File	20250225_164537.jpg
3704	PSM.5000.0004.1169	5/03/2025	Electronic File	20250221_090203.jpg
3705	PSM.5000.0004.1170	6/03/2025	Electronic File	IMG_1663.HEIC
3706	PSM.5000.0004.1171	6/03/2025	Electronic File	IMG_3161.HEIC
3707	PSM.5000.0004.1172	6/03/2025	Electronic File	IMG_3160.HEIC
3708	PSM.5000.0004.1173	7/03/2025	Electronic File	IMG_1897.HEIC
3709	PSM.5000.0004.1174	7/03/2025	Electronic File	IMG_1898.HEIC
3710	PSM.5000.0004.1175	7/03/2025	Electronic File	IMG_1899.HEIC
3711	PSM.5000.0004.1176	7/03/2025	Electronic File	IMG_1900.HEIC
3712	PSM.5000.0004.1177	7/03/2025	Electronic File	IMG_1901.HEIC
3713	PSM.5000.0004.1178	7/03/2025	Electronic File	IMG_1902.HEIC
3714	PSM.5000.0004.1179	7/03/2025	Electronic File	IMG_1903.HEIC
3715	PSM.5000.0004.1180	7/03/2025	Electronic File	IMG_1904.HEIC
3716	PSM.5000.0004.1181	7/03/2025	Electronic File	IMG_1905.HEIC
3717	PSM.5000.0004.1182	7/03/2025	Electronic File	IMG_1906.HEIC
3718	PSM.5000.0004.1183	7/03/2025	Electronic File	IMG_1907.HEIC
3719	PSM.5000.0004.1184	7/03/2025	Electronic File	IMG_1908.HEIC
3720	PSM.5000.0004.1185	7/03/2025	Electronic File	IMG_1909.HEIC
3721	PSM.5000.0004.1186	7/03/2025	Electronic File	IMG_1910.HEIC
3722	PSM.5000.0004.1187	7/03/2025	Electronic File	IMG_1911.HEIC
3723	PSM.5000.0004.1188	7/03/2025	Electronic File	IMG_1912.HEIC
3724	PSM.5000.0004.1189	7/03/2025	Electronic File	IMG_1913.HEIC
3725	PSM.5000.0004.1190	7/03/2025	Electronic File	IMG_1914.HEIC
3726	PSM.5000.0004.1191	7/03/2025	Electronic File	IMG_1915.HEIC
3727	PSM.5000.0004.1192	7/03/2025	Electronic File	IMG_1916.HEIC
3728	PSM.5000.0004.1193	7/03/2025	Electronic File	IMG_1917.HEIC
3729	PSM.5000.0004.1194	7/03/2025	Electronic File	IMG_1918.HEIC
3730	PSM.5000.0004.1195	7/03/2025	Electronic File	IMG_1919.HEIC
3731	PSM.5000.0004.1196	7/03/2025	Electronic File	IMG_1920.HEIC
3732	PSM.5000.0004.1197	7/03/2025	Electronic File	IMG_1921.HEIC
3733	PSM.5000.0004.1198	7/03/2025	Electronic File	IMG_1922.HEIC
3734	PSM.5000.0004.1199	7/03/2025	Electronic File	IMG_1923.HEIC
3735	PSM.5000.0004.1200	7/03/2025	Electronic File	IMG_1924.HEIC
3736	PSM.5000.0004.1201	7/03/2025	Electronic File	IMG_1925.HEIC
3737	PSM.5000.0004.1202	7/03/2025	Electronic File	IMG_1926.HEIC
3738	PSM.5000.0004.1203	7/03/2025	Electronic File	IMG_1927.HEIC
3739	PSM.5000.0004.1204	7/03/2025	Electronic File	IMG_1928.HEIC
3740	PSM.5000.0004.1205	7/03/2025	Electronic File	IMG_1929.HEIC

Count	Document ID	Document Date	Document Type	Title
3741	PSM.5000.0004.1206	7/03/2025	Electronic File	IMG_1930.HEIC
3742	PSM.5000.0004.1207	7/03/2025	Electronic File	IMG_1931.HEIC
3743	PSM.5000.0004.1208	7/03/2025	Electronic File	IMG_1932.HEIC
3744	PSM.5000.0004.1209	7/03/2025	Electronic File	IMG_1933.HEIC
3745	PSM.5000.0004.1210	7/03/2025	Electronic File	IMG_1934.HEIC
3746	PSM.5000.0004.1211	7/03/2025	Electronic File	IMG_1935.HEIC
3747	PSM.5000.0004.1212	7/03/2025	Electronic File	IMG_1936.HEIC
3748	PSM.5000.0004.1213	7/03/2025	Electronic File	IMG_1937.HEIC
3749	PSM.5000.0004.1214	7/03/2025	Electronic File	IMG_1938.HEIC
3750	PSM.5000.0004.1215	7/03/2025	Electronic File	IMG_1939.HEIC
3751	PSM.5000.0004.1216	12/03/2025	Electronic File	IMG_1468.jpg
3752	PSM.5000.0004.1217	12/03/2025	Electronic File	IMG_1475.jpg
3753	PSM.5000.0004.1218	12/03/2025	Electronic File	IMG_1483.jpg
3754	PSM.5000.0004.1219	12/03/2025	Electronic File	IMG_1489.jpg
3755	PSM.5000.0004.1220	12/03/2025	Electronic File	IMG_1490.jpg
3756	PSM.5000.0004.1221	12/03/2025	Electronic File	IMG_1492.jpg
3757	PSM.5000.0004.1222	12/03/2025	Electronic File	IMG_1454.jpg
3758	PSM.5000.0004.1223	12/03/2025	Electronic File	IMG_1455.jpg
3759	PSM.5000.0004.1224	12/03/2025	Electronic File	IMG_1456.jpg
3760	PSM.5000.0004.1225	12/03/2025	Electronic File	IMG_1457.jpg
3761	PSM.5000.0004.1226	12/03/2025	Electronic File	IMG_1458.jpg
3762	PSM.5000.0004.1227	12/03/2025	Electronic File	IMG_1459.jpg
3763	PSM.5000.0004.1228	12/03/2025	Electronic File	IMG_1460.jpg
3764	PSM.5000.0004.1229	12/03/2025	Electronic File	IMG_1461.jpg
3765	PSM.5000.0004.1230	12/03/2025	Electronic File	IMG_1462.jpg
3766	PSM.5000.0004.1231	12/03/2025	Electronic File	IMG_1463.jpg
3767	PSM.5000.0004.1232	12/03/2025	Electronic File	IMG_1464.jpg
3768	PSM.5000.0004.1233	12/03/2025	Electronic File	IMG_1469.jpg
3769	PSM.5000.0004.1234	12/03/2025	Electronic File	IMG_1470.jpg
3770	PSM.5000.0004.1235	12/03/2025	Electronic File	IMG_1474.jpg
3771	PSM.5000.0004.1236	12/03/2025	Electronic File	IMG_1476.jpg
3772	PSM.5000.0004.1237	12/03/2025	Electronic File	IMG_1477.jpg
3773	PSM.5000.0004.1238	12/03/2025	Electronic File	IMG_1479.jpg
3774	PSM.5000.0004.1239	12/03/2025	Electronic File	IMG_1480.jpg
3775	PSM.5000.0004.1240	12/03/2025	Electronic File	IMG_1481.jpg
3776	PSM.5000.0004.1241	12/03/2025	Electronic File	IMG_1484.jpg
3777	PSM.5000.0004.1242	12/03/2025	Electronic File	IMG_1485.jpg
3778	PSM.5000.0004.1243	12/03/2025	Electronic File	IMG_1486.jpg
3779	PSM.5000.0004.1244	12/03/2025	Electronic File	IMG_1487.jpg
3780	PSM.5000.0004.1245	12/03/2025	Electronic File	IMG_1488.jpg
3781	PSM.5000.0004.1246	12/03/2025	Electronic File	IMG_1491.jpg
3782	PSM.5000.0004.1247	12/03/2025	Electronic File	IMG_1493.jpg
3783	PSM.5000.0004.1248	12/03/2025	Electronic File	IMG_1498.jpg
3784	PSM.5000.0004.1249	12/03/2025	Electronic File	IMG_1499.jpg
3785	PSM.5000.0004.1250	12/03/2025	Electronic File	IMG_1500.jpg
3786	PSM.5000.0004.1251	12/03/2025	Electronic File	IMG_1510.jpg
3787	PSM.5000.0004.1252	12/03/2025	Electronic File	IMG_1494.jpg
3788	PSM.5000.0004.1253	12/03/2025	Electronic File	IMG_1495.jpg
3789	PSM.5000.0004.1254	12/03/2025	Electronic File	IMG_1496.jpg
3790	PSM.5000.0004.1255	12/03/2025	Electronic File	IMG_1497.jpg
3791	PSM.5000.0004.1256	12/03/2025	Electronic File	IMG_1501.jpg
3792	PSM.5000.0004.1257	12/03/2025	Electronic File	IMG_1506.jpg
3793	PSM.5000.0004.1258	12/03/2025	Electronic File	IMG_1507.jpg
3794	PSM.5000.0004.1259	12/03/2025	Electronic File	IMG_1508.jpg
3795	PSM.5000.0004.1260	12/03/2025	Electronic File	IMG_1509.jpg

Count	Document ID	Document Date	Document Type	Title
3796	PSM.5000.0004.1261	12/03/2025	Electronic File	IMG_1512.jpg
3797	PSM.5000.0004.1262	12/03/2025	Electronic File	IMG_1513.jpg
3798	PSM.5000.0004.1263	12/03/2025	Electronic File	IMG_1514.jpg
3799	PSM.5000.0004.1264	12/03/2025	Electronic File	IMG_1515.jpg
3800	PSM.5000.0004.1265	12/03/2025	Electronic File	IMG_1516.jpg
3801	PSM.5000.0004.1266	12/03/2025	Electronic File	IMG_1517.jpg
3802	PSM.5000.0004.1267	12/03/2025	Electronic File	IMG_1518.jpg
3803	PSM.5000.0004.1268	12/03/2025	Electronic File	IMG_1519.jpg
3804	PSM.5000.0004.1269	12/03/2025	Electronic File	IMG_1525.jpg
3805	PSM.5000.0004.1270	12/03/2025	Electronic File	IMG_1526.jpg
3806	PSM.5000.0004.1271	12/03/2025	Electronic File	IMG_1527.jpg
3807	PSM.5000.0004.1272	12/03/2025	Electronic File	IMG_1533.jpg
3808	PSM.5000.0004.1273	12/03/2025	Electronic File	IMG_1520.jpg
3809	PSM.5000.0004.1274	12/03/2025	Electronic File	IMG_1521.jpg
3810	PSM.5000.0004.1275	12/03/2025	Electronic File	IMG_1522.jpg
3811	PSM.5000.0004.1276	12/03/2025	Electronic File	IMG_1523.jpg
3812	PSM.5000.0004.1277	12/03/2025	Electronic File	IMG_1524.jpg
3813	PSM.5000.0004.1278	12/03/2025	Electronic File	IMG_1528.jpg
3814	PSM.5000.0004.1279	12/03/2025	Electronic File	IMG_1529.jpg
3815	PSM.5000.0004.1280	12/03/2025	Electronic File	IMG_1530.jpg
3816	PSM.5000.0004.1281	12/03/2025	Electronic File	IMG_1531.jpg
3817	PSM.5000.0004.1282	12/03/2025	Electronic File	IMG_1532.jpg
3818	PSM.5000.0004.1283	12/03/2025	Electronic File	IMG_1534.jpg
3819	PSM.5000.0004.1284	12/03/2025	Electronic File	IMG_1535.jpg
3820	PSM.5000.0004.1285	12/03/2025	Electronic File	IMG_1536.jpg
3821	PSM.5000.0004.1286	12/03/2025	Electronic File	IMG_1537.jpg
3822	PSM.5000.0004.1287	12/03/2025	Electronic File	IMG_1538.jpg
3823	PSM.5000.0004.1288	12/03/2025	Electronic File	IMG_1539.jpg
3824	PSM.5000.0004.1289	12/03/2025	Electronic File	IMG_1540.jpg
3825	PSM.5000.0004.1290	12/03/2025	Electronic File	IMG_1542.jpg
3826	PSM.5000.0004.1291	12/03/2025	Electronic File	IMG_1543.jpg
3827	PSM.5000.0004.1292	12/03/2025	Electronic File	IMG_1544.jpg
3828	PSM.5000.0004.1293	12/03/2025	Electronic File	IMG_1545.jpg
3829	PSM.5000.0004.1294	12/03/2025	Electronic File	IMG_1546.jpg
3830	PSM.5000.0004.1295	12/03/2025	Electronic File	IMG_1549.jpg
3831	PSM.5000.0004.1296	12/03/2025	Electronic File	IMG_1550.jpg
3832	PSM.5000.0004.1297	12/03/2025	Electronic File	IMG_1551.jpg
3833	PSM.5000.0004.1298	12/03/2025	Electronic File	IMG_1541.jpg
3834	PSM.5000.0004.1299	12/03/2025	Electronic File	IMG_1552.jpg
3835	PSM.5000.0004.1300	12/03/2025	Electronic File	IMG_1553.jpg
3836	PSM.5000.0004.1301	12/03/2025	Electronic File	IMG_1554.jpg
3837	PSM.5000.0004.1302	12/03/2025	Electronic File	IMG_1555.jpg
3838	PSM.5000.0004.1303	14/03/2025	Electronic File	250205_25010_McCrae_LargerArea_Clippped_DTM25cm.tif.aux.x
3839	PSM.5000.0004.1304	14/03/2025	Electronic File	250205_25010_McCrae_LargerArea_DTM25cm.tif.aux.xml
3840	PSM.5000.0004.1458	18/03/2025	Electronic File	1.jpg
3841	PSM.5000.0004.1459	18/03/2025	Electronic File	2.jpg
3842	PSM.5000.0004.1460	18/03/2025	Electronic File	3.jpg
3843	PSM.5000.0004.1461	18/03/2025	Electronic File	4.jpg
3844	PSM.5000.0004.1462	18/03/2025	Electronic File	Country Roads Board Geotech Cross Sections LL.pptx
3845	PSM.5000.0004.1473	18/03/2025	Electronic File	SN7018 - Latrobe Parade Overpass - Geotech Cross Section.pdf
3846	PSM.5000.0004.1475	18/03/2025	Electronic File	SN7019 - Lonsdale Street Bridge - Geotech Cross Section.pdf
3847	PSM.5000.0004.1478	18/03/2025	Electronic File	f337e5db-a19e-4420-b309-f8fb231a7ac0.jpg
3848	PSM.5000.0004.1479	18/03/2025	Email	Soil Samples - Coburn Ave next to the Charlesworth St
3849	PSM.5000.0004.1481	20/03/2025	Electronic File	IMG_2019.HEIC
3850	PSM.5000.0004.1482	20/03/2025	Electronic File	IMG_2020.HEIC

Count	Document ID	Document Date	Document Type	Title
3851	PSM.5000.0004.1483	20/03/2025	Electronic File	IMG_2021.HEIC
3852	PSM.5000.0004.1484	20/03/2025	Electronic File	IMG_2022.HEIC
3853	PSM.5000.0004.1485	20/03/2025	Electronic File	IMG_2023.HEIC
3854	PSM.5000.0004.1486	20/03/2025	Electronic File	IMG_2024.HEIC
3855	PSM.5000.0004.1487	20/03/2025	Electronic File	IMG_2025.HEIC
3856	PSM.5000.0004.1488	20/03/2025	Electronic File	IMG_2026.HEIC
3857	PSM.5000.0004.1489	20/03/2025	Electronic File	IMG_2027.HEIC
3858	PSM.5000.0004.1490	20/03/2025	Electronic File	IMG_2028.HEIC
3859	PSM.5000.0004.1491	20/03/2025	Electronic File	IMG_2029.HEIC
3860	PSM.5000.0004.1492	20/03/2025	Electronic File	IMG_2030.HEIC
3861	PSM.5000.0004.1493	20/03/2025	Electronic File	IMG_2031.HEIC
3862	PSM.5000.0004.1494	20/03/2025	Electronic File	IMG_2032.HEIC
3863	PSM.5000.0004.1495	20/03/2025	Electronic File	IMG_2033.HEIC
3864	PSM.5000.0004.1496	20/03/2025	Electronic File	IMG_2034.HEIC
3865	PSM.5000.0004.1497	20/03/2025	Electronic File	IMG_2035.HEIC
3866	PSM.5000.0004.1498	20/03/2025	Electronic File	IMG_2036.HEIC
3867	PSM.5000.0004.1499	20/03/2025	Electronic File	IMG_2037.HEIC
3868	PSM.5000.0004.1500	20/03/2025	Electronic File	IMG_2038.HEIC
3869	PSM.5000.0004.1501	20/03/2025	Electronic File	IMG_2039.HEIC
3870	PSM.5000.0004.1502	20/03/2025	Electronic File	IMG_2040.HEIC
3871	PSM.5000.0004.1503	20/03/2025	Electronic File	IMG_2041.HEIC
3872	PSM.5000.0004.1504	20/03/2025	Electronic File	IMG_2042.HEIC
3873	PSM.5000.0004.1505	20/03/2025	Electronic File	IMG_2043.HEIC
3874	PSM.5000.0004.1506	20/03/2025	Electronic File	IMG_2044.HEIC
3875	PSM.5000.0004.1507	20/03/2025	Electronic File	IMG_2045.HEIC
3876	PSM.5000.0004.1508	20/03/2025	Electronic File	IMG_2046.HEIC
3877	PSM.5000.0004.1509	20/03/2025	Electronic File	IMG_2047.HEIC
3878	PSM.5000.0004.1510	20/03/2025	Electronic File	IMG_2048.HEIC
3879	PSM.5000.0004.1511	20/03/2025	Electronic File	IMG_2049.HEIC
3880	PSM.5000.0004.1512	20/03/2025	Electronic File	IMG_2050.HEIC
3881	PSM.5000.0004.1513	20/03/2025	Electronic File	IMG_2051.HEIC
3882	PSM.5000.0004.1514	20/03/2025	Electronic File	IMG_2052.MOV
3883	PSM.5000.0004.1515	20/03/2025	Electronic File	TH000430.JPG
3884	PSM.5000.0004.1516	20/03/2025	Electronic File	IMG_2054.HEIC
3885	PSM.5000.0004.1517	20/03/2025	Electronic File	IMG_2055.HEIC
3886	PSM.5000.0004.1518	20/03/2025	Electronic File	TH000431.JPG
3887	PSM.5000.0004.1519	20/03/2025	Electronic File	TH000432.JPG
3888	PSM.5000.0004.1520	20/03/2025	Electronic File	IMG_2058.HEIC
3889	PSM.5000.0004.1521	20/03/2025	Electronic File	TH000433.JPG
3890	PSM.5000.0004.1522	20/03/2025	Electronic File	TH000434.JPG
3891	PSM.5000.0004.1523	20/03/2025	Electronic File	IMG_2061.HEIC
3892	PSM.5000.0004.1524	20/03/2025	Electronic File	IMG_2062.HEIC
3893	PSM.5000.0004.1525	20/03/2025	Electronic File	IMG_2063.HEIC
3894	PSM.5000.0004.1526	20/03/2025	Electronic File	IMG_2064.HEIC
3895	PSM.5000.0004.1527	20/03/2025	Electronic File	IMG_2065.HEIC
3896	PSM.5000.0004.1528	20/03/2025	Electronic File	IMG_2066.MOV
3897	PSM.5000.0004.1529	20/03/2025	Electronic File	IMG_2067.HEIC
3898	PSM.5000.0004.1530	20/03/2025	Electronic File	IMG_2068.HEIC
3899	PSM.5000.0004.1531	20/03/2025	Electronic File	IMG_2069.HEIC
3900	PSM.5000.0004.1532	20/03/2025	Electronic File	IMG_2070.HEIC
3901	PSM.5000.0004.1533	20/03/2025	Electronic File	IMG_2071.HEIC
3902	PSM.5000.0004.1534	20/03/2025	Electronic File	IMG_2072.HEIC
3903	PSM.5000.0004.1535	20/03/2025	Electronic File	IMG_2073.HEIC
3904	PSM.5000.0004.1536	20/03/2025	Electronic File	IMG_2074.HEIC
3905	PSM.5000.0004.1537	20/03/2025	Electronic File	IMG_2075.HEIC

Count	Document ID	Document Date	Document Type	Title
3906	PSM.5000.0004.1538	20/03/2025	Electronic File	IMG_2076.HEIC
3907	PSM.5000.0004.1539	21/03/2025	Electronic File	IMG_3564.HEIC
3908	PSM.5000.0004.1540	21/03/2025	Electronic File	IMG_3565.HEIC
3909	PSM.5000.0004.1541	21/03/2025	Electronic File	IMG_3566.HEIC
3910	PSM.5000.0004.1542	21/03/2025	Electronic File	IMG_3567.HEIC
3911	PSM.5000.0004.1543	21/03/2025	Electronic File	IMG_3568.HEIC
3912	PSM.5000.0004.1544	21/03/2025	Electronic File	IMG_3569.HEIC
3913	PSM.5000.0004.1545	21/03/2025	Electronic File	IMG_3570.HEIC
3914	PSM.5000.0004.1546	21/03/2025	Electronic File	IMG_3571.HEIC
3915	PSM.5000.0004.1547	21/03/2025	Electronic File	IMG_3572.HEIC
3916	PSM.5000.0004.1548	21/03/2025	Electronic File	IMG_3559.HEIC
3917	PSM.5000.0004.1549	21/03/2025	Electronic File	IMG_3560.HEIC
3918	PSM.5000.0004.1550	21/03/2025	Electronic File	IMG_3561.HEIC
3919	PSM.5000.0004.1551	21/03/2025	Electronic File	IMG_3562.HEIC
3920	PSM.5000.0004.1552	21/03/2025	Electronic File	IMG_3563.HEIC
3921	PSM.5000.0004.1553	21/03/2025	Electronic File	IMG_3558.HEIC
3922	PSM.5000.0004.1554	21/03/2025	Electronic File	IMG_3580.HEIC
3923	PSM.5000.0004.1555	21/03/2025	Electronic File	IMG_3583.HEIC
3924	PSM.5000.0004.1556	21/03/2025	Electronic File	IMG_3584.HEIC
3925	PSM.5000.0004.1557	21/03/2025	Electronic File	IMG_3588.HEIC
3926	PSM.5000.0004.1558	21/03/2025	Electronic File	IMG_3589.HEIC
3927	PSM.5000.0004.1559	21/03/2025	Electronic File	IMG_3592.HEIC
3928	PSM.5000.0004.1560	21/03/2025	Electronic File	IMG_3598.HEIC
3929	PSM.5000.0004.1561	21/03/2025	Electronic File	IMG_3577.HEIC
3930	PSM.5000.0004.1562	21/03/2025	Electronic File	IMG_3578.HEIC
3931	PSM.5000.0004.1563	21/03/2025	Electronic File	IMG_3579.HEIC
3932	PSM.5000.0004.1564	21/03/2025	Electronic File	IMG_3581.HEIC
3933	PSM.5000.0004.1565	21/03/2025	Electronic File	IMG_3582.HEIC
3934	PSM.5000.0004.1566	21/03/2025	Electronic File	IMG_3585.HEIC
3935	PSM.5000.0004.1567	21/03/2025	Electronic File	IMG_3586.HEIC
3936	PSM.5000.0004.1568	21/03/2025	Electronic File	IMG_3587.HEIC
3937	PSM.5000.0004.1569	21/03/2025	Electronic File	IMG_3590.HEIC
3938	PSM.5000.0004.1570	21/03/2025	Electronic File	IMG_3591.HEIC
3939	PSM.5000.0004.1571	21/03/2025	Electronic File	IMG_3593.HEIC
3940	PSM.5000.0004.1572	21/03/2025	Electronic File	IMG_3594.HEIC
3941	PSM.5000.0004.1573	21/03/2025	Electronic File	IMG_3595.HEIC
3942	PSM.5000.0004.1574	21/03/2025	Electronic File	IMG_3596.HEIC
3943	PSM.5000.0004.1575	21/03/2025	Electronic File	IMG_3597.HEIC
3944	PSM.5000.0004.1576	24/03/2025	Electronic File	25010_McCrae_Ortho.ecw.aux.xml
3945	PSM.5000.0004.1577	26/03/2025	Electronic File	IMG_1854.HEIC
3946	PSM.5000.0004.1578	26/03/2025	Electronic File	IMG_1861.HEIC
3947	PSM.5000.0004.1579	26/03/2025	Electronic File	IMG_1881.HEIC
3948	PSM.5000.0004.1580	26/03/2025	Electronic File	IMG_1886.HEIC
3949	PSM.5000.0004.1581	26/03/2025	Electronic File	IMG_1718.HEIC
3950	PSM.5000.0004.1582	26/03/2025	Electronic File	IMG_1820.HEIC
3951	PSM.5000.0004.1583	26/03/2025	Electronic File	250116_25010_McCrae Landslip_Ortho2cm.ecw.aux.xml
3952	PSM.5000.0004.1584	28/03/2025	Electronic File	PSM5665 Surface Water Quality - All Data Comparison.xlsx
3953	PSM.5000.0004.1585	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-06-22.jpg
3954	PSM.5000.0004.1586	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-06-44.jpg
3955	PSM.5000.0004.1587	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-06-53.jpg
3956	PSM.5000.0004.1588	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-07-20.jpg
3957	PSM.5000.0004.1589	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-09-53.jpg
3958	PSM.5000.0004.1590	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-10-13.jpg
3959	PSM.5000.0004.1591	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-11-37.jpg
3960	PSM.5000.0004.1592	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-11-50.jpg

Count	Document ID	Document Date	Document Type	Title
3961	PSM.5000.0004.1593	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-12-50.jpg
3962	PSM.5000.0004.1594	2/04/2025	Electronic File	BYDA Responses - Enquiry 39002753.pdf
3963	PSM.5000.0004.1717	2/04/2025	Electronic File	IMG_2159.HEIC
3964	PSM.5000.0004.1718	2/04/2025	Electronic File	IMG_2160.HEIC
3965	PSM.5000.0004.1719	2/04/2025	Electronic File	IMG_2161.HEIC
3966	PSM.5000.0004.1720	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-24-24.jpg
3967	PSM.5000.0004.1721	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-24-30.jpg
3968	PSM.5000.0004.1722	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-24-55.jpg
3969	PSM.5000.0004.1723	2/04/2025	Electronic File	IMG_2162.HEIC
3970	PSM.5000.0004.1724	2/04/2025	Electronic File	IMG_2163.HEIC
3971	PSM.5000.0004.1725	2/04/2025	Electronic File	IMG_2164.HEIC
3972	PSM.5000.0004.1726	2/04/2025	Electronic File	IMG_2165.HEIC
3973	PSM.5000.0004.1727	2/04/2025	Electronic File	IMG_2166.HEIC
3974	PSM.5000.0004.1728	2/04/2025	Electronic File	IMG_2167.HEIC
3975	PSM.5000.0004.1729	2/04/2025	Electronic File	IMG_2168.HEIC
3976	PSM.5000.0004.1730	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-26-34.jpg
3977	PSM.5000.0004.1731	2/04/2025	Electronic File	IMG_2169.HEIC
3978	PSM.5000.0004.1732	2/04/2025	Electronic File	IMG_2170.HEIC
3979	PSM.5000.0004.1733	2/04/2025	Electronic File	IMG_2171.HEIC
3980	PSM.5000.0004.1734	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-27-20.jpg
3981	PSM.5000.0004.1735	2/04/2025	Electronic File	TH000438.JPG
3982	PSM.5000.0004.1736	2/04/2025	Electronic File	IMG_2173.HEIC
3983	PSM.5000.0004.1737	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-28-14.jpg
3984	PSM.5000.0004.1738	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-28-55.jpg
3985	PSM.5000.0004.1739	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-29-48.jpg
3986	PSM.5000.0004.1740	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-33-42.jpg
3987	PSM.5000.0004.1741	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-36-44.jpg
3988	PSM.5000.0004.1742	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-37-00.jpg
3989	PSM.5000.0004.1743	2/04/2025	Electronic File	BYDA Responses - Enquiry 39002795.pdf
3990	PSM.5000.0004.1889	2/04/2025	Electronic File	IMG_2174.PNG
3991	PSM.5000.0004.1890	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-43-27.jpg
3992	PSM.5000.0004.1891	2/04/2025	Electronic File	BYDA Responses - Enquiry 39003525.pdf
3993	PSM.5000.0004.1997	2/04/2025	Electronic File	BYDA Responses - Enquiry 39002828.pdf
3994	PSM.5000.0004.2115	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-48-01.jpg
3995	PSM.5000.0004.2116	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-49-21.jpg
3996	PSM.5000.0004.2117	2/04/2025	Electronic File	BYDA Responses - Enquiry 39002870.pdf
3997	PSM.5000.0004.2234	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-51-01.jpg
3998	PSM.5000.0004.2235	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-51-17.jpg
3999	PSM.5000.0004.2236	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-52-11.jpg
4000	PSM.5000.0004.2237	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-52-19.jpg
4001	PSM.5000.0004.2238	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-52-24.jpg
4002	PSM.5000.0004.2239	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-53-23.jpg
4003	PSM.5000.0004.2240	2/04/2025	Electronic File	IMG_2175.HEIC
4004	PSM.5000.0004.2241	2/04/2025	Electronic File	IMG_2176.HEIC
4005	PSM.5000.0004.2242	2/04/2025	Electronic File	IMG_2177.HEIC
4006	PSM.5000.0004.2243	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-56-59.jpg
4007	PSM.5000.0004.2244	2/04/2025	Electronic File	PSM5665 -2025-04-02-11-58-56.jpg
4008	PSM.5000.0004.2245	2/04/2025	Electronic File	PSM5665 -2025-04-02-12-05-04.jpg
4009	PSM.5000.0004.2246	2/04/2025	Electronic File	NDT08 to NDT10 - Plans and Legends Only.pdf
4010	PSM.5000.0004.2288	2/04/2025	Electronic File	IMG_2178.HEIC
4011	PSM.5000.0004.2289	2/04/2025	Electronic File	IMG_2179.HEIC
4012	PSM.5000.0004.2290	2/04/2025	Electronic File	NDT07 & NDT11 - Plans and Legends Only.pdf
4013	PSM.5000.0004.2317	2/04/2025	Electronic File	IMG_2180.HEIC
4014	PSM.5000.0004.2318	2/04/2025	Electronic File	IMG_2181.HEIC
4015	PSM.5000.0004.2319	2/04/2025	Electronic File	IMG_2182.HEIC

Count	Document ID	Document Date	Document Type	Title
4016	PSM.5000.0004.2320	2/04/2025	Electronic File	IMG_2183.HEIC
4017	PSM.5000.0004.2321	2/04/2025	Electronic File	IMG_2184.HEIC
4018	PSM.5000.0004.2322	2/04/2025	Electronic File	IMG_2185.HEIC
4019	PSM.5000.0004.2323	2/04/2025	Electronic File	IMG_2186.HEIC
4020	PSM.5000.0004.2324	2/04/2025	Electronic File	IMG_2187.HEIC
4021	PSM.5000.0004.2325	2/04/2025	Electronic File	IMG_2188.HEIC
4022	PSM.5000.0004.2326	2/04/2025	Electronic File	IMG_2189.HEIC
4023	PSM.5000.0004.2327	2/04/2025	Electronic File	IMG_2190.HEIC
4024	PSM.5000.0004.2328	2/04/2025	Electronic File	IMG_2191.HEIC
4025	PSM.5000.0004.2329	2/04/2025	Electronic File	IMG_2192.HEIC
4026	PSM.5000.0004.2330	2/04/2025	Electronic File	IMG_2193.HEIC
4027	PSM.5000.0004.2331	2/04/2025	Electronic File	IMG_2194.HEIC
4028	PSM.5000.0004.2332	2/04/2025	Electronic File	IMG_2195.HEIC
4029	PSM.5000.0004.2333	2/04/2025	Electronic File	IMG_2196.HEIC
4030	PSM.5000.0004.2334	2/04/2025	Electronic File	IMG_2197.HEIC
4031	PSM.5000.0004.2335	2/04/2025	Electronic File	IMG_2198.HEIC
4032	PSM.5000.0004.2336	2/04/2025	Electronic File	IMG_2199.HEIC
4033	PSM.5000.0004.2337	2/04/2025	Electronic File	IMG_2200.HEIC
4034	PSM.5000.0004.2338	2/04/2025	Electronic File	TH000439.JPG
4035	PSM.5000.0004.2339	2/04/2025	Electronic File	IMG_2202.HEIC
4036	PSM.5000.0004.2340	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-12-19.jpg
4037	PSM.5000.0004.2341	2/04/2025	Electronic File	NDT12 - Plans and Legends Only.pdf
4038	PSM.5000.0004.2363	2/04/2025	Electronic File	NDT13 - Plans and Legends Only.pdf
4039	PSM.5000.0004.2385	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-24-39.jpg
4040	PSM.5000.0004.2386	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-27-40.jpg
4041	PSM.5000.0004.2387	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-27-53.jpg
4042	PSM.5000.0004.2388	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-29-37.jpg
4043	PSM.5000.0004.2389	2/04/2025	Electronic File	TH000440.JPG
4044	PSM.5000.0004.2390	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-34-18.jpg
4045	PSM.5000.0004.2391	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-34-51.jpg
4046	PSM.5000.0004.2392	2/04/2025	Electronic File	IMG_2204.HEIC
4047	PSM.5000.0004.2393	2/04/2025	Electronic File	IMG_2205.HEIC
4048	PSM.5000.0004.2394	2/04/2025	Electronic File	IMG_2206.HEIC
4049	PSM.5000.0004.2395	2/04/2025	Electronic File	IMG_2207.HEIC
4050	PSM.5000.0004.2396	2/04/2025	Electronic File	IMG_2208.HEIC
4051	PSM.5000.0004.2397	2/04/2025	Electronic File	IMG_2209.HEIC
4052	PSM.5000.0004.2398	2/04/2025	Electronic File	IMG_2210.HEIC
4053	PSM.5000.0004.2399	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-41-27.jpg
4054	PSM.5000.0004.2400	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-47-58.jpg
4055	PSM.5000.0004.2401	2/04/2025	Electronic File	IMG_2211.HEIC
4056	PSM.5000.0004.2402	2/04/2025	Electronic File	IMG_2212.HEIC
4057	PSM.5000.0004.2403	2/04/2025	Electronic File	IMG_2213.HEIC
4058	PSM.5000.0004.2404	2/04/2025	Electronic File	IMG_2214.HEIC
4059	PSM.5000.0004.2405	2/04/2025	Electronic File	IMG_2215.HEIC
4060	PSM.5000.0004.2406	2/04/2025	Electronic File	IMG_2216.HEIC
4061	PSM.5000.0004.2407	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-59-12.jpg
4062	PSM.5000.0004.2408	2/04/2025	Electronic File	IMG_2217.HEIC
4063	PSM.5000.0004.2409	2/04/2025	Electronic File	PSM5665 -2025-04-02-13-59-28.jpg
4064	PSM.5000.0004.2410	2/04/2025	Electronic File	IMG_2218.HEIC
4065	PSM.5000.0004.2411	2/04/2025	Electronic File	IMG_2219.HEIC
4066	PSM.5000.0004.2412	2/04/2025	Electronic File	IMG_2220.HEIC
4067	PSM.5000.0004.2413	2/04/2025	Electronic File	IMG_2221.HEIC
4068	PSM.5000.0004.2414	2/04/2025	Electronic File	IMG_2222.HEIC
4069	PSM.5000.0004.2415	2/04/2025	Electronic File	IMG_2223.HEIC
4070	PSM.5000.0004.2416	2/04/2025	Electronic File	IMG_2224.HEIC

Count	Document ID	Document Date	Document Type	Title
4071	PSM.5000.0004.2417	2/04/2025	Electronic File	IMG_2225.HEIC
4072	PSM.5000.0004.2418	2/04/2025	Electronic File	IMG_2226.HEIC
4073	PSM.5000.0004.2419	2/04/2025	Electronic File	IMG_2227.HEIC
4074	PSM.5000.0004.2420	2/04/2025	Electronic File	IMG_2228.HEIC
4075	PSM.5000.0004.2421	2/04/2025	Electronic File	IMG_2229.HEIC
4076	PSM.5000.0004.2422	2/04/2025	Electronic File	IMG_2230.HEIC
4077	PSM.5000.0004.2423	2/04/2025	Electronic File	IMG_2231.HEIC
4078	PSM.5000.0004.2424	2/04/2025	Electronic File	IMG_2232.HEIC
4079	PSM.5000.0004.2425	2/04/2025	Electronic File	IMG_2233.HEIC
4080	PSM.5000.0004.2426	2/04/2025	Electronic File	IMG_2234.HEIC
4081	PSM.5000.0004.2427	2/04/2025	Electronic File	IMG_2235.HEIC
4082	PSM.5000.0004.2428	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-07-40.jpg
4083	PSM.5000.0004.2429	2/04/2025	Electronic File	IMG_2236.HEIC
4084	PSM.5000.0004.2430	2/04/2025	Electronic File	IMG_2237.HEIC
4085	PSM.5000.0004.2431	2/04/2025	Electronic File	IMG_2238.HEIC
4086	PSM.5000.0004.2432	2/04/2025	Electronic File	IMG_2239.HEIC
4087	PSM.5000.0004.2433	2/04/2025	Electronic File	IMG_2240.HEIC
4088	PSM.5000.0004.2434	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-09-34.jpg
4089	PSM.5000.0004.2435	2/04/2025	Electronic File	IMG_2241.HEIC
4090	PSM.5000.0004.2436	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-10-09.jpg
4091	PSM.5000.0004.2437	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-10-20.jpg
4092	PSM.5000.0004.2438	2/04/2025	Electronic File	IMG_2242.HEIC
4093	PSM.5000.0004.2439	2/04/2025	Electronic File	IMG_2243.HEIC
4094	PSM.5000.0004.2440	2/04/2025	Electronic File	IMG_2244.HEIC
4095	PSM.5000.0004.2441	2/04/2025	Electronic File	IMG_2245.HEIC
4096	PSM.5000.0004.2442	2/04/2025	Electronic File	IMG_2246.HEIC
4097	PSM.5000.0004.2443	2/04/2025	Electronic File	IMG_2247.HEIC
4098	PSM.5000.0004.2444	2/04/2025	Electronic File	IMG_2248.HEIC
4099	PSM.5000.0004.2445	2/04/2025	Electronic File	IMG_2249.HEIC
4100	PSM.5000.0004.2446	2/04/2025	Electronic File	IMG_2250.HEIC
4101	PSM.5000.0004.2447	2/04/2025	Electronic File	IMG_2251.HEIC
4102	PSM.5000.0004.2448	2/04/2025	Electronic File	IMG_2252.HEIC
4103	PSM.5000.0004.2449	2/04/2025	Electronic File	IMG_2253.HEIC
4104	PSM.5000.0004.2450	2/04/2025	Electronic File	IMG_2254.HEIC
4105	PSM.5000.0004.2451	2/04/2025	Electronic File	IMG_2255.HEIC
4106	PSM.5000.0004.2452	2/04/2025	Electronic File	IMG_2256.HEIC
4107	PSM.5000.0004.2453	2/04/2025	Electronic File	IMG_2257.HEIC
4108	PSM.5000.0004.2454	2/04/2025	Electronic File	IMG_2258.HEIC
4109	PSM.5000.0004.2455	2/04/2025	Electronic File	IMG_2259.HEIC
4110	PSM.5000.0004.2456	2/04/2025	Electronic File	IMG_2260.HEIC
4111	PSM.5000.0004.2457	2/04/2025	Electronic File	IMG_2261.HEIC
4112	PSM.5000.0004.2458	2/04/2025	Electronic File	IMG_2262.HEIC
4113	PSM.5000.0004.2459	2/04/2025	Electronic File	IMG_2263.HEIC
4114	PSM.5000.0004.2460	2/04/2025	Electronic File	IMG_2264.HEIC
4115	PSM.5000.0004.2461	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-34-23.jpg
4116	PSM.5000.0004.2462	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-35-55.jpg
4117	PSM.5000.0004.2463	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-40-28.jpg
4118	PSM.5000.0004.2464	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-41-48.jpg
4119	PSM.5000.0004.2465	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-48-50.jpg
4120	PSM.5000.0004.2466	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-48-56.jpg
4121	PSM.5000.0004.2467	2/04/2025	Electronic File	PSM5665 -2025-04-02-14-48-59.jpg
4122	PSM.5000.0004.2468	2/04/2025	Electronic File	PSM5665 -2025-04-02-15-00-47.jpg
4123	PSM.5000.0004.2469	2/04/2025	Electronic File	PSM5665 -2025-04-02-15-02-55.jpg
4124	PSM.5000.0004.2470	2/04/2025	Electronic File	PSM5665 -2025-04-02-15-51-54.jpg
4125	PSM.5000.0004.2471	2/04/2025	Electronic File	PSM5665 -2025-04-02-15-55-48.jpg

Count	Document ID	Document Date	Document Type	Title
4126	PSM.5000.0004.2472	2/04/2025	Electronic File	PSM5665 -2025-04-02-15-56-00.jpg
4127	PSM.5000.0004.2473	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-07-29.jpg
4128	PSM.5000.0004.2474	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-07-53.jpg
4129	PSM.5000.0004.2475	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-08-51.jpg
4130	PSM.5000.0004.2476	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-16-12.jpg
4131	PSM.5000.0004.2477	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-19-23.jpg
4132	PSM.5000.0004.2478	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-19-36.jpg
4133	PSM.5000.0004.2479	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-25-06.jpg
4134	PSM.5000.0004.2480	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-26-12.jpg
4135	PSM.5000.0004.2481	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-28-50.jpg
4136	PSM.5000.0004.2482	2/04/2025	Electronic File	Sew_Data.ini
4137	PSM.5000.0004.2483	2/04/2025	Electronic File	SW_ACCPOINT_PT.csf
4138	PSM.5000.0004.2484	2/04/2025	Electronic File	SW_ACCPOINT_PT.dbf
4139	PSM.5000.0004.2485	2/04/2025	Electronic File	SW_ACCPOINT_PT.shp
4140	PSM.5000.0004.2486	2/04/2025	Electronic File	SW_ACCPOINT_PT.shx
4141	PSM.5000.0004.2487	2/04/2025	Electronic File	SW_PIPE_LN.csf
4142	PSM.5000.0004.2488	2/04/2025	Electronic File	SW_PIPE_LN.dbf
4143	PSM.5000.0004.2489	2/04/2025	Electronic File	SW_PIPE_LN.shp
4144	PSM.5000.0004.2490	2/04/2025	Electronic File	SW_PIPE_LN.shx
4145	PSM.5000.0004.2491	2/04/2025	Electronic File	WA_FITTING_PT.csf
4146	PSM.5000.0004.2492	2/04/2025	Electronic File	WA_FITTING_PT.dbf
4147	PSM.5000.0004.2493	2/04/2025	Electronic File	WA_FITTING_PT.shp
4148	PSM.5000.0004.2494	2/04/2025	Electronic File	WA_FITTING_PT.shx
4149	PSM.5000.0004.2495	2/04/2025	Electronic File	WA_HYDRANT_PT.csf
4150	PSM.5000.0004.2496	2/04/2025	Electronic File	WA_HYDRANT_PT.dbf
4151	PSM.5000.0004.2497	2/04/2025	Electronic File	WA_HYDRANT_PT.shp
4152	PSM.5000.0004.2498	2/04/2025	Electronic File	WA_HYDRANT_PT.shx
4153	PSM.5000.0004.2499	2/04/2025	Electronic File	WA_PIPE_LN.csf
4154	PSM.5000.0004.2500	2/04/2025	Electronic File	WA_PIPE_LN.dbf
4155	PSM.5000.0004.2501	2/04/2025	Electronic File	WA_PIPE_LN.shp
4156	PSM.5000.0004.2502	2/04/2025	Electronic File	WA_PIPE_LN.shx
4157	PSM.5000.0004.2503	2/04/2025	Electronic File	WA_VALVE_PT.csf
4158	PSM.5000.0004.2504	2/04/2025	Electronic File	Export.log
4159	PSM.5000.0004.2506	2/04/2025	Electronic File	WA_VALVE_PT.dbf
4160	PSM.5000.0004.2507	2/04/2025	Electronic File	WA_VALVE_PT.shp
4161	PSM.5000.0004.2508	2/04/2025	Electronic File	WA_VALVE_PT.shx
4162	PSM.5000.0004.2509	2/04/2025	Electronic File	PSM5665 -2025-04-02-16-59-44.jpg
4163	PSM.5000.0004.2510	2/04/2025	Electronic File	PSM5665 -2025-04-02-17-00-03.jpg
4164	PSM.5000.0004.2511	2/04/2025	Electronic File	PSM5665 -2025-04-02-17-06-33.jpg
4165	PSM.5000.0004.2512	2/04/2025	Electronic File	PSM5665 -2025-04-02-17-08-08.jpg
4166	PSM.5000.0004.2513	2/04/2025	Electronic File	PSM5665 -2025-04-02-17-16-31.jpg
4167	PSM.5000.0004.2514	2/04/2025	Electronic File	PSM5665 -2025-04-02-17-19-27.jpg
4168	PSM.5000.0004.2515	2/04/2025	Electronic File	PSM5665 -2025-04-02-17-19-42.jpg
4169	PSM.5000.0004.2516	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-24-22.jpg
4170	PSM.5000.0004.2517	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-27-32.jpg
4171	PSM.5000.0004.2518	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-27-43.jpg
4172	PSM.5000.0004.2519	3/04/2025	Electronic File	IMG_2267.HEIC
4173	PSM.5000.0004.2520	3/04/2025	Electronic File	IMG_2268.HEIC
4174	PSM.5000.0004.2521	3/04/2025	Electronic File	IMG_2269.HEIC
4175	PSM.5000.0004.2522	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-38-00.jpg
4176	PSM.5000.0004.2523	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-38-15.jpg
4177	PSM.5000.0004.2524	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-44-16.jpg
4178	PSM.5000.0004.2525	3/04/2025	Electronic File	PSM5665 -2025-04-03-08-46-18.jpg
4179	PSM.5000.0004.2526	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-01-35.jpg
4180	PSM.5000.0004.2527	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-05-28.jpg

Count	Document ID	Document Date	Document Type	Title
4181	PSM.5000.0004.2528	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-05-53.jpg
4182	PSM.5000.0004.2529	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-06-06.jpg
4183	PSM.5000.0004.2530	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-06-54.jpg
4184	PSM.5000.0004.2531	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-07-37.jpg
4185	PSM.5000.0004.2532	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-11-33.jpg
4186	PSM.5000.0004.2533	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-12-32.jpg
4187	PSM.5000.0004.2534	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-16-03.jpg
4188	PSM.5000.0004.2535	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-16-22.jpg
4189	PSM.5000.0004.2536	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-17-42.jpg
4190	PSM.5000.0004.2537	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-18-55.jpg
4191	PSM.5000.0004.2538	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-19-32.jpg
4192	PSM.5000.0004.2539	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-19-40.jpg
4193	PSM.5000.0004.2540	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-21-12.jpg
4194	PSM.5000.0004.2541	3/04/2025	Electronic File	IMG_2270.HEIC
4195	PSM.5000.0004.2542	3/04/2025	Electronic File	IMG_2271.HEIC
4196	PSM.5000.0004.2543	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-27-54.jpg
4197	PSM.5000.0004.2544	3/04/2025	Electronic File	IMG_2272.HEIC
4198	PSM.5000.0004.2545	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-32-57.jpg
4199	PSM.5000.0004.2546	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-45-12.jpg
4200	PSM.5000.0004.2547	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-45-26.jpg
4201	PSM.5000.0004.2548	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-45-55.jpg
4202	PSM.5000.0004.2549	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-46-50.jpg
4203	PSM.5000.0004.2550	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-47-05.jpg
4204	PSM.5000.0004.2551	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-47-17.jpg
4205	PSM.5000.0004.2552	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-47-25.jpg
4206	PSM.5000.0004.2553	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-48-32.jpg
4207	PSM.5000.0004.2554	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-48-40.jpg
4208	PSM.5000.0004.2555	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-49-05.jpg
4209	PSM.5000.0004.2556	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-51-51.jpg
4210	PSM.5000.0004.2557	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-54-59.jpg
4211	PSM.5000.0004.2558	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-55-22.jpg
4212	PSM.5000.0004.2559	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-55-56.jpg
4213	PSM.5000.0004.2560	3/04/2025	Electronic File	PSM5665 -2025-04-03-09-59-52.jpg
4214	PSM.5000.0004.2561	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-00-04.jpg
4215	PSM.5000.0004.2562	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-03-13.jpg
4216	PSM.5000.0004.2563	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-05-30.jpg
4217	PSM.5000.0004.2564	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-06-18.jpg
4218	PSM.5000.0004.2565	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-17-02.jpg
4219	PSM.5000.0004.2566	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-18-56.jpg
4220	PSM.5000.0004.2567	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-19-44.jpg
4221	PSM.5000.0004.2568	3/04/2025	Electronic File	IMG_2273.HEIC
4222	PSM.5000.0004.2569	3/04/2025	Electronic File	IMG_2274.HEIC
4223	PSM.5000.0004.2570	3/04/2025	Electronic File	IMG_2275.HEIC
4224	PSM.5000.0004.2571	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-26-52.jpg
4225	PSM.5000.0004.2572	3/04/2025	Electronic File	IMG_2276.HEIC
4226	PSM.5000.0004.2573	3/04/2025	Electronic File	IMG_2277.HEIC
4227	PSM.5000.0004.2574	3/04/2025	Electronic File	IMG_2278.HEIC
4228	PSM.5000.0004.2575	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-30-10.jpg
4229	PSM.5000.0004.2576	3/04/2025	Electronic File	IMG_2279.HEIC
4230	PSM.5000.0004.2577	3/04/2025	Electronic File	PSM5665 -2025-04-03-10-32-01.jpg
4231	PSM.5000.0004.2578	3/04/2025	Electronic File	IMG_2280.HEIC
4232	PSM.5000.0004.2579	3/04/2025	Electronic File	IMG_2281.HEIC
4233	PSM.5000.0004.2580	3/04/2025	Electronic File	IMG_2282.HEIC
4234	PSM.5000.0004.2581	3/04/2025	Electronic File	IMG_2283.HEIC
4235	PSM.5000.0004.2582	3/04/2025	Electronic File	IMG_2284.HEIC

Count	Document ID	Document Date	Document Type	Title
4236	PSM.5000.0004.2583	3/04/2025	Electronic File	IMG_2285.HEIC
4237	PSM.5000.0004.2584	3/04/2025	Electronic File	IMG_2286.HEIC
4238	PSM.5000.0004.2585	3/04/2025	Electronic File	IMG_2287.HEIC
4239	PSM.5000.0004.2586	3/04/2025	Electronic File	IMG_2288.HEIC
4240	PSM.5000.0004.2587	3/04/2025	Electronic File	IMG_2289.HEIC
4241	PSM.5000.0004.2588	3/04/2025	Electronic File	IMG_2290.HEIC
4242	PSM.5000.0004.2589	3/04/2025	Electronic File	IMG_2291.HEIC
4243	PSM.5000.0004.2590	3/04/2025	Electronic File	IMG_2292.HEIC
4244	PSM.5000.0004.2591	3/04/2025	Electronic File	IMG_2293.HEIC
4245	PSM.5000.0004.2592	3/04/2025	Electronic File	IMG_2294.HEIC
4246	PSM.5000.0004.2593	3/04/2025	Electronic File	IMG_2295.HEIC
4247	PSM.5000.0004.2594	3/04/2025	Electronic File	IMG_2296.HEIC
4248	PSM.5000.0004.2595	3/04/2025	Electronic File	IMG_2297.HEIC
4249	PSM.5000.0004.2596	3/04/2025	Electronic File	IMG_2298.HEIC
4250	PSM.5000.0004.2597	3/04/2025	Electronic File	IMG_2299.HEIC
4251	PSM.5000.0004.2598	3/04/2025	Electronic File	IMG_2300.HEIC
4252	PSM.5000.0004.2599	3/04/2025	Electronic File	IMG_2301.HEIC
4253	PSM.5000.0004.2600	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-15-13.jpg
4254	PSM.5000.0004.2601	3/04/2025	Electronic File	IMG_2302.HEIC
4255	PSM.5000.0004.2602	3/04/2025	Electronic File	IMG_2303.HEIC
4256	PSM.5000.0004.2603	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-18-39.jpg
4257	PSM.5000.0004.2604	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-20-02.jpg
4258	PSM.5000.0004.2605	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-20-15.jpg
4259	PSM.5000.0004.2606	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-20-36.jpg
4260	PSM.5000.0004.2607	3/04/2025	Electronic File	IMG_2304.HEIC
4261	PSM.5000.0004.2608	3/04/2025	Electronic File	IMG_2305.HEIC
4262	PSM.5000.0004.2609	3/04/2025	Electronic File	IMG_2306.HEIC
4263	PSM.5000.0004.2610	3/04/2025	Electronic File	IMG_2307.HEIC
4264	PSM.5000.0004.2611	3/04/2025	Electronic File	IMG_2308.HEIC
4265	PSM.5000.0004.2612	3/04/2025	Electronic File	IMG_2309.HEIC
4266	PSM.5000.0004.2613	3/04/2025	Electronic File	IMG_2310.HEIC
4267	PSM.5000.0004.2614	3/04/2025	Electronic File	IMG_2311.HEIC
4268	PSM.5000.0004.2615	3/04/2025	Electronic File	IMG_2312.HEIC
4269	PSM.5000.0004.2616	3/04/2025	Electronic File	IMG_2313.HEIC
4270	PSM.5000.0004.2617	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-23-06.jpg
4271	PSM.5000.0004.2618	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-23-12.jpg
4272	PSM.5000.0004.2619	3/04/2025	Electronic File	IMG_2314.HEIC
4273	PSM.5000.0004.2620	3/04/2025	Electronic File	IMG_2315.HEIC
4274	PSM.5000.0004.2621	3/04/2025	Electronic File	IMG_2316.HEIC
4275	PSM.5000.0004.2622	3/04/2025	Electronic File	IMG_2317.HEIC
4276	PSM.5000.0004.2623	3/04/2025	Electronic File	IMG_2318.HEIC
4277	PSM.5000.0004.2624	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-25-17.jpg
4278	PSM.5000.0004.2625	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-26-19.jpg
4279	PSM.5000.0004.2626	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-27-23.jpg
4280	PSM.5000.0004.2627	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-28-50.jpg
4281	PSM.5000.0004.2628	3/04/2025	Electronic File	IMG_2319.HEIC
4282	PSM.5000.0004.2629	3/04/2025	Electronic File	IMG_2320.HEIC
4283	PSM.5000.0004.2630	3/04/2025	Electronic File	IMG_2321.HEIC
4284	PSM.5000.0004.2631	3/04/2025	Electronic File	IMG_2322.HEIC
4285	PSM.5000.0004.2632	3/04/2025	Electronic File	IMG_2323.HEIC
4286	PSM.5000.0004.2633	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-29-18.jpg
4287	PSM.5000.0004.2634	3/04/2025	Electronic File	IMG_2325.HEIC
4288	PSM.5000.0004.2635	3/04/2025	Electronic File	IMG_2326.HEIC
4289	PSM.5000.0004.2636	3/04/2025	Electronic File	IMG_2327.HEIC
4290	PSM.5000.0004.2637	3/04/2025	Electronic File	IMG_2328.HEIC

Count	Document ID	Document Date	Document Type	Title
4291	PSM.5000.0004.2638	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-30-47.jpg
4292	PSM.5000.0004.2639	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-32-40.jpg
4293	PSM.5000.0004.2640	3/04/2025	Electronic File	IMG_2330.HEIC
4294	PSM.5000.0004.2641	3/04/2025	Electronic File	IMG_2331.HEIC
4295	PSM.5000.0004.2642	3/04/2025	Electronic File	IMG_2332.HEIC
4296	PSM.5000.0004.2643	3/04/2025	Electronic File	IMG_2333.HEIC
4297	PSM.5000.0004.2644	3/04/2025	Electronic File	IMG_2334.HEIC
4298	PSM.5000.0004.2645	3/04/2025	Electronic File	IMG_2335.HEIC
4299	PSM.5000.0004.2646	3/04/2025	Electronic File	IMG_2336.HEIC
4300	PSM.5000.0004.2647	3/04/2025	Electronic File	IMG_2337.HEIC
4301	PSM.5000.0004.2648	3/04/2025	Electronic File	IMG_2338.HEIC
4302	PSM.5000.0004.2649	3/04/2025	Electronic File	IMG_2339.HEIC
4303	PSM.5000.0004.2650	3/04/2025	Electronic File	IMG_2340.HEIC
4304	PSM.5000.0004.2651	3/04/2025	Electronic File	IMG_2341.MOV
4305	PSM.5000.0004.2652	3/04/2025	Electronic File	IMG_2342.HEIC
4306	PSM.5000.0004.2653	3/04/2025	Electronic File	IMG_2343.HEIC
4307	PSM.5000.0004.2654	3/04/2025	Electronic File	IMG_2344.HEIC
4308	PSM.5000.0004.2655	3/04/2025	Electronic File	IMG_2345.HEIC
4309	PSM.5000.0004.2656	3/04/2025	Electronic File	IMG_2346.HEIC
4310	PSM.5000.0004.2657	3/04/2025	Electronic File	IMG_2347.HEIC
4311	PSM.5000.0004.2658	3/04/2025	Electronic File	IMG_2348.HEIC
4312	PSM.5000.0004.2659	3/04/2025	Electronic File	IMG_2349.HEIC
4313	PSM.5000.0004.2660	3/04/2025	Electronic File	IMG_2350.HEIC
4314	PSM.5000.0004.2661	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-42-30.jpg
4315	PSM.5000.0004.2662	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-42-55.jpg
4316	PSM.5000.0004.2663	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-43-45.jpg
4317	PSM.5000.0004.2664	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-44-56.jpg
4318	PSM.5000.0004.2665	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-45-43.jpg
4319	PSM.5000.0004.2666	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-46-41.jpg
4320	PSM.5000.0004.2667	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-56-52.jpg
4321	PSM.5000.0004.2668	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-56-56.jpg
4322	PSM.5000.0004.2669	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-57-08.jpg
4323	PSM.5000.0004.2670	3/04/2025	Electronic File	PSM5665 -2025-04-03-11-57-18.jpg
4324	PSM.5000.0004.2671	3/04/2025	Electronic File	IMG_2351.HEIC
4325	PSM.5000.0004.2672	3/04/2025	Electronic File	IMG_2352.HEIC
4326	PSM.5000.0004.2673	3/04/2025	Electronic File	IMG_2353.MOV
4327	PSM.5000.0004.2674	3/04/2025	Electronic File	IMG_2354.MOV
4328	PSM.5000.0004.2675	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-10-06.jpg
4329	PSM.5000.0004.2676	3/04/2025	Electronic File	IMG_2355.HEIC
4330	PSM.5000.0004.2677	3/04/2025	Electronic File	IMG_2356.HEIC
4331	PSM.5000.0004.2678	3/04/2025	Electronic File	IMG_2357.HEIC
4332	PSM.5000.0004.2679	3/04/2025	Electronic File	IMG_2358.HEIC
4333	PSM.5000.0004.2680	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-10-44.jpg
4334	PSM.5000.0004.2681	3/04/2025	Electronic File	IMG_2359.HEIC
4335	PSM.5000.0004.2682	3/04/2025	Electronic File	IMG_2360.HEIC
4336	PSM.5000.0004.2683	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-12-07.jpg
4337	PSM.5000.0004.2684	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-12-37.jpg
4338	PSM.5000.0004.2685	3/04/2025	Electronic File	IMG_2361.HEIC
4339	PSM.5000.0004.2686	3/04/2025	Electronic File	IMG_2362.HEIC
4340	PSM.5000.0004.2687	3/04/2025	Electronic File	IMG_2363.HEIC
4341	PSM.5000.0004.2688	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-12-53.jpg
4342	PSM.5000.0004.2689	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-13-13.jpg
4343	PSM.5000.0004.2690	3/04/2025	Electronic File	IMG_2364.HEIC
4344	PSM.5000.0004.2691	3/04/2025	Electronic File	IMG_2365.HEIC
4345	PSM.5000.0004.2692	3/04/2025	Electronic File	IMG_2366.HEIC

Count	Document ID	Document Date	Document Type	Title
4346	PSM.5000.0004.2693	3/04/2025	Electronic File	IMG_2367.HEIC
4347	PSM.5000.0004.2694	3/04/2025	Electronic File	IMG_2368.HEIC
4348	PSM.5000.0004.2695	3/04/2025	Electronic File	IMG_2369.HEIC
4349	PSM.5000.0004.2696	3/04/2025	Electronic File	IMG_2370.HEIC
4350	PSM.5000.0004.2697	3/04/2025	Electronic File	IMG_2371.HEIC
4351	PSM.5000.0004.2698	3/04/2025	Electronic File	IMG_2372.HEIC
4352	PSM.5000.0004.2699	3/04/2025	Electronic File	IMG_2373.HEIC
4353	PSM.5000.0004.2700	3/04/2025	Electronic File	IMG_2374.HEIC
4354	PSM.5000.0004.2701	3/04/2025	Electronic File	IMG_2375.HEIC
4355	PSM.5000.0004.2702	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-18-25.jpg
4356	PSM.5000.0004.2703	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-19-20.jpg
4357	PSM.5000.0004.2704	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-19-33.jpg
4358	PSM.5000.0004.2705	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-21-37.jpg
4359	PSM.5000.0004.2706	3/04/2025	Electronic File	IMG_2376.HEIC
4360	PSM.5000.0004.2707	3/04/2025	Electronic File	IMG_2377.HEIC
4361	PSM.5000.0004.2708	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-26-04.jpg
4362	PSM.5000.0004.2709	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-26-08.jpg
4363	PSM.5000.0004.2710	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-26-28.jpg
4364	PSM.5000.0004.2711	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-29-54.jpg
4365	PSM.5000.0004.2712	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-32-46.jpg
4366	PSM.5000.0004.2713	3/04/2025	Electronic File	IMG_2378.HEIC
4367	PSM.5000.0004.2714	3/04/2025	Electronic File	IMG_2379.MOV
4368	PSM.5000.0004.2715	3/04/2025	Electronic File	IMG_2380.HEIC
4369	PSM.5000.0004.2716	3/04/2025	Electronic File	IMG_2381.HEIC
4370	PSM.5000.0004.2717	3/04/2025	Electronic File	IMG_2382.HEIC
4371	PSM.5000.0004.2718	3/04/2025	Electronic File	IMG_2383.HEIC
4372	PSM.5000.0004.2719	3/04/2025	Electronic File	IMG_2384.HEIC
4373	PSM.5000.0004.2720	3/04/2025	Electronic File	IMG_2385.MOV
4374	PSM.5000.0004.2721	3/04/2025	Electronic File	PSM5665 -2025-04-03-12-56-34.jpg
4375	PSM.5000.0004.2722	3/04/2025	Electronic File	IMG_2386.HEIC
4376	PSM.5000.0004.2723	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-40-09.jpg
4377	PSM.5000.0004.2724	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-40-47.jpg
4378	PSM.5000.0004.2725	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-42-00.jpg
4379	PSM.5000.0004.2726	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-42-39.jpg
4380	PSM.5000.0004.2727	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-44-01.jpg
4381	PSM.5000.0004.2728	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-44-09.jpg
4382	PSM.5000.0004.2729	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-44-14.jpg
4383	PSM.5000.0004.2730	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-45-00.jpg
4384	PSM.5000.0004.2731	3/04/2025	Electronic File	PSM5665 -2025-04-03-13-46-30.jpg
4385	PSM.5000.0004.2732	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-12-35.jpg
4386	PSM.5000.0004.2733	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-15-31.jpg
4387	PSM.5000.0004.2734	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-38-44.jpg
4388	PSM.5000.0004.2735	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-48-51.jpg
4389	PSM.5000.0004.2736	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-49-07.jpg
4390	PSM.5000.0004.2737	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-49-25.jpg
4391	PSM.5000.0004.2738	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-49-45.jpg
4392	PSM.5000.0004.2739	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-50-05.jpg
4393	PSM.5000.0004.2740	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-51-33.jpg
4394	PSM.5000.0004.2741	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-51-54.jpg
4395	PSM.5000.0004.2742	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-52-09.jpg
4396	PSM.5000.0004.2743	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-52-24.jpg
4397	PSM.5000.0004.2744	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-52-42.jpg
4398	PSM.5000.0004.2745	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-53-03.jpg
4399	PSM.5000.0004.2746	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-53-32.jpg
4400	PSM.5000.0004.2747	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-53-47.jpg

Count	Document ID	Document Date	Document Type	Title
4401	PSM.5000.0004.2748	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-54-05.jpg
4402	PSM.5000.0004.2749	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-54-25.jpg
4403	PSM.5000.0004.2750	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-54-42.jpg
4404	PSM.5000.0004.2751	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-55-01.jpg
4405	PSM.5000.0004.2752	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-55-29.jpg
4406	PSM.5000.0004.2753	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-55-47.jpg
4407	PSM.5000.0004.2754	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-56-08.jpg
4408	PSM.5000.0004.2755	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-56-22.jpg
4409	PSM.5000.0004.2756	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-56-45.jpg
4410	PSM.5000.0004.2757	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-57-08.jpg
4411	PSM.5000.0004.2758	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-57-31.jpg
4412	PSM.5000.0004.2759	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-57-54.jpg
4413	PSM.5000.0004.2760	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-58-13.jpg
4414	PSM.5000.0004.2761	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-58-30.jpg
4415	PSM.5000.0004.2762	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-58-53.jpg
4416	PSM.5000.0004.2763	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-59-01.jpg
4417	PSM.5000.0004.2764	3/04/2025	Electronic File	PSM5665 -2025-04-03-14-59-41.jpg
4418	PSM.5000.0004.2765	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-01-09.jpg
4419	PSM.5000.0004.2766	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-01-25.jpg
4420	PSM.5000.0004.2767	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-01-50.jpg
4421	PSM.5000.0004.2768	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-02-07.jpg
4422	PSM.5000.0004.2769	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-02-39.jpg
4423	PSM.5000.0004.2770	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-02-53.jpg
4424	PSM.5000.0004.2771	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-03-08.jpg
4425	PSM.5000.0004.2772	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-03-27.jpg
4426	PSM.5000.0004.2773	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-03-52.jpg
4427	PSM.5000.0004.2774	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-04-13.jpg
4428	PSM.5000.0004.2775	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-04-25.jpg
4429	PSM.5000.0004.2776	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-04-44.jpg
4430	PSM.5000.0004.2777	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-05-09.jpg
4431	PSM.5000.0004.2778	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-06-18.jpg
4432	PSM.5000.0004.2779	3/04/2025	Electronic File	250116_25010_McCrae Landslip_Ortho1cm.ecw.aux.xml
4433	PSM.5000.0004.2780	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-22-42.jpg
4434	PSM.5000.0004.2781	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-22-58.jpg
4435	PSM.5000.0004.2782	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-24-01.jpg
4436	PSM.5000.0004.2783	3/04/2025	Electronic File	PSM5665 -2025-04-03-15-47-33.jpg
4437	PSM.5000.0004.2784	6/04/2025	Electronic File	IMG_5631.JPG
4438	PSM.5000.0004.2785	6/04/2025	Electronic File	IMG_5632.JPG
4439	PSM.5000.0004.2786	6/04/2025	Electronic File	IMG_5633.JPG
4440	PSM.5000.0004.2787	6/04/2025	Electronic File	IMG_5635.JPG
4441	PSM.5000.0004.2788	6/04/2025	Electronic File	IMG_5636.JPG
4442	PSM.5000.0004.2789	6/04/2025	Electronic File	IMG_5637.JPG
4443	PSM.5000.0004.2790	6/04/2025	Electronic File	IMG_5638.JPG
4444	PSM.5000.0004.2791	6/04/2025	Electronic File	IMG_5639.JPG
4445	PSM.5000.0004.2792	6/04/2025	Electronic File	IMG_5640.JPG
4446	PSM.5000.0004.2793	6/04/2025	Electronic File	IMG_5641.JPG
4447	PSM.5000.0004.2794	6/04/2025	Electronic File	IMG_5642.JPG
4448	PSM.5000.0004.2795	6/04/2025	Electronic File	IMG_5643.JPG
4449	PSM.5000.0004.2796	6/04/2025	Electronic File	IMG_5644.JPG
4450	PSM.5000.0004.2797	6/04/2025	Electronic File	IMG_5675.JPG
4451	PSM.5000.0004.2798	6/04/2025	Electronic File	IMG_5676.JPG
4452	PSM.5000.0004.2799	6/04/2025	Electronic File	IMG_5677.JPG
4453	PSM.5000.0004.2800	6/04/2025	Electronic File	IMG_5678.JPG
4454	PSM.5000.0004.2801	6/04/2025	Electronic File	IMG_5679.JPG
4455	PSM.5000.0004.2802	6/04/2025	Electronic File	IMG_5680.JPG

Count	Document ID	Document Date	Document Type	Title
4456	PSM.5000.0004.2803	6/04/2025	Electronic File	IMG_5681.JPG
4457	PSM.5000.0004.2804	6/04/2025	Electronic File	IMG_5543.JPG
4458	PSM.5000.0004.2805	6/04/2025	Electronic File	IMG_5544.JPG
4459	PSM.5000.0004.2806	6/04/2025	Electronic File	IMG_5545.JPG
4460	PSM.5000.0004.2807	6/04/2025	Electronic File	IMG_5546.JPG
4461	PSM.5000.0004.2808	6/04/2025	Electronic File	IMG_5547.JPG
4462	PSM.5000.0004.2809	6/04/2025	Electronic File	IMG_5548.JPG
4463	PSM.5000.0004.2810	6/04/2025	Electronic File	IMG_5549.JPG
4464	PSM.5000.0004.2811	6/04/2025	Electronic File	IMG_5550.JPG
4465	PSM.5000.0004.2812	6/04/2025	Electronic File	IMG_5551.JPG
4466	PSM.5000.0004.2813	6/04/2025	Electronic File	IMG_5552.JPG
4467	PSM.5000.0004.2814	6/04/2025	Electronic File	IMG_5553.JPG
4468	PSM.5000.0004.2815	6/04/2025	Electronic File	IMG_5554.JPG
4469	PSM.5000.0004.2816	6/04/2025	Electronic File	IMG_5555.JPG
4470	PSM.5000.0004.2817	6/04/2025	Electronic File	IMG_5556.JPG
4471	PSM.5000.0004.2818	6/04/2025	Electronic File	IMG_5557.JPG
4472	PSM.5000.0004.2819	6/04/2025	Electronic File	IMG_5558.JPG
4473	PSM.5000.0004.2820	6/04/2025	Electronic File	IMG_5559.JPG
4474	PSM.5000.0004.2821	6/04/2025	Electronic File	IMG_5560.JPG
4475	PSM.5000.0004.2822	6/04/2025	Electronic File	IMG_5561.JPG
4476	PSM.5000.0004.2823	6/04/2025	Electronic File	IMG_5563.JPG
4477	PSM.5000.0004.2824	6/04/2025	Electronic File	IMG_5564.JPG
4478	PSM.5000.0004.2825	6/04/2025	Electronic File	IMG_5565.JPG
4479	PSM.5000.0004.2826	6/04/2025	Electronic File	IMG_5568.JPG
4480	PSM.5000.0004.2827	6/04/2025	Electronic File	IMG_5569.JPG
4481	PSM.5000.0004.2828	6/04/2025	Electronic File	IMG_5570.JPG
4482	PSM.5000.0004.2829	6/04/2025	Electronic File	IMG_5571.JPG
4483	PSM.5000.0004.2830	6/04/2025	Electronic File	IMG_5572.JPG
4484	PSM.5000.0004.2831	6/04/2025	Electronic File	IMG_5573.JPG
4485	PSM.5000.0004.2832	6/04/2025	Electronic File	IMG_5574.JPG
4486	PSM.5000.0004.2833	6/04/2025	Electronic File	IMG_5575.JPG
4487	PSM.5000.0004.2834	6/04/2025	Electronic File	IMG_5576.JPG
4488	PSM.5000.0004.2835	6/04/2025	Electronic File	IMG_5577.MOV
4489	PSM.5000.0004.2836	6/04/2025	Electronic File	IMG_5578.JPG
4490	PSM.5000.0004.2837	6/04/2025	Electronic File	IMG_5579.JPG
4491	PSM.5000.0004.2838	6/04/2025	Electronic File	IMG_5580.JPG
4492	PSM.5000.0004.2839	6/04/2025	Electronic File	IMG_5581.JPG
4493	PSM.5000.0004.2840	6/04/2025	Electronic File	IMG_5582.JPG
4494	PSM.5000.0004.2841	6/04/2025	Electronic File	IMG_5583.JPG
4495	PSM.5000.0004.2842	6/04/2025	Electronic File	IMG_5585.JPG
4496	PSM.5000.0004.2843	6/04/2025	Electronic File	IMG_5586.JPG
4497	PSM.5000.0004.2844	6/04/2025	Electronic File	IMG_5587.JPG
4498	PSM.5000.0004.2845	6/04/2025	Electronic File	IMG_5590.JPG
4499	PSM.5000.0004.2846	6/04/2025	Electronic File	IMG_5591.JPG
4500	PSM.5000.0004.2847	6/04/2025	Electronic File	IMG_5592.JPG
4501	PSM.5000.0004.2848	6/04/2025	Electronic File	IMG_5593.JPG
4502	PSM.5000.0004.2849	6/04/2025	Electronic File	IMG_5594.JPG
4503	PSM.5000.0004.2850	6/04/2025	Electronic File	IMG_5595.JPG
4504	PSM.5000.0004.2851	6/04/2025	Electronic File	IMG_5596.JPG
4505	PSM.5000.0004.2852	6/04/2025	Electronic File	IMG_5597.JPG
4506	PSM.5000.0004.2853	6/04/2025	Electronic File	IMG_5598.JPG
4507	PSM.5000.0004.2854	6/04/2025	Electronic File	IMG_5599.JPG
4508	PSM.5000.0004.2855	6/04/2025	Electronic File	IMG_5600.JPG
4509	PSM.5000.0004.2856	6/04/2025	Electronic File	IMG_5601.JPG
4510	PSM.5000.0004.2857	6/04/2025	Electronic File	IMG_5602.JPG

Count	Document ID	Document Date	Document Type	Title
4511	PSM.5000.0004.2858	6/04/2025	Electronic File	IMG_5634.JPG
4512	PSM.5000.0004.2859	6/04/2025	Electronic File	IMG_5645.JPG
4513	PSM.5000.0004.2860	6/04/2025	Electronic File	IMG_5646.JPG
4514	PSM.5000.0004.2861	6/04/2025	Electronic File	IMG_5647.JPG
4515	PSM.5000.0004.2862	6/04/2025	Electronic File	IMG_5648.JPG
4516	PSM.5000.0004.2863	6/04/2025	Electronic File	IMG_5649.JPG
4517	PSM.5000.0004.2864	6/04/2025	Electronic File	IMG_5650.JPG
4518	PSM.5000.0004.2865	6/04/2025	Electronic File	IMG_5651.JPG
4519	PSM.5000.0004.2866	6/04/2025	Electronic File	IMG_5652.JPG
4520	PSM.5000.0004.2867	6/04/2025	Electronic File	IMG_5653.JPG
4521	PSM.5000.0004.2868	6/04/2025	Electronic File	IMG_5654.JPG
4522	PSM.5000.0004.2869	6/04/2025	Electronic File	IMG_5655.JPG
4523	PSM.5000.0004.2870	6/04/2025	Electronic File	IMG_5656.JPG
4524	PSM.5000.0004.2871	6/04/2025	Electronic File	IMG_5657.JPG
4525	PSM.5000.0004.2872	6/04/2025	Electronic File	IMG_5658.JPG
4526	PSM.5000.0004.2873	6/04/2025	Electronic File	IMG_5659.JPG
4527	PSM.5000.0004.2874	6/04/2025	Electronic File	IMG_5660.JPG
4528	PSM.5000.0004.2875	6/04/2025	Electronic File	IMG_5661.JPG
4529	PSM.5000.0004.2876	6/04/2025	Electronic File	IMG_5662.JPG
4530	PSM.5000.0004.2877	6/04/2025	Electronic File	IMG_5663.JPG
4531	PSM.5000.0004.2878	6/04/2025	Electronic File	IMG_5664.JPG
4532	PSM.5000.0004.2879	6/04/2025	Electronic File	IMG_5665.JPG
4533	PSM.5000.0004.2880	6/04/2025	Electronic File	IMG_5666.JPG
4534	PSM.5000.0004.2881	6/04/2025	Electronic File	IMG_5667.JPG
4535	PSM.5000.0004.2882	6/04/2025	Electronic File	IMG_5669.JPG
4536	PSM.5000.0004.2883	6/04/2025	Electronic File	IMG_5670.JPG
4537	PSM.5000.0004.2884	6/04/2025	Electronic File	IMG_5671.JPG
4538	PSM.5000.0004.2885	6/04/2025	Electronic File	IMG_5672.JPG
4539	PSM.5000.0004.2886	6/04/2025	Electronic File	IMG_5673.JPG
4540	PSM.5000.0004.2887	6/04/2025	Electronic File	IMG_5674.JPG
4541	PSM.5000.0004.2888	6/04/2025	Electronic File	IMG_5682.JPG
4542	PSM.5000.0004.2889	6/04/2025	Electronic File	IMG_5683.JPG
4543	PSM.5000.0004.2890	6/04/2025	Electronic File	IMG_5684.JPG
4544	PSM.5000.0004.2891	6/04/2025	Electronic File	IMG_5685.JPG
4545	PSM.5000.0004.2892	6/04/2025	Electronic File	IMG_5686.JPG
4546	PSM.5000.0004.2893	6/04/2025	Electronic File	IMG_5687.JPG
4547	PSM.5000.0004.2894	6/04/2025	Electronic File	IMG_5688.JPG
4548	PSM.5000.0004.2895	6/04/2025	Electronic File	IMG_5689.JPG
4549	PSM.5000.0004.2896	6/04/2025	Electronic File	IMG_5690.JPG
4550	PSM.5000.0004.2897	6/04/2025	Electronic File	IMG_5691.JPG
4551	PSM.5000.0004.2898	6/04/2025	Electronic File	IMG_5692.JPG
4552	PSM.5000.0004.2899	6/04/2025	Electronic File	IMG_5693.JPG
4553	PSM.5000.0004.2900	6/04/2025	Electronic File	IMG_5694.JPG
4554	PSM.5000.0004.2901	6/04/2025	Electronic File	IMG_5695.JPG
4555	PSM.5000.0004.2902	6/04/2025	Electronic File	IMG_5696.JPG
4556	PSM.5000.0004.2903	6/04/2025	Electronic File	IMG_5697.JPG
4557	PSM.5000.0004.2904	6/04/2025	Electronic File	IMG_5698.JPG
4558	PSM.5000.0004.2905	6/04/2025	Electronic File	IMG_5699.JPG
4559	PSM.5000.0004.2906	6/04/2025	Electronic File	IMG_5700.JPG
4560	PSM.5000.0004.2907	6/04/2025	Electronic File	IMG_5701.JPG
4561	PSM.5000.0004.2908	6/04/2025	Electronic File	IMG_5702.JPG
4562	PSM.5000.0004.2909	6/04/2025	Electronic File	IMG_5703.JPG
4563	PSM.5000.0004.2910	6/04/2025	Electronic File	IMG_5704.JPG
4564	PSM.5000.0004.2911	6/04/2025	Electronic File	IMG_5705.JPG
4565	PSM.5000.0004.2912	6/04/2025	Electronic File	IMG_5706.JPG

Count	Document ID	Document Date	Document Type	Title
4566	PSM.5000.0004.2913	6/04/2025	Electronic File	IMG_5707.JPG
4567	PSM.5000.0004.2914	6/04/2025	Electronic File	IMG_5708.JPG
4568	PSM.5000.0004.2915	6/04/2025	Electronic File	IMG_5709.JPG
4569	PSM.5000.0004.2916	6/04/2025	Electronic File	IMG_5710.JPG
4570	PSM.5000.0004.2917	6/04/2025	Electronic File	IMG_5711.JPG
4571	PSM.5000.0004.2918	6/04/2025	Electronic File	IMG_5712.JPG
4572	PSM.5000.0004.2919	6/04/2025	Electronic File	IMG_5713.JPG
4573	PSM.5000.0004.2920	6/04/2025	Electronic File	IMG_5714.JPG
4574	PSM.5000.0004.2921	6/04/2025	Electronic File	IMG_5715.JPG
4575	PSM.5000.0004.2922	6/04/2025	Electronic File	IMG_5716.JPG
4576	PSM.5000.0004.2923	6/04/2025	Electronic File	IMG_5717.JPG
4577	PSM.5000.0004.2924	6/04/2025	Electronic File	IMG_5718.JPG
4578	PSM.5000.0004.2925	6/04/2025	Electronic File	IMG_5719.JPG
4579	PSM.5000.0004.2926	6/04/2025	Electronic File	IMG_5720.JPG
4580	PSM.5000.0004.2927	6/04/2025	Electronic File	IMG_5721.JPG
4581	PSM.5000.0004.2928	6/04/2025	Electronic File	IMG_5722.JPG
4582	PSM.5000.0004.2929	6/04/2025	Electronic File	IMG_5603.JPG
4583	PSM.5000.0004.2930	6/04/2025	Electronic File	IMG_5604.JPG
4584	PSM.5000.0004.2931	6/04/2025	Electronic File	IMG_5605.JPG
4585	PSM.5000.0004.2932	6/04/2025	Electronic File	IMG_5606.JPG
4586	PSM.5000.0004.2933	6/04/2025	Electronic File	IMG_5607.JPG
4587	PSM.5000.0004.2934	6/04/2025	Electronic File	IMG_5608.JPG
4588	PSM.5000.0004.2935	6/04/2025	Electronic File	IMG_5609.JPG
4589	PSM.5000.0004.2936	6/04/2025	Electronic File	IMG_5610.JPG
4590	PSM.5000.0004.2937	6/04/2025	Electronic File	IMG_5611.JPG
4591	PSM.5000.0004.2938	6/04/2025	Electronic File	IMG_5612.JPG
4592	PSM.5000.0004.2939	6/04/2025	Electronic File	IMG_5613.JPG
4593	PSM.5000.0004.2940	6/04/2025	Electronic File	IMG_5614.JPG
4594	PSM.5000.0004.2941	6/04/2025	Electronic File	IMG_5615.JPG
4595	PSM.5000.0004.2942	6/04/2025	Electronic File	IMG_5616.JPG
4596	PSM.5000.0004.2943	6/04/2025	Electronic File	IMG_5617.JPG
4597	PSM.5000.0004.2944	6/04/2025	Electronic File	IMG_5619.JPG
4598	PSM.5000.0004.2945	6/04/2025	Electronic File	IMG_5620.JPG
4599	PSM.5000.0004.2946	6/04/2025	Electronic File	IMG_5621.JPG
4600	PSM.5000.0004.2947	6/04/2025	Electronic File	IMG_5622.JPG
4601	PSM.5000.0004.2948	6/04/2025	Electronic File	IMG_5623.JPG
4602	PSM.5000.0004.2949	6/04/2025	Electronic File	IMG_5624.JPG
4603	PSM.5000.0004.2950	6/04/2025	Electronic File	IMG_5625.JPG
4604	PSM.5000.0004.2951	6/04/2025	Electronic File	IMG_5626.JPG
4605	PSM.5000.0004.2952	6/04/2025	Electronic File	IMG_5627.JPG
4606	PSM.5000.0004.2953	6/04/2025	Electronic File	IMG_5628.JPG
4607	PSM.5000.0004.2954	6/04/2025	Electronic File	IMG_5629.JPG
4608	PSM.5000.0004.2955	9/04/2025	Electronic File	Protection of South East Water Supply Assets (1).pdf
4609	PSM.5000.0004.2958	9/04/2025	Electronic File	Protection of South East Water Sewerage Assets.pdf
4610	PSM.5000.0004.2962	10/04/2025	Electronic File	NDT01 to NDT06 - Plans and Legends Only.pdf
4611	PSM.5000.0004.2984	10/04/2025	Electronic File	NDT01 to NDT06 - Plans and Legends Only annotated.pdf
4612	PSM.5000.0004.3006	10/04/2025	Electronic File	IMG_2576.HEIC
4613	PSM.5000.0004.3007	10/04/2025	Electronic File	IMG_2577.HEIC
4614	PSM.5000.0004.3008	10/04/2025	Electronic File	IMG_2578.HEIC
4615	PSM.5000.0004.3009	10/04/2025	Electronic File	IMG_2579.HEIC
4616	PSM.5000.0004.3010	10/04/2025	Electronic File	IMG_2580.HEIC
4617	PSM.5000.0004.3011	10/04/2025	Electronic File	IMG_2581.HEIC
4618	PSM.5000.0004.3012	10/04/2025	Electronic File	IMG_2582.HEIC
4619	PSM.5000.0004.3013	10/04/2025	Electronic File	IMG_2583.HEIC
4620	PSM.5000.0004.3014	10/04/2025	Electronic File	IMG_2584.HEIC

Count	Document ID	Document Date	Document Type	Title
4621	PSM.5000.0004.3015	10/04/2025	Electronic File	IMG_2585.HEIC
4622	PSM.5000.0004.3016	10/04/2025	Electronic File	IMG_2586.HEIC
4623	PSM.5000.0004.3017	10/04/2025	Electronic File	IMG_2587.MOV
4624	PSM.5000.0004.3018	10/04/2025	Electronic File	IMG_2588.HEIC
4625	PSM.5000.0004.3019	10/04/2025	Electronic File	NDT07 & NDT11 - Plans and Legends Only annotated.pdf
4626	PSM.5000.0004.3046	10/04/2025	Electronic File	IMG_2589.HEIC
4627	PSM.5000.0004.3047	10/04/2025	Electronic File	IMG_2590.HEIC
4628	PSM.5000.0004.3048	10/04/2025	Electronic File	IMG_2591.HEIC
4629	PSM.5000.0004.3049	10/04/2025	Electronic File	IMG_2592.HEIC
4630	PSM.5000.0004.3050	10/04/2025	Electronic File	IMG_2593.HEIC
4631	PSM.5000.0004.3051	10/04/2025	Electronic File	IMG_2594.HEIC
4632	PSM.5000.0004.3052	10/04/2025	Electronic File	IMG_2595.HEIC
4633	PSM.5000.0004.3053	10/04/2025	Electronic File	IMG_2596.HEIC
4634	PSM.5000.0004.3054	10/04/2025	Electronic File	IMG_2597.HEIC
4635	PSM.5000.0004.3055	10/04/2025	Electronic File	IMG_2598.PNG
4636	PSM.5000.0004.3056	10/04/2025	Electronic File	IMG_E2598.JPG
4637	PSM.5000.0004.3057	10/04/2025	Electronic File	IMG_2599.HEIC
4638	PSM.5000.0004.3058	10/04/2025	Electronic File	IMG_2600.HEIC
4639	PSM.5000.0004.3059	10/04/2025	Electronic File	IMG_2601.HEIC
4640	PSM.5000.0004.3060	10/04/2025	Electronic File	IMG_2602.HEIC
4641	PSM.5000.0004.3061	10/04/2025	Electronic File	IMG_2603.HEIC
4642	PSM.5000.0004.3062	10/04/2025	Electronic File	IMG_2604.HEIC
4643	PSM.5000.0004.3063	10/04/2025	Electronic File	IMG_2605.HEIC
4644	PSM.5000.0004.3064	10/04/2025	Electronic File	IMG_2606.HEIC
4645	PSM.5000.0004.3065	10/04/2025	Electronic File	IMG_2607.HEIC
4646	PSM.5000.0004.3066	10/04/2025	Electronic File	IMG_2608.HEIC
4647	PSM.5000.0004.3067	10/04/2025	Electronic File	IMG_2609.HEIC
4648	PSM.5000.0004.3068	10/04/2025	Electronic File	IMG_2610.HEIC
4649	PSM.5000.0004.3069	10/04/2025	Electronic File	IMG_2611.HEIC
4650	PSM.5000.0004.3070	10/04/2025	Electronic File	IMG_2612.HEIC
4651	PSM.5000.0004.3071	10/04/2025	Electronic File	IMG_2613.HEIC
4652	PSM.5000.0004.3072	10/04/2025	Electronic File	IMG_2614.HEIC
4653	PSM.5000.0004.3073	10/04/2025	Electronic File	IMG_2615.MOV
4654	PSM.5000.0004.3074	10/04/2025	Electronic File	IMG_2618.MOV
4655	PSM.5000.0004.3075	10/04/2025	Electronic File	IMG_2619.MOV
4656	PSM.5000.0004.3076	10/04/2025	Electronic File	IMG_2620.MOV
4657	PSM.5000.0004.3077	10/04/2025	Electronic File	IMG_2621.MOV
4658	PSM.5000.0004.3078	10/04/2025	Electronic File	IMG_2623.MOV
4659	PSM.5000.0004.3079	10/04/2025	Electronic File	IMG_2626.MOV
4660	PSM.5000.0004.3080	10/04/2025	Electronic File	IMG_2627.HEIC
4661	PSM.5000.0004.3081	10/04/2025	Electronic File	IMG_2628.HEIC
4662	PSM.5000.0004.3082	10/04/2025	Electronic File	IMG_2629.HEIC
4663	PSM.5000.0004.3083	10/04/2025	Electronic File	IMG_2630.HEIC
4664	PSM.5000.0004.3084	10/04/2025	Electronic File	IMG_2631.HEIC
4665	PSM.5000.0004.3085	10/04/2025	Electronic File	IMG_2632.HEIC
4666	PSM.5000.0004.3086	10/04/2025	Electronic File	IMG_2633.HEIC
4667	PSM.5000.0004.3087	10/04/2025	Electronic File	IMG_2634.HEIC
4668	PSM.5000.0004.3088	10/04/2025	Electronic File	NDT08 to NDT10 - Plans and Legends Only annotated.pdf
4669	PSM.5000.0004.3130	11/04/2025	Electronic File	NDT12 - Plans and Legends Only annotated.pdf
4670	PSM.5000.0004.3152	11/04/2025	Electronic File	NDT13 - Plans and Legends Only annotated.pdf
4671	PSM.5000.0004.3174	14/04/2025	Electronic File	READ ME.txt
4672	PSM.5000.0004.3200	29/04/2025	Electronic File	IMG_5369.HEIC
4673	PSM.5000.0004.3201	29/04/2025	Electronic File	IMG_5370.HEIC
4674	PSM.5000.0004.3202	29/04/2025	Electronic File	IMG_5371.HEIC
4675	PSM.5000.0004.3203	29/04/2025	Electronic File	IMG_5372.MOV

Count	Document ID	Document Date	Document Type	Title
4676	PSM.5000.0004.3204	29/04/2025	Electronic File	IMG_5373.HEIC
4677	PSM.5000.0004.3205	29/04/2025	Electronic File	IMG_5374.HEIC
4678	PSM.5000.0004.3206	29/04/2025	Electronic File	IMG_5376.HEIC
4679	PSM.5000.0004.3207	29/04/2025	Electronic File	IMG_5377.HEIC
4680	PSM.5000.0004.3208	29/04/2025	Electronic File	IMG_5378.HEIC
4681	PSM.5000.0004.3209	29/04/2025	Electronic File	IMG_5379.HEIC
4682	PSM.5000.0004.3210	30/04/2025	Electronic File	IMG_2900.HEIC
4683	PSM.5000.0004.3211	30/04/2025	Electronic File	IMG_2901.HEIC
4684	PSM.5000.0004.3212	30/04/2025	Electronic File	IMG_2902.HEIC
4685	PSM.5000.0004.3213	30/04/2025	Electronic File	IMG_2895.HEIC
4686	PSM.5000.0004.3214	30/04/2025	Electronic File	IMG_2896.HEIC
4687	PSM.5000.0004.3215	30/04/2025	Electronic File	IMG_2897.HEIC
4688	PSM.5000.0004.3216	30/04/2025	Electronic File	IMG_2898.HEIC
4689	PSM.5000.0004.3217	30/04/2025	Electronic File	IMG_2903.HEIC
4690	PSM.5000.0004.3218	1/05/2025	Electronic File	IMG_5382.HEIC
4691	PSM.5000.0004.3219	1/05/2025	Electronic File	IMG_5383.HEIC
4692	PSM.5000.0004.3220	1/05/2025	Electronic File	IMG_2913.HEIC
4693	PSM.5000.0004.3221	1/05/2025	Electronic File	IMG_2915.HEIC
4694	PSM.5000.0004.3222	1/05/2025	Electronic File	IMG_2916.HEIC
4695	PSM.5000.0004.3223	6/05/2025	Electronic File	IMG_2911.HEIC
4696	PSM.5000.0004.3224	6/05/2025	Electronic File	IMG_2912.HEIC
4697	PSM.5000.0004.3225	6/05/2025	Electronic File	IMG_2917.HEIC
4698	PSM.5000.0004.3226	6/05/2025	Electronic File	IMG_2906.HEIC
4699	PSM.5000.0004.3227	6/05/2025	Electronic File	IMG_2907.HEIC
4700	PSM.5000.0004.3228	6/05/2025	Electronic File	IMG_2910.HEIC
4701	PSM.5000.0004.3229	6/05/2025	Electronic File	IMG_2892.HEIC
4702	PSM.5000.0004.3230	6/05/2025	Electronic File	IMG_2893.HEIC
4703	PSM.5000.0004.3231	6/05/2025	Electronic File	IMG_2894.HEIC
4704	PSM.5000.0004.3232	6/05/2025	Electronic File	IMG_2904.HEIC
4705	PSM.5000.0004.3233	6/05/2025	Electronic File	IMG_E2891.HEIC
4706	PSM.5000.0004.3234	7/05/2025	Electronic File	IMG_5390.HEIC
4707	PSM.5000.0004.3235	7/05/2025	Electronic File	IMG_5391.HEIC
4708	PSM.5000.0004.3236	7/05/2025	Electronic File	IMG_5392.HEIC
4709	PSM.5000.0004.3237	7/05/2025	Electronic File	IMG_5393.HEIC
4710	PSM.5000.0004.3238	7/05/2025	Electronic File	IMG_5394.HEIC
4711	PSM.5000.0004.3239	7/05/2025	Electronic File	IMG_5395.HEIC
4712	PSM.5000.0004.3240	7/05/2025	Electronic File	IMG_5396.HEIC
4713	PSM.5000.0004.3241	7/05/2025	Electronic File	IMG_E5397.HEIC
4714	PSM.5000.0004.3242	7/05/2025	Electronic File	IMG_5398.HEIC
4715	PSM.5000.0004.3243	7/05/2025	Electronic File	IMG_5399.HEIC
4716	PSM.5000.0004.3244	7/05/2025	Electronic File	IMG_5400.HEIC
4717	PSM.5000.0004.3245	7/05/2025	Electronic File	IMG_5401.HEIC
4718	PSM.5000.0004.3246	7/05/2025	Electronic File	IMG_5402.HEIC
4719	PSM.5000.0004.3247	7/05/2025	Electronic File	IMG_5403.HEIC
4720	PSM.5000.0004.3248	7/05/2025	Electronic File	IMG_5404.HEIC
4721	PSM.5000.0004.3249	7/05/2025	Electronic File	IMG_5405.HEIC
4722	PSM.5000.0004.3250	7/05/2025	Electronic File	IMG_5406.HEIC
4723	PSM.5000.0004.3251	7/05/2025	Electronic File	IMG_5407.HEIC
4724	PSM.5000.0004.3252	7/05/2025	Electronic File	IMG_5408.HEIC
4725	PSM.5000.0004.3253	7/05/2025	Electronic File	IMG_5409.HEIC
4726	PSM.5000.0004.3254	7/05/2025	Electronic File	IMG_5411.HEIC
4727	PSM.5000.0004.3255	7/05/2025	Electronic File	IMG_5412.HEIC
4728	PSM.5000.0004.3256	7/05/2025	Electronic File	IMG_5413.HEIC
4729	PSM.5000.0004.3257	7/05/2025	Electronic File	IMG_5414.HEIC
4730	PSM.5000.0004.3258	7/05/2025	Electronic File	IMG_5416.HEIC

Count	Document ID	Document Date	Document Type	Title
4731	PSM.5000.0004.3259	7/05/2025	Electronic File	IMG_5417.HEIC
4732	PSM.5000.0004.3260	7/05/2025	Electronic File	IMG_5418.HEIC
4733	PSM.5000.0004.3261	7/05/2025	Electronic File	IMG_2934.HEIC
4734	PSM.5000.0004.3262	7/05/2025	Electronic File	IMG_2935.HEIC
4735	PSM.5000.0004.3263	7/05/2025	Electronic File	IMG_2936.HEIC
4736	PSM.5000.0004.3264	7/05/2025	Electronic File	IMG_2927.HEIC
4737	PSM.5000.0004.3265	7/05/2025	Electronic File	IMG_2928.HEIC
4738	PSM.5000.0004.3266	7/05/2025	Electronic File	IMG_2929.HEIC
4739	PSM.5000.0004.3267	7/05/2025	Electronic File	IMG_2930.HEIC
4740	PSM.5000.0004.3268	7/05/2025	Electronic File	IMG_2931.HEIC
4741	PSM.5000.0004.3269	7/05/2025	Electronic File	IMG_2932.HEIC
4742	PSM.5000.0004.3270	7/05/2025	Electronic File	IMG_2918.HEIC
4743	PSM.5000.0004.3271	7/05/2025	Electronic File	IMG_2919.HEIC
4744	PSM.5000.0004.3272	7/05/2025	Electronic File	IMG_2920.HEIC
4745	PSM.5000.0004.3273	7/05/2025	Electronic File	IMG_2923.HEIC
4746	PSM.5000.0004.3274	7/05/2025	Electronic File	IMG_2924.HEIC
4747	PSM.5000.0004.3275	7/05/2025	Electronic File	IMG_2926.HEIC
4748	PSM.5000.0004.3276	8/05/2025	Electronic File	IMG_5424.HEIC
4749	PSM.5000.0004.3277	8/05/2025	Electronic File	IMG_5425.HEIC
4750	PSM.5000.0004.3278	8/05/2025	Electronic File	IMG_5426.HEIC
4751	PSM.5000.0004.3279	8/05/2025	Electronic File	IMG_2938.HEIC
4752	PSM.5000.0004.3280	8/05/2025	Electronic File	IMG_2939.HEIC
4753	PSM.5000.0004.3281	8/05/2025	Electronic File	IMG_2937.HEIC
4754	PSM.5000.0004.3282	9/05/2025	Electronic File	10-12 View Point Retaining Wall drawings.pptx
4755	PSM.5000.0004.3415	14/05/2025	Electronic File	NDT04 looking to 6 View Point Rd.MP4
4756	PSM.5000.0004.3420	14/05/2025	Electronic File	NDT04 looking to pipe.MP4
4757	PSM.5000.0004.3425	14/05/2025	Electronic File	NDT04 looking to pipe 2.MP4
4758	PSM.5000.0004.3432	14/05/2025	Electronic File	NDT03 looking to Coburn Ave.MP4
4759	PSM.5000.0004.3438	14/05/2025	Electronic File	NDT03 looking to house away from road.MP4
4760	PSM.5000.0004.3445	14/05/2025	Electronic File	NDT03 looking to road.MP4
4761	PSM.5000.0004.3450	14/05/2025	Electronic File	NDT05 looking away from pipe.MP4
4762	PSM.5000.0004.3455	14/05/2025	Electronic File	NDT05 looking to pipe.MP4
4763	PSM.5000.0004.3461	14/05/2025	Electronic File	Browne St intersection looking 1m downslope of stormwater defect along main.MP4
4764	PSM.5000.0004.3468	14/05/2025	Electronic File	Browne St looking along strike of water main uphill.MP4
4765	PSM.5000.0004.3473	14/05/2025	Electronic File	Browne St intersection.MP4
4766	PSM.5000.0004.3479	14/05/2025	Electronic File	NDT13 looking away from manhole.MP4
4767	PSM.5000.0004.3485	14/05/2025	Electronic File	NDT13 looking towards manhole.MP4
4768	PSM.5000.0004.3492	14/05/2025	Electronic File	NDT12 looking away from manhole towards road.MP4
4769	PSM.5000.0004.3497	14/05/2025	Electronic File	NDT12 looking to manhole towards house.MP4
4770	PSM.5000.0004.3502	14/05/2025	Electronic File	NDT06 looking away from sewer pipe.MP4
4771	PSM.5000.0004.3509	14/05/2025	Electronic File	NDT06 looking towards sewer.MP4
4772	PSM.5000.0004.3516	14/05/2025	Electronic File	NDT06 looking to pipe.MP4
4773	PSM.5000.0004.3522	14/05/2025	Electronic File	NDT11 looking to road.MP4
4774	PSM.5000.0004.3529	14/05/2025	Electronic File	NDT11 looking towards house.MP4
4775	PSM.5000.0004.3534	14/05/2025	Electronic File	NDT07 looking towards road.MP4
4776	PSM.5000.0004.3540	14/05/2025	Electronic File	GOPR1797.JPG
4777	PSM.5000.0004.3541	14/05/2025	Electronic File	NDT07 looking to stormwater pipe 3.MP4
4778	PSM.5000.0004.3546	14/05/2025	Electronic File	NDT07 looking to stormwater pipe.MP4
4779	PSM.5000.0004.3551	14/05/2025	Electronic File	NDT07 looking to stormwater pipe 2.MP4
4780	PSM.5000.0004.3557	14/05/2025	Electronic File	NDT08 looking upslope of Coburn Ave.MP4
4781	PSM.5000.0004.3564	14/05/2025	Electronic File	NDT08 looking to house and sewer main.MP4
4782	PSM.5000.0004.3571	14/05/2025	Electronic File	NDT09 looking downslope.MP4
4783	PSM.5000.0004.3577	14/05/2025	Electronic File	NDT09 looking along strike of pipe.MP4
4784	PSM.5000.0004.3583	14/05/2025	Electronic File	NDT09 looking upslope towards pipe.MP4
4785	PSM.5000.0004.3590	14/05/2025	Electronic File	NDT10 looking downslope Coburn Ave.MP4

Count	Document ID	Document Date	Document Type	Title
4786	PSM.5000.0004.3757	16/05/2025	Electronic File	IMG_0358 2023-11-23 23_21_34.HEIC
4787	PSM.5000.0004.3758	16/05/2025	Electronic File	IMG_2516 2023-11-23 23_21_05.HEIC
4788	PSM.5000.0004.3759	16/05/2025	Electronic File	IMG_2517 2023-11-23 23_21_05.HEIC
4789	PSM.5000.0004.3760	16/05/2025	Electronic File	IMG_2518 2023-11-23 23_21_06.HEIC
4790	PSM.5000.0004.3761	16/05/2025	Electronic File	IMG_2519 2023-11-23 23_21_06.HEIC
4791	PSM.5000.0004.3762	16/05/2025	Electronic File	IMG_2520 2023-11-23 23_21_07.HEIC
4792	PSM.5000.0004.3763	16/05/2025	Electronic File	IMG_2521 2023-11-23 23_21_07.HEIC
4793	PSM.5000.0004.3764	16/05/2025	Electronic File	IMG_2522 2023-11-23 23_21_08.HEIC
4794	PSM.5000.0004.3765	16/05/2025	Electronic File	IMG_2523 2023-11-23 23_21_08.HEIC
4795	PSM.5000.0004.3766	16/05/2025	Electronic File	IMG_2524 2023-11-23 23_21_08.HEIC
4796	PSM.5000.0004.3767	16/05/2025	Electronic File	IMG_2525 2023-11-23 23_21_09.HEIC
4797	PSM.5000.0004.3768	16/05/2025	Electronic File	IMG_2526 2023-11-23 23_21_11.HEIC
4798	PSM.5000.0004.3769	16/05/2025	Electronic File	IMG_2527 2023-11-23 23_21_15.HEIC
4799	PSM.5000.0004.3770	16/05/2025	Electronic File	IMG_2528 2023-11-23 23_21_15.HEIC
4800	PSM.5000.0004.3771	16/05/2025	Electronic File	IMG_2529 2023-11-23 23_21_18.HEIC
4801	PSM.5000.0004.3772	16/05/2025	Electronic File	IMG_2530 2023-11-23 23_21_22.HEIC
4802	PSM.5000.0004.3773	16/05/2025	Electronic File	IMG_2531 2023-11-23 23_21_22.HEIC
4803	PSM.5000.0004.3774	16/05/2025	Electronic File	IMG_2532 2023-11-23 23_21_22.HEIC
4804	PSM.5000.0004.3775	16/05/2025	Electronic File	IMG_2533 2023-11-23 23_21_23.HEIC
4805	PSM.5000.0004.3776	16/05/2025	Electronic File	IMG_2534 2023-11-23 23_21_23.HEIC
4806	PSM.5000.0004.3777	16/05/2025	Electronic File	IMG_2535 2023-11-23 23_21_24.HEIC
4807	PSM.5000.0004.3778	16/05/2025	Electronic File	IMG_2536 2023-11-23 23_21_25.HEIC
4808	PSM.5000.0004.3779	16/05/2025	Electronic File	IMG_2537 2023-11-23 23_21_26.HEIC
4809	PSM.5000.0004.3780	16/05/2025	Electronic File	IMG_2538 2023-11-23 23_21_29.HEIC
4810	PSM.5000.0004.3781	16/05/2025	Electronic File	IMG_2539 2023-11-23 23_21_34.HEIC
4811	PSM.5000.0004.3782	16/05/2025	Electronic File	IMG_2540 2023-11-23 23_21_34.HEIC
4812	PSM.5000.0004.3783	16/05/2025	Electronic File	IMG_2541 2023-11-23 23_21_35.HEIC
4813	PSM.5000.0004.3784	16/05/2025	Electronic File	IMG_2542 2023-11-23 23_21_35.HEIC
4814	PSM.5000.0004.3785	16/05/2025	Electronic File	IMG_2543 2023-11-23 23_21_36.HEIC
4815	PSM.5000.0004.3786	16/05/2025	Electronic File	IMG_2544 2023-11-23 23_21_36.HEIC
4816	PSM.5000.0004.3787	16/05/2025	Electronic File	IMG_2545 2023-11-23 23_21_36.HEIC
4817	PSM.5000.0004.3788	16/05/2025	Electronic File	IMG_2546 2023-11-23 23_21_37.HEIC
4818	PSM.5000.0004.3789	16/05/2025	Electronic File	IMG_2547 2023-11-23 23_21_40.HEIC
4819	PSM.5000.0004.3790	16/05/2025	Electronic File	IMG_2548 2023-11-23 23_21_42.HEIC
4820	PSM.5000.0004.3791	16/05/2025	Electronic File	IMG_2549 2023-11-23 23_21_44.HEIC
4821	PSM.5000.0004.3792	16/05/2025	Electronic File	IMG_2550 2023-11-23 23_21_45.HEIC
4822	PSM.5000.0004.3793	16/05/2025	Electronic File	IMG_2551 2023-11-23 23_21_45.HEIC
4823	PSM.5000.0004.3794	16/05/2025	Electronic File	IMG_2552 2023-11-23 23_21_46.HEIC
4824	PSM.5000.0004.3795	16/05/2025	Electronic File	IMG_2553 2023-11-23 23_21_50.HEIC
4825	PSM.5000.0004.3796	16/05/2025	Electronic File	IMG_2554 2023-11-23 23_21_50.HEIC
4826	PSM.5000.0004.3797	16/05/2025	Electronic File	IMG_2555 2023-11-23 23_21_51.HEIC
4827	PSM.5000.0004.3798	16/05/2025	Electronic File	IMG_2556 2023-11-23 23_21_51.HEIC
4828	PSM.5000.0004.3799	16/05/2025	Electronic File	IMG_2557 2023-11-23 23_21_52.HEIC
4829	PSM.5000.0004.3800	16/05/2025	Electronic File	IMG_2558 2023-11-23 23_21_52.HEIC
4830	PSM.5000.0004.3801	16/05/2025	Electronic File	IMG_2559 2023-11-23 23_21_52.HEIC
4831	PSM.5000.0004.3802	16/05/2025	Electronic File	IMG_2560 2023-11-23 23_21_53.HEIC
4832	PSM.5000.0004.3803	16/05/2025	Electronic File	IMG_2561 2023-11-23 23_21_54.HEIC
4833	PSM.5000.0004.3804	16/05/2025	Electronic File	IMG_2562 2023-11-23 23_21_54.HEIC
4834	PSM.5000.0004.3805	16/05/2025	Electronic File	IMG_2563 2023-11-23 23_21_54.HEIC
4835	PSM.5000.0004.3806	16/05/2025	Electronic File	IMG_2564 2023-11-23 23_21_55.HEIC
4836	PSM.5000.0004.3807	16/05/2025	Electronic File	IMG_2565 2023-11-23 23_21_55.HEIC
4837	PSM.5000.0004.3808	16/05/2025	Electronic File	IMG_2566 2023-11-23 23_21_56.HEIC
4838	PSM.5000.0004.3809	16/05/2025	Electronic File	IMG_2567 2023-11-23 23_21_56.HEIC
4839	PSM.5000.0004.3810	16/05/2025	Electronic File	IMG_2568 2023-11-23 23_21_57.HEIC
4840	PSM.5000.0004.3811	16/05/2025	Electronic File	IMG_2569 2023-11-23 23_21_58.HEIC

Count	Document ID	Document Date	Document Type	Title
4841	PSM.5000.0004.3812	16/05/2025	Electronic File	IMG_2570 2023-11-23 23_21_58.HEIC
4842	PSM.5000.0004.3813	16/05/2025	Electronic File	IMG_2571 2023-11-23 23_21_59.HEIC
4843	PSM.5000.0004.3814	16/05/2025	Electronic File	IMG_2572 2023-11-23 23_22_01.HEIC
4844	PSM.5000.0004.3815	16/05/2025	Electronic File	IMG_2573 2023-11-23 23_22_02.HEIC
4845	PSM.5000.0004.3816	16/05/2025	Electronic File	IMG_2574 2023-11-23 23_22_02.HEIC
4846	PSM.5000.0004.3817	16/05/2025	Electronic File	IMG_2575 2023-11-23 23_22_03.HEIC
4847	PSM.5000.0004.3818	16/05/2025	Electronic File	IMG_2576 2023-11-23 23_22_03.HEIC
4848	PSM.5000.0004.3819	16/05/2025	Electronic File	IMG_2577 2023-11-23 23_22_03.HEIC
4849	PSM.5000.0004.3820	16/05/2025	Electronic File	IMG_2578 2023-11-23 23_22_04.HEIC
4850	PSM.5000.0004.3821	16/05/2025	Electronic File	IMG_2579 2023-11-23 23_22_04.HEIC
4851	PSM.5000.0004.3822	16/05/2025	Electronic File	IMG_2580 2023-11-23 23_22_05.HEIC
4852	PSM.5000.0004.3823	16/05/2025	Electronic File	IMG_2581 2023-11-23 23_22_05.HEIC
4853	PSM.5000.0004.3824	16/05/2025	Electronic File	IMG_2582 2023-11-23 23_22_06.HEIC
4854	PSM.5000.0004.3825	16/05/2025	Electronic File	IMG_2583 2023-11-23 23_22_12.HEIC
4855	PSM.5000.0004.3826	16/05/2025	Electronic File	IMG_2584 2023-11-23 23_22_13.HEIC
4856	PSM.5000.0004.3827	16/05/2025	Electronic File	IMG_2585 2023-11-23 23_22_13.HEIC
4857	PSM.5000.0004.3828	16/05/2025	Electronic File	IMG_2586 2023-11-23 23_22_13.HEIC
4858	PSM.5000.0004.3829	16/05/2025	Electronic File	IMG_2587 2023-11-23 23_22_14.HEIC
4859	PSM.5000.0004.3830	16/05/2025	Electronic File	IMG_2588 2023-11-23 23_22_18.HEIC
4860	PSM.5000.0004.3831	16/05/2025	Electronic File	IMG_2589 2023-11-23 23_22_18.HEIC
4861	PSM.5000.0004.3832	16/05/2025	Electronic File	IMG_2590 2023-11-23 23_22_19.HEIC
4862	PSM.5000.0004.3833	16/05/2025	Electronic File	IMG_2591 2023-11-23 23_22_19.HEIC
4863	PSM.5000.0004.3834	16/05/2025	Electronic File	IMG_2592 2023-11-23 23_22_20.HEIC
4864	PSM.5000.0004.3835	16/05/2025	Electronic File	IMG_2593 2023-11-23 23_22_20.HEIC
4865	PSM.5000.0004.3836	16/05/2025	Electronic File	IMG_2594 2023-11-23 23_22_25.HEIC
4866	PSM.5000.0004.3837	16/05/2025	Electronic File	IMG_2595 2023-11-23 23_22_26.HEIC
4867	PSM.5000.0004.3838	16/05/2025	Electronic File	IMG_2596 2023-11-23 23_22_26.HEIC
4868	PSM.5000.0004.3839	16/05/2025	Electronic File	IMG_2597 2023-11-23 23_22_26.HEIC
4869	PSM.5000.0004.3840	16/05/2025	Electronic File	IMG_2598 2023-11-23 23_22_28.HEIC
4870	PSM.5000.0004.3841	16/05/2025	Electronic File	IMG_2599 2023-11-23 23_22_33.HEIC
4871	PSM.5000.0004.3842	16/05/2025	Electronic File	IMG_2600 2023-11-23 23_22_33.HEIC
4872	PSM.5000.0004.3843	16/05/2025	Electronic File	IMG_2601 2023-11-23 23_22_33.HEIC
4873	PSM.5000.0004.3844	16/05/2025	Electronic File	IMG_2602 2023-11-23 23_22_34.HEIC
4874	PSM.5000.0004.3845	16/05/2025	Electronic File	IMG_2603 2023-11-23 23_22_34.HEIC
4875	PSM.5000.0004.3846	16/05/2025	Electronic File	IMG_2604 2023-11-23 23_22_35.HEIC
4876	PSM.5000.0004.3847	16/05/2025	Electronic File	IMG_2605 2023-11-23 23_22_36.HEIC
4877	PSM.5000.0004.3848	16/05/2025	Electronic File	IMG_2606 2023-11-23 23_22_37.HEIC
4878	PSM.5000.0004.3849	16/05/2025	Electronic File	IMG_2607 2023-11-23 23_22_37.HEIC
4879	PSM.5000.0004.3850	16/05/2025	Electronic File	IMG_2608 2023-11-23 23_23_47.MOV
4880	PSM.5000.0004.3851	16/05/2025	Electronic File	IMG_2609 2023-11-23 23_22_40.HEIC
4881	PSM.5000.0004.3852	16/05/2025	Electronic File	IMG_2610 2023-11-23 23_22_42.HEIC
4882	PSM.5000.0004.3853	16/05/2025	Electronic File	IMG_2611 2023-11-23 23_22_48.HEIC
4883	PSM.5000.0004.3854	16/05/2025	Electronic File	IMG_2612 2023-11-23 23_23_50.MOV
4884	PSM.5000.0004.3855	16/05/2025	Electronic File	IMG_2613 2023-11-23 23_22_48.HEIC
4885	PSM.5000.0004.3856	16/05/2025	Electronic File	IMG_2614 2023-11-23 23_22_49.HEIC
4886	PSM.5000.0004.3857	16/05/2025	Electronic File	IMG_2615 2023-11-23 23_22_49.HEIC
4887	PSM.5000.0004.3858	16/05/2025	Electronic File	IMG_2616 2023-11-23 23_22_50.HEIC
4888	PSM.5000.0004.3859	16/05/2025	Electronic File	IMG_2617 2023-11-23 23_22_50.HEIC
4889	PSM.5000.0004.3860	16/05/2025	Electronic File	IMG_2618 2023-11-23 23_22_50.HEIC
4890	PSM.5000.0004.3861	16/05/2025	Electronic File	IMG_2619 2023-11-23 23_22_51.HEIC
4891	PSM.5000.0004.3862	16/05/2025	Electronic File	IMG_2620 2023-11-23 23_22_51.HEIC
4892	PSM.5000.0004.3863	16/05/2025	Electronic File	IMG_2621 2023-11-23 23_22_51.HEIC
4893	PSM.5000.0004.3864	16/05/2025	Electronic File	IMG_2622 2023-11-23 23_22_52.HEIC
4894	PSM.5000.0004.3865	16/05/2025	Electronic File	IMG_2623 2023-11-23 23_22_56.HEIC
4895	PSM.5000.0004.3866	16/05/2025	Electronic File	IMG_2626 2023-11-23 23_22_59.HEIC

Count	Document ID	Document Date	Document Type	Title
4896	PSM.5000.0004.3867	16/05/2025	Electronic File	IMG_2627 2023-11-23 23_22_59.HEIC
4897	PSM.5000.0004.3868	16/05/2025	Electronic File	IMG_2628 2023-11-23 23_23_00.HEIC
4898	PSM.5000.0004.3869	16/05/2025	Electronic File	IMG_2629 2023-11-23 23_23_02.HEIC
4899	PSM.5000.0004.3870	16/05/2025	Electronic File	IMG_2632 2023-11-23 23_23_04.HEIC
4900	PSM.5000.0004.3871	16/05/2025	Electronic File	IMG_2633 2023-11-23 23_23_04.HEIC
4901	PSM.5000.0004.3872	16/05/2025	Electronic File	IMG_2634 2023-11-23 23_23_05.HEIC
4902	PSM.5000.0004.3873	16/05/2025	Electronic File	IMG_2635 2023-11-23 23_23_51.MOV
4903	PSM.5000.0004.3874	16/05/2025	Electronic File	IMG_2636 2023-11-23 23_23_07.HEIC
4904	PSM.5000.0004.3875	16/05/2025	Electronic File	IMG_2637 2023-11-23 23_23_11.HEIC
4905	PSM.5000.0004.3876	16/05/2025	Electronic File	IMG_2638 2023-11-23 23_23_11.HEIC
4906	PSM.5000.0004.3877	16/05/2025	Electronic File	IMG_2639 2023-11-23 23_23_12.HEIC
4907	PSM.5000.0004.3878	16/05/2025	Electronic File	IMG_2640 2023-11-23 23_23_12.HEIC
4908	PSM.5000.0004.3879	16/05/2025	Electronic File	IMG_2641 2023-11-23 23_23_13.HEIC
4909	PSM.5000.0004.3880	16/05/2025	Electronic File	IMG_2643 2023-11-23 23_23_14.HEIC
4910	PSM.5000.0004.3881	16/05/2025	Electronic File	IMG_2644 2023-11-23 23_23_15.HEIC
4911	PSM.5000.0004.3882	16/05/2025	Electronic File	IMG_2645 2023-11-23 23_23_17.HEIC
4912	PSM.5000.0004.3883	16/05/2025	Electronic File	IMG_2646 2023-11-23 23_23_19.HEIC
4913	PSM.5000.0004.3884	16/05/2025	Electronic File	IMG_2647 2023-11-23 23_23_20.HEIC
4914	PSM.5000.0004.3885	16/05/2025	Electronic File	IMG_2648 2023-11-23 23_23_21.HEIC
4915	PSM.5000.0004.3886	16/05/2025	Electronic File	IMG_2649 2023-11-23 23_23_25.HEIC
4916	PSM.5000.0004.3887	16/05/2025	Electronic File	IMG_2650 2023-11-23 23_23_25.HEIC
4917	PSM.5000.0004.3888	16/05/2025	Electronic File	IMG_2651 2023-11-23 23_23_26.HEIC
4918	PSM.5000.0004.3889	16/05/2025	Electronic File	IMG_2652 2023-11-23 23_23_26.HEIC
4919	PSM.5000.0004.3890	16/05/2025	Electronic File	IMG_2653 2023-11-23 23_23_26.HEIC
4920	PSM.5000.0004.3891	16/05/2025	Electronic File	IMG_2654 2023-11-23 23_23_27.HEIC
4921	PSM.5000.0004.3892	16/05/2025	Electronic File	IMG_2655 2023-11-23 23_23_27.HEIC
4922	PSM.5000.0004.3893	16/05/2025	Electronic File	IMG_2656 2023-11-23 23_23_28.HEIC
4923	PSM.5000.0004.3894	16/05/2025	Electronic File	IMG_2657 2023-11-23 23_23_28.HEIC
4924	PSM.5000.0004.3895	16/05/2025	Electronic File	IMG_2658 2023-11-23 23_23_28.HEIC
4925	PSM.5000.0004.3896	16/05/2025	Electronic File	IMG_2660 2023-11-23 23_23_32.HEIC
4926	PSM.5000.0004.3897	16/05/2025	Electronic File	IMG_2661 2023-11-23 23_23_34.HEIC
4927	PSM.5000.0004.3898	16/05/2025	Electronic File	IMG_2662 2023-11-23 23_23_35.HEIC
4928	PSM.5000.0004.3899	16/05/2025	Electronic File	IMG_2663 2023-11-23 23_23_37.HEIC
4929	PSM.5000.0004.3900	16/05/2025	Electronic File	IMG_2664 2023-11-23 23_23_39.HEIC
4930	PSM.5000.0004.3901	16/05/2025	Electronic File	IMG_2665 2023-11-23 23_23_40.HEIC
4931	PSM.5000.0004.3902	16/05/2025	Electronic File	IMG_2667 2023-11-23 23_23_41.HEIC
4932	PSM.5000.0004.3903	16/05/2025	Electronic File	IMG_2668 2023-11-23 23_23_41.HEIC
4933	PSM.5000.0004.3904	16/05/2025	Electronic File	IMG_2669 2023-11-23 23_23_41.HEIC
4934	PSM.5000.0004.3905	16/05/2025	Electronic File	IMG_2670 2023-11-23 23_23_43.HEIC
4935	PSM.5000.0004.3906	16/05/2025	Electronic File	IMG_2671 2023-11-23 23_23_44.HEIC
4936	PSM.5000.0004.3907	16/05/2025	Electronic File	TH000009 2023-11-23 23_22_58.JPG
4937	PSM.5000.0004.3908	16/05/2025	Electronic File	TH000010 2023-11-23 23_22_58.JPG
4938	PSM.5000.0004.3909	16/05/2025	Electronic File	TH000011 2023-11-23 23_23_03.JPG
4939	PSM.5000.0004.3910	16/05/2025	Electronic File	TH000012 2023-11-23 23_23_03.JPG
4940	PSM.5000.0004.3911	16/05/2025	Electronic File	TH000013 2023-11-23 23_23_13.JPG
4941	PSM.5000.0004.3912	16/05/2025	Electronic File	TH000014 2023-11-23 23_23_29.JPG
4942	PSM.5000.0004.3994	16/05/2025	Electronic File	PSM5226-0070 PSEP SIGNED.pdf
4943	PSM.5000.0004.3995	16/05/2025	Electronic File	PSM5226-0080 SWMS SIGNED.pdf
4944	PSM.5000.0004.4001	16/05/2025	Electronic File	PSM5226-0190 SWMS.pdf
4945	PSM.5000.0004.4007	16/05/2025	Electronic File	PSM5226-017E FIGURE 1.pptx
4946	PSM.5000.0004.4008	16/05/2025	Electronic File	PSM5226-0140 Expert Rectification meeting notes.docx
4947	PSM.5000.0004.4010	16/05/2025	Electronic File	PSM5226-0140.pdf
4948	PSM.5000.0004.4013	16/05/2025	Electronic File	Appendix A Letter dated 9 November 2023.pdf
4949	PSM.5000.0004.4015	16/05/2025	Electronic File	Appendix B Additional Instructions.pdf
4950	PSM.5000.0004.4017	16/05/2025	Electronic File	Appendix C CV Dane Pope_2023.pdf

Count	Document ID	Document Date	Document Type	Title
4951	PSM.5000.0004.4022	16/05/2025	Electronic File	Appendix D Radar Imagery.pdf
4952	PSM.5000.0004.4024	16/05/2025	Electronic File	Appendix F AerialStreet Imagery.pdf
4953	PSM.5000.0004.4031	16/05/2025	Electronic File	Appendix E Selected Site Photographs.pdf
4954	PSM.5000.0004.4039	16/05/2025	Electronic File	Figure 1.pdf
4955	PSM.5000.0004.4040	16/05/2025	Electronic File	F1.pdf
4956	PSM.5000.0004.4041	16/05/2025	Electronic File	F2.pdf
4957	PSM.5000.0004.4042	16/05/2025	Electronic File	F3.pdf
4958	PSM.5000.0004.4043	16/05/2025	Electronic File	F4.pdf
4959	PSM.5000.0004.4044	16/05/2025	Electronic File	PSM5226-006R.pdf
4960	PSM.5000.0004.4106	16/05/2025	Electronic File	PSM5226-006R.docx
4961	PSM.5000.0004.4144	16/05/2025	Electronic File	PSM5226 - Appendix D.xlsx
4962	PSM.5000.0004.4145	16/05/2025	Electronic File	PSM5226 - Appendix E.xlsm
4963	PSM.5000.0004.4157	16/05/2025	Electronic File	PSM5226 - Appendix F.xlsm
4964	PSM.5000.0004.4167	16/05/2025	Electronic File	Appendix C Radar.pdf
4965	PSM.5000.0004.4169	16/05/2025	Electronic File	Appendix D.pdf
4966	PSM.5000.0004.4177	16/05/2025	Electronic File	Appendix E.pdf
4967	PSM.5000.0004.4184	16/05/2025	Electronic File	PSM5226-006R DRAFT.docx
4968	PSM.5000.0004.4218	16/05/2025	Electronic File	Appendix C Figures.xlsx
4969	PSM.5000.0004.4219	16/05/2025	Electronic File	PSM5226-006R DRAFT.pdf
4970	PSM.5000.0004.4220	16/05/2025	Electronic File	PSM5226 - Appendix C.xlsm
4971	PSM.5000.0004.4234	16/05/2025	Electronic File	PSM5226 - Appendix D.xlsm
4972	PSM.5000.0004.4248	16/05/2025	Electronic File	PSM5226 - Appendix E.xlsm
4973	PSM.5000.0004.4260	16/05/2025	Electronic File	Appendix A - Brief.pdf
4974	PSM.5000.0004.4263	16/05/2025	Electronic File	Appendix B - CV.pdf
4975	PSM.5000.0004.4268	16/05/2025	Electronic File	Appendix C - Select Site Photographs.pdf
4976	PSM.5000.0004.4276	16/05/2025	Electronic File	PSM5226-005R.docx
4977	PSM.5000.0004.4315	16/05/2025	Electronic File	PSM5226-005R.pdf
4978	PSM.5000.0004.4367	16/05/2025	Electronic File	Appendix D - Aerials.pdf
4979	PSM.5000.0004.4371	16/05/2025	Electronic File	PSM5226-005R DRAFT.docx
4980	PSM.5000.0004.4410	16/05/2025	Electronic File	PSM5226-005R DRAFT.pdf
4981	PSM.5000.0004.4462	16/05/2025	Electronic File	Appendix A2 Andrew Wilson_2023.pdf
4982	PSM.5000.0004.4466	16/05/2025	Electronic File	PSM5226-004L.docx
4983	PSM.5000.0004.4470	16/05/2025	Electronic File	PSM5226-004L Budget.xls
4984	PSM.5000.0004.4471	16/05/2025	Electronic File	PSM5226-004L.pdf
4985	PSM.5000.0004.4472	16/05/2025	Electronic File	PSM5226-003L Budget.xls
4986	PSM.5000.0004.4473	16/05/2025	Electronic File	PSM5226-003L.docx
4987	PSM.5000.0004.4477	16/05/2025	Electronic File	PSM5226-003L.pdf
4988	PSM.5000.0004.4478	16/05/2025	Electronic File	PSM5226 - Risk Assessment REV 1.xlsx
4989	PSM.5000.0004.4479	16/05/2025	Electronic File	PSM5226-002L - Appendix A.pdf
4990	PSM.5000.0004.4484	16/05/2025	Electronic File	PSM5226-002L - Appendix A Figures.xlsx
4991	PSM.5000.0004.4485	16/05/2025	Electronic File	PSM5226-002L - Appendix B.pdf
4992	PSM.5000.0004.4493	16/05/2025	Electronic File	PSM5226-002L - Appendix B Photos.xlsm
4993	PSM.5000.0004.4506	16/05/2025	Electronic File	PSM5226-002L - Appendix C.pdf
4994	PSM.5000.0004.4508	16/05/2025	Electronic File	PSM5226-002L Rev1.docx
4995	PSM.5000.0004.4529	16/05/2025	Electronic File	PSM5226-002L Rev1.pdf
4996	PSM.5000.0004.4564	16/05/2025	Electronic File	Appendix A1 PSM5226-002L_ Figures first three pages only
4997	PSM.5000.0004.4569	16/05/2025	Electronic File	Appendix A2 PSM5226-002L_ Figures A4 A5.pdf
4998	PSM.5000.0004.4571	16/05/2025	Electronic File	Appendix A1 PSM5226-002L_ Figures first three pages.pdf
4999	PSM.5000.0004.4574	16/05/2025	Electronic File	Appendix A PSM5226-002L_ Figures.xlsx
5000	PSM.5000.0004.4575	16/05/2025	Electronic File	Appendix B PSM5226 - Risk Assessment.pdf
5001	PSM.5000.0004.4576	16/05/2025	Electronic File	PSM5226-002L.docx
5002	PSM.5000.0004.4593	16/05/2025	Electronic File	PSM5226-002L.pdf
5003	PSM.5000.0004.4616	16/05/2025	Electronic File	PSM5226-001L Rev1.docx
5004	PSM.5000.0004.4621	16/05/2025	Electronic File	PSM5226-001L Rev1.pdf
5005	PSM.5000.0004.4622	16/05/2025	Electronic File	Appendix A Dane Pope_2023.docx

Count	Document ID	Document Date	Document Type	Title
5006	PSM.5000.0004.4627	16/05/2025	Electronic File	PSM5226-001L.docx
5007	PSM.5000.0004.4632	16/05/2025	Electronic File	PSM5226-001L.pdf
5008	PSM.5000.0004.4633	16/05/2025	Electronic File	108 Base Map.tif.aux.xml
5009	PSM.5000.0004.4634	16/05/2025	Electronic File	108 Base Map_modified.tif.aux.xml
5010	PSM.5000.0004.4636	16/05/2025	Electronic File	108 Base Map_modified.tif

Expert Report – Phillip Hitchcock
Board of Inquiry, McCrae Landslide
Date Issued: 21 July 2025



Attachment 5 – GRR report

Groundwater Resource Report

Groundwater catchment: East Port Phillip Bay

VICGRID94 Easting: 2494313 Northing: 2350552

Depth to water table: 20 - 50m

Water table salinity (mg/L): 1001 - 3500

Groundwater layers (Aquifers and Aquitards)	Depth below surface (m)	Groundwater salinity (mg/L)
QA Quaternary Aquifer sand, gravels, clay, silts	0 - 6	Unknown
LTA Lower Tertiary Aquifer sand, gravel, clay and silt, minor coal	6 - 7	Unknown
BSE Mesozoic and Palaeozoic Bedrock (basement) sedimentary (fractured rock): Sandstone, siltstone, mudstone, shale. Igneous (fractured rock): includes volcanics, granites, granodiorites.	7 - 207	1001 - 3500

There are no GMUs at this location

For further information about this report contact:

Department of Environment, Land, Water & Planning

Email: ground.water@delwp.vic.gov.au

For further information on groundwater licensing in this area contact:

Southern Rural Water Corporation

Phone: 1300 139 510

Email: srw@srw.com.au

Website: www.srw.com.au

Disclaimer

This publication may be of assistance to you but the State of Victoria and its employees do not guarantee that the publication is without flaw of any kind or is wholly appropriate for your particular purposes and therefore disclaims all liability for any error, loss or other consequence which may arise from you relying on any information in this publication.

Printed: 15 July 2025

Date Updated: 11 January 2019



Environment,
Land, Water
and Planning

How to read this report

Introduction

Groundwater is part of the water cycle. When rain or snow falls on land, some of it evaporates, some flows to streams and rivers, and some seeps into the soil. Some of the water in the soil is used by plants but some continues to move down through the soil and rock until all the pores and cracks are full of water. This is known as the water table and this water is called groundwater.

Groundwater is a finite resource that, like surface water, is allocated under the Water Act (1989). A Bore Construction Licence is required to drill for groundwater including for domestic and stock purposes. Taking and using groundwater for commercial or irrigation purposes requires an additional licence.

Purpose of this report

This report has been prepared to provide potential groundwater users with basic information about groundwater beneath their property. This includes the different geological layers, the depths of the layers and the salinity of groundwater in the layers. Information on the groundwater management units (GMU) and any associated caps on the volume that can be licensed (the PCV) are also provided.

Definitions and context

Term	Description
Groundwater Catchment	An identified area of the State within which groundwater resources are connected.
Easting / Northing	The VICGRID 94 coordinates of the spot that was selected on the interactive map.
Groundwater Salinity	Indicates the possible concentration of salts within the groundwater. The salt content indicates the possible uses of the water (see the Beneficial Use Table below). Fertilisers and other contaminants can also enter groundwater and affect its use. It is up to you to make sure that the groundwater you use is suitable for your purpose.
Aquifer	An aquifer is a layer of soil or rock which stores usable volumes of groundwater. Aquifers are generally limestones, gravels and sands, as well as some fractured rocks where the cracks in the rock are open and connected (some basalts, sandstones and limestones). How much water can be pumped from an aquifer depends on how much water is stored in pores and cracks, how well connected the pores and cracks are, and how thick the layer is. It is more likely that volumes of water for irrigation and urban water supply will come from gravels, sands, limestones and basalts that are at least 30 metres thick. Low volumes of water for domestic and stock use are likely from any aquifer greater than 10 metres thick. The advice above is a guide only, as the amount of water available can be highly variable. Actual pumping volumes can only be determined from drilling, appropriate construction and testing of a bore.
Aquitard	An aquitard is a layer of rock or soil that does not allow water to move through it easily, limiting its capacity to supply water. Aquitards are generally silts, clays and fractured rocks (where there are few cracks in the rock or the cracks are poorly connected).
Groundwater Management Unit (GMU)	A collective term for groundwater management areas (GMAs) and water supply protection areas (WSPAs). GMAs and WSPAs are defined areas and depths below the surface where rules for groundwater use may apply. WSPAs often have caps on groundwater use and plans describing how the resource is managed. GMAs usually have caps on groundwater use and may have local plans and rules. All other areas are managed directly through the Water Act (1989). Always check with your local Rural Water Corporation to be sure that the information on the GMU is correct for your specific location.
Permissible Consumptive Volume (PCV)	A cap that is set under the Water Act (1989) declaring the total volume of groundwater that may be taken from the area. Once the PCV is reached, no additional extraction can be licensed for use within the area unless traded from another groundwater licence holder.
Depth to Water Table	This is an indication of the depth at which groundwater might first be encountered when drilling a bore. The depth can vary from year to year, and from place to place and may vary significantly from that indicated in this report.

Beneficial Use Table

Salinity range (mg/L TDS)	Beneficial use as described by State Environment Protection Policy (Groundwaters of Victoria) s160							
	Potable water - preferred	Potable water - acceptable	Potable mineral water	Irrigation	Stock water	Industry	Ecosystem protection	Buildings and structures
<500	✓	✓	✓	✓	✓	✓	✓	✓
501-1000		✓	✓	✓	✓	✓	✓	✓
1001-3500			✓	✓	✓	✓	✓	✓
3501-13000					✓	✓	✓	✓
13001+						✓	✓	✓

Accessibility

If you would like to receive this publication in an alternate format, please telephone or email the DELWP Customer Service Centre 136 186, email customer.service@delwp.vic.gov.au, or via the National Relay Service on 133 677 www.relayservice.com.au.

© The State of Victoria Department of Environment, Land, Water & Planning 2019

This publication is copyright. No part may be reproduced by any process except in accordance with the provisions of the Copyright Act 1968.

Disclaimer

This publication may be of assistance to you but the State of Victoria and its employees do not guarantee that the publication is without flaw of any kind or is wholly appropriate for your particular purposes and therefore disclaims all liability for any error, loss or other consequence which may arise from you relying on any information in this publication.

Printed: 15 July 2025

Date Updated: 11 January 2019



Environment,
Land, Water
and Planning